

Technical Report Documentation Page

1. Report No. RC-1605	2. Government Accession No.	3. MDOT Project Manager	
4. Title and Subtitle Twenty Year Performance Review of Michigan's European Concrete Pavement		5. Report Date October 7, 2013	
		6. Performing Organization Code	
7. Author(s) John F. Staton		8. Performing Org. Report No.	
9. Performing Organization Name and Address Michigan Department of Transportation Construction Field Services Division P.O. Box 30049 Lansing, MI 48909		10. Work Unit No. (TRAIS)	
		11. Contract No.	
		11(a). Authorization No.	
12. Sponsoring Agency Name and Address Michigan Department of Transportation Construction Field Services Division P.O. Box 30049 Lansing, MI 48909		13. Type of Report & Period Covered	
		14. Sponsoring Agency Code	
15. Supplementary Notes			
<p>16. Abstract</p> <p>In 1993, a special pavement demonstration project was constructed in Detroit on NB I-75 to evaluate the design features of some highly acclaimed European rigid pavements. The Michigan Department of Transportation (MDOT) and the Federal Highway Administration (FHWA) agreed to this project after an extensive inquiry of European pavements, including a 1992 technical tour of pavements in Germany and Austria to gain insight into their specific design features and construction practices for duplication with the Detroit project. MDOT has monitored the project's performance for the past twenty years since construction. The results from the I-75 European project continue to generate nationwide interest amongst pavement enthusiasts.</p> <p>This report is a compilation of the condition data of the Euro-pavement since its construction. Because MDOT considered this demonstration project a valuable research opportunity, a rigid pavement "control section" was included on NB I-75 adjacent to the one-mile long Euro-pavement. The control section represented MDOT's standard rigid pavement design used during that era. This report also documents preservation contract work performed on both pavement sections in 2008 to repair pavement distress to extend their respective service lives. The report also describes investigative work into the cause of the distress that initiated the 2008 preservation project, as well as investigation of further distress observed in the Euro-pavement section since 2008.</p> <p>Today, both pavements have relatively similar ride quality values (RQI/IRI). The Euro-pavement section, however, is showing signs of surface delamination which appears to be originating at the transverse joints and propagating outward toward mid-slab, as well as intermittent longitudinal cracking in the right wheel path. A distinct performance trend has not yet developed for either pavement section to estimate a definitive service life expectancy. In the interim, MDOT has benefited from the project by using its limited results to enhance its present rigid pavement design in efforts to extend its service life.</p>			
17. Key Words		18. Distribution Statement No restrictions. This document is available to the public through the Michigan Department of Transportation.	
19. Security Classification - report Unclassified	20. Security Classification - page Unclassified	21. No. of Pages 51	22. Price

**MICHIGAN DEPARTMENT OF TRANSPORTATION
MDOT**

**Twenty Year Performance Review of Michigan's European
Concrete Pavement**

John F. Staton

**Construction Field Services Division
Research Report**

**Michigan Transportation Commission
Jerrold Jung, Chairman
Todd Wyett, Vice Chairman
Lynn Afendoulis, Commissioner
Charles Moser, Commissioner
Michael Hayes, Commissioner
Kirk T. Steudle, Director
Lansing, Michigan
October 2013**

TABLE OF CONTENTS

Executive Summary.....	1
Introduction.....	2
Project Background.....	3
European Pavement Features.....	3
Michigan Pavement Features.....	6
Performance History.....	7
Historical Condition Data.....	8
2006 Pavement Condition.....	11
2008 Preventative Maintenance Project.....	18
Summary Review and Conclusions.....	21
Changes in MDOT Typical Concrete Designs.....	22
Cost Differences.....	23
2011 MDOT Field Investigation.....	23
Appendix.....	28

LIST OF TABLES

Table 1	Historical Pavement Distress Index	9
Table 2	Historical Summary of Ride Quality.....	10
Table 3	Historical Summary of Friction Numbers	11
Table 4	Partial-Depth Repairs for Euro-Pavement 2008 Preventative Maintenance Project	20
Table 5	European Pavement Repair Options 2011 MDOT Field Investigation	25

LIST OF FIGURES

Figure 1	European Demonstration Project Location.....	2
Figure 2	European Pavement Section	4
Figure 3	Exposed-Aggregate Surface.....	5
Figure 4	Michigan Pavement Cross Section	6
Figure 5	Typical Longitudinal Crack with Euro-Pavement	12
Figure 6	Contrast in Crack Width per Depth of Euro-Pavement Longitudinal Crack	13
Figure 7	Beginning Spall of Euro-Pavement	14
Figure 8	Spall on Both Sides of Traverse Joint of Euro-Pavement.....	15
Figure 9	High Severity Spall/Delamination of Euro-Pavement.....	15
Figure 10	Exposed Lean Concrete Base of Euro-Pavement	21
Figure 11	2012 Pavement Condition – Spall at Traverse Joint.....	24
Figure 12	2012 Pavement Condition – High Severity Spall at Traverse Joint.....	24

EXECUTIVE SUMMARY

In 1993, a special demonstration project was constructed in Detroit on NB I-75 (Chrysler Freeway) to present some highly acclaimed features of European rigid pavements to pavement practitioners in the United States. The Federal Highway Administration (FHWA) and the Michigan Department of Transportation (MDOT) collaborated on the project to learn whether the unique features of European rigid pavements could be adapted cost-effectively to enhance the performance of more conventional pavement designs used in the United States. MDOT included the special one-mile long 'Euro-pavement' in a project to reconstruct I-75 from I-375 N'ly to north of the I-94 interchange in northwest Detroit. The pavement portion of NB I-75 directly south of the Euro-pavement has been used since construction as a Michigan 'control section' to compare its performance with the Euro-pavement.

This report summarizes the performance of the Euro-pavement and the Michigan control section pavement since their construction twenty years ago. The European demonstration project still generates enthusiasts nationwide who actively follow its performance. This report also documents preservation repairs made to both pavements during a 2008 preventive maintenance project, discusses results from earlier field investigations in 2007 that looked for a cause for the pavement distress to be repaired, and also summarizes a field investigation conducted by MDOT in 2011 to explore strategies to remediate the distress that has accelerated since 2008 in the Euro-pavement section.

To date there is no clear indication as to which pavement section will eventually achieve the most cost-effective service life. The Euro-pavement's initial construction cost was more than twice the cost of the Michigan pavement section, which can be mostly attributed to its special features (exposed aggregate texture, structural enhancements). Today, both pavements have a low distress index and similar ride quality values (RQI/IRI). The Euro-pavement section, however, is showing signs of surface delamination which appears to be originating at the transverse joints and propagating outward toward mid-slab, as well as intermittent longitudinal cracking in the right wheel path. But, a distinct performance trend has not developed for either pavement section to estimate a definitive service life expectancy. Considering its substantial initial cost factor, the future preservation cost of the Euro-pavement will need to be much lower than the Michigan pavement section to be cost equivalent for its service life.

In the interim period, the project results have fortified some changes MDOT has made in designing and constructing rigid pavements to improve their long-term performance. The changes include a design shift to JPCP from JRCP that was made shortly after the project during the mid-1990s. And, improvements have been made to enhance concrete pavement mixtures and their construction placement procedures for quality control and acceptance.

1.0 INTRODUCTION

In 1993, the Michigan Department of Transportation (MDOT) and the Federal Highway Administration (FHWA) fulfilled an agreement to construct and evaluate a rigid pavement that assimilated unique European design features. MDOT included the special pavement section, known as the “European Pavement”, as part of the reconstruction of NB I-75 (IM 82251-30613A) that occurred during the fall of 1993. Figure 1 shows the Euro-pavement location, which is northwest of downtown Detroit. This report updates its performance after twenty years of service and includes documentation of contracted maintenance repairs performed in 2008.

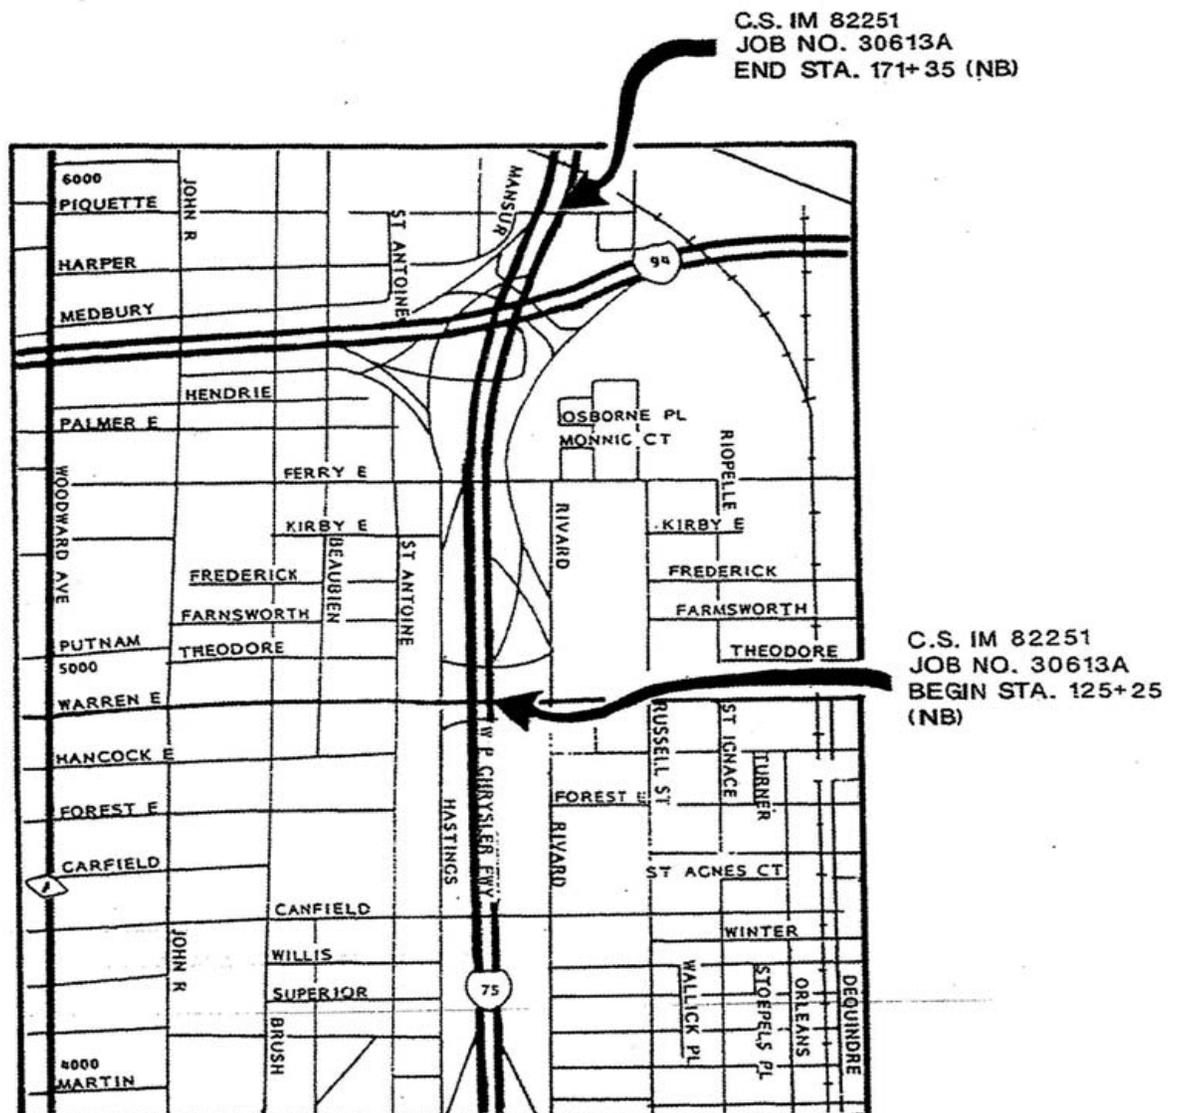


FIGURE 1. European Demonstration Project Location

2.0 PROJECT BACKGROUND

In early 1992, the FHWA conducted a technical tour of several European countries to gain insight into their design and construction practices of concrete (rigid) pavements. The tour found¹ that European countries are designing and constructing excellent concrete pavements for heavier truck loadings than are allowed in the United States. The European countries generally emphasize a long service life by using quality materials and stringent construction practices and tend to have less concern for the resulting initial cost increases from those practices.

The findings from the FHWA technical tour encouraged a subsequent technical tour² in October 1992, which included MDOT representatives. The tour's purpose was to review design and construction techniques in Germany and Austria for application with U.S. projects, which began with Michigan's I-75 demonstration project in Detroit.

Michigan's "European Pavement" demonstration project was constructed from July to November 1993. The approximately one-mile long project is located on NB I-75 (Chrysler Freeway) between Warren Ave. and Piquette Ave., which includes the interchange with I-94. The portion of NB I-75 directly south of the Euro-pavement was also reconstructed at the same time (same contract) using MDOT's concrete pavement design from that time period (see section 2.2). Its performance has been contrasted with the Euro-pavement since their mutual construction. The details of both pavement's design features and construction results are documented in previously published reports³ by MDOT and the FHWA.

A summary reminder of the Michigan and Euro-pavement's design features and construction are provided in this report. Greater detail, including as-constructed results, can be found in the cited references.

2.1 European Pavement Features

The Euro-pavement's structural layer thicknesses and material characteristics were dictated from the German design catalog for the climatic, soil and traffic conditions similar to Detroit. The typical section is 3-4 lanes wide with the outer pavement slabs widen to 13.5' from the conventional 12' width. Figure 2 is a schematic of the Euro-pavement's cross section.

¹ "Report on the 1992 US Tour of European Concrete Highways", US Tech, Sponsors were: AASHTO, ACPA, FHWA, PCA, SHRP, TRB

² "European Concrete Pavement Tour", Michigan Department of Transportation, November 1992, authors Roger D. Till and Randy VanPortfliet

³ "Construction of European Concrete Pavement on Northbound I-75 – Detroit, Michigan", Michigan Department of Transportation, Report No. R-1333, September 1994.

"Demonstration Project No. 75 - Michigan Demonstration Project I-75 Detroit, Michigan", Federal Highway Administration, March 1994.

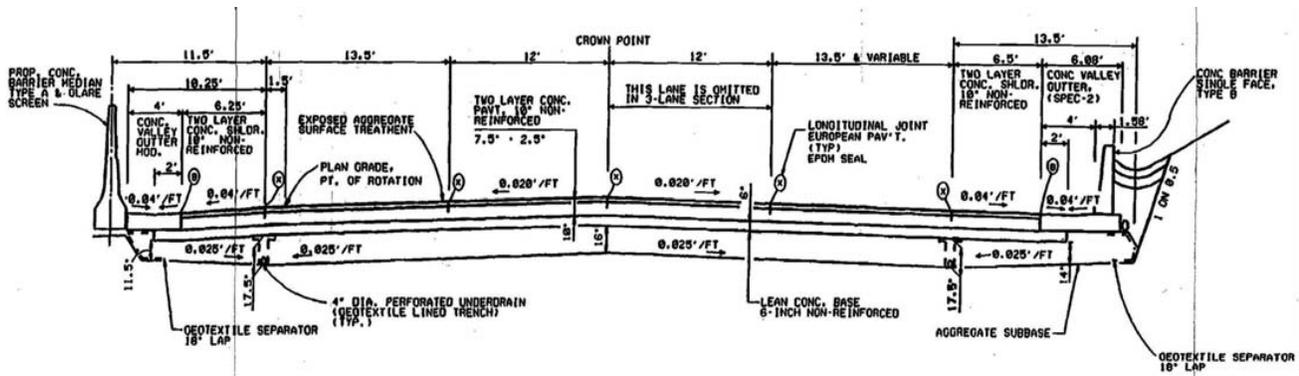


FIGURE 2. European Pavement Cross Section NB I-75

Subgrade and Subbase

Sound, uniform structural support is highly emphasized with European designs. Thus, the Euro-pavement was designed accordingly. The local subgrade soil is a lacustrine silty clay. During construction, after the complete removal of the old I-75 pavement structure, it was thoroughly inspected for potential frost heaving and compaction was held to a minimum 95% of its maximum unit weight. A crushed limestone was used to construct the 16" thick (two 8" lifts) aggregate subbase. A well-graded gradation (low permeability) was specified to comply with the German protocol. Compaction was required to be a minimum 100% of its maximum unit weight.

Lean Concrete Base

The six-inch thick lean concrete base (LCB) lies on the aggregate subbase. The specified 2500 psi design strength was easily achieved. The mix design used a Type I Portland Cement (420lbs./cyd) from LaFarge Corp., a natural sand fine aggregate, and a crushed limestone (ASN 71-47) coarse aggregate. The non-reinforced slab had sawed transverse relief cuts (0.4D) at 15' joint spacing that match location with the joint pattern in the two-layer, concrete surface pavement.

Two-layer Concrete Surface Pavement

The ten-inch thick surface pavement consists of two-layers (placed wet on wet) using different concrete mixtures. The bottom layer is a nominal 7 1/2" thick, while the top layer is 2 1/2" thick. Separate batching facilities and delivery equipment were used to coordinate each concrete mixture. Verification coring during construction found the top and bottom layer thickness to be highly variable, but the overall slab thickness held to the ten-inch target.

The same sources for cement and aggregate used for the lean concrete base were also used to construct the surface pavement, except the coarse aggregate for the top layer was changed. A crushed basalt stone (ASN 95-10) was used to meet the wear (polishing) requirements of the exposed aggregate surface. The aggregate was essentially one size with a top size of 1/3" (8mm). Coarse 2NS sand filled the gradation gaps. The strength requirements for the layers were 5500 psi top-layer and 5000 psi bottom-layer. Compressive strength was mostly achieved without difficulty, but some top-layer areas had low strength with corresponding high total air content (ASTM C-457). Coring found no evidence of a cold joint between the two surface layers. Some partial bonding with the lean concrete base was also confirmed. Bonding between the LCB and the two-layer pavement was neither promoted, nor discouraged.

Exposed Aggregate Surface

The pavement surface has an exposed aggregate texture that is intended to reduce tire interaction noise and improve frictional characteristics. The construction process followed a patented procedure (International Patent No. 0086188) that was developed by Robuco Ltd, of Belgium. Briefly, the freshly placed concrete was sprayed with a set retarder and then covered with two-mil plastic sheeting. The sheeting was removed the next day (after 20 hrs.) and the surface was brushed to expose the coarse aggregate. An average texture depth of about 1.0 mm was achieved, which was less than the intended target value of 1.1 to 1.5mm. Figure 3 shows a typical photo example of the present texture condition. To date, there has been minimal loss of exposed stone.



FIGURE 3. Exposed Aggregate Surface

Transverse and Longitudinal Joints

Contraction joint spacing was 15' that matches the relief cuts in the LCB. Expansion joints were installed only at the ending limits of the Euro-pavement. The 20" long by 1 ¼" diameter dowel bars (transverse joint) were polyethylene coated. Except for the median lane, the bar spacing was reduced (0.8') in the slab's wheel path. This complies with the German protocol due to their much higher truck axle load limits to maintain sufficient load transfer capability. In addition, the number of bars in the wheel path was reduced in each lane (outside to median) as over time truck loading replications are assumed to be less for inner travel lanes. The shoulder joints also have load transfer dowels. Dowel basket assemblies were used to assure proper dowel alignment.

The longitudinal joints also match location with those in the LCB. Each joint has four uniformly spaced tie bars for each 15' slab. The bars are epoxy-coated deformed steel, 32" long by 7/8" diameter, installed at mid-depth.

Both the transverse and longitudinal joint reservoirs were sealed with a special preformed Ethylene Propylene Diene Terpolymer (EPDM) seal. There are supposed advantages of using EPDM seals in lieu of traditional neoprene compression seals. The joint cavity need only be clean, not dry, and there is no need for adhesives. EPDM is also supposed to be more resistant to adverse materials, like oil drippings from vehicles and winter de-icing chemicals.

2.2 Michigan Pavement Features

The Michigan pavement on NB I-75 is a conventional jointed-reinforced concrete pavement (JRCP) that lies directly south of the Euro-pavement. Since construction it has served as the "control section" to compare performance results over time with the Euro-pavement. Figure 4 shows the Michigan pavement cross section. The slab thickness was 11" with mesh reinforcement. The contraction joint spacing was 41'. For load transfer the contraction joints have epoxy-coated, uniformly spaced, 1-1/4" x 18" steel dowels. The concrete shoulders are similarly reinforced with a matching joint spacing.

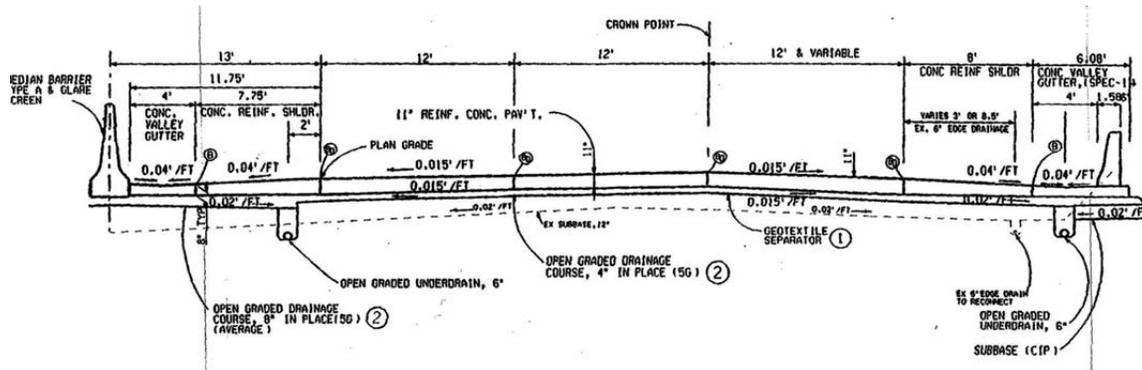


FIGURE 4. Michigan Pavement Cross Section NB I-75

The reconstruction of SB I-75, directly adjacent (same contract ending limits) to the Euro-pavement and Michigan pavement section, was also part of the contract work. It was re-built the following year in 1994. A contract revision was made to modify the southbound portion by shortening the transverse contraction joint spacing to 27'⁴ from the 41' that was used for the NB direction. SB I-75 has not been directly involved in the performance comparison with the Euro-pavement, but still is an interesting pavement section, by itself.

The aggregate for the open-graded drainage course (OGDC) was a Michigan series 5G gradation that was made by crushing the old I-75 concrete pavement. The OGDC is stabilized with Portland cement at 6%, by weight of the aggregate. A geotextile (non-woven fabric) separates

⁴ The Michigan DOT during this time period was using both joint spacings for JRCP depending upon the amount of anticipated truck traffic to correspond with the potential for transverse cracks developing. The change was made to 27' on SB I-75 to allow a comparison in performance to take place. All other design features and material sources remained the same with NB I-75.

the OGDC from the 12" thick sand subbase (original to I-75). During construction, however, the geotextile was inadvertently placed across the shoulder drain trench as the plan cross section drawing was misinterpreted. The drain type matches the Euro-pavement, but its location is under the shoulder, two-foot from the longitudinal joint.

The design requirements for the concrete mixture were; a 3500 psi (28 day) compressive strength, 650 psi (28 day) flexure strength, 3" max. slump, 550lbs/cyd min. Portland cement content, and a maximum 0.50 w/c ratio. The Euro-pavement and the Michigan section used the same coarse aggregate (carbonate⁵). The Michigan pavement surface texture is transverse tinned (non-skew) at a nominal 3/4" spacing with some intended randomness.

3.0 PERFORMANCE HISTORY

MDOT and FHWA agreed to closely monitor the performance of the Euro-pavement for the first five years after its construction. A yearly performance report⁶ was prepared by MDOT for the project's first three years. After about five years MDOT contracted with Michigan State University (MSU) to conduct a study⁷ to evaluate the cost effectiveness of both pavement sections by comparing their respective construction costs and any detectable performance trends that may have occurred since construction.

The MSU study found that condition data since construction showed no apparent trend for either pavement type to predict a clear outcome for their eventual service life duration. As an alternative, MSU used MDOT's maintenance schedule⁸ for concrete pavement and their respective construction (bid item) costs for a hypothetical economic comparison. That analysis concluded the Euro-pavement's initial capital cost⁹ could not exceed that of the conventional Michigan pavement cost by approximately 17% for both pavement types to be considered equivalent on an annualized cost basis.

⁵ The project specified a coarse aggregate with high durability requirements with a maximum dilation value of 0.008 percent per 100 freeze-thaw cycles per MTM 115. The aggregate sampling and acceptance requirements were also modified for this project and applied to both pavements.

⁶ MDOT published the following three reports:

Report No. R-1338 – "First Year Performance of the European Concrete Pavement on Northbound I-75, Detroit, Michigan" February 1995.

Report No. R-1343 – "Second Year Performance of the European Concrete Pavement on Northbound I-75, Detroit, Michigan" June 1996.

Report No. unknown – "Third Year Performance of the European Concrete Pavement on Northbound I-75, Detroit, Michigan" March 1997.

⁷ Report No. RC-1381 – "Cost Effectiveness of European Demonstration Project: I-75 Detroit" May 2000.

⁸ MDOT uses an assumed schedule of needed preventive maintenance treatments during a pavement's service life, which is estimated at 35 years. Each treatment action is intended to add service life. During design for pavement type selection, the life/cycle cost of equivalent flexible and concrete pavements are compared, if the pavement cost exceeds one million dollars. The type with the lowest cost is selected.

⁹ The construction cost (using only pavement pay items) per unit area of the Euro-pavement was about 2 1/2 times the cost of the Michigan section. The Euro-pavement cost included special features (exposed texture, joint seals, LCB) and adjustments to the paving schedule which inflated its overall project cost.

3.1 Historical Condition Data

The primary performance parameters for comparing the Euro-pavement and Michigan section have been surface distress characteristics, ride quality and surface friction. The following discussion is an update from the last (3rd year - 1997) MDOT performance report. Current directional daily traffic is approximately 73,500 vehicles with 7% commercial volume. MDOT's Pavement Management System (PMS) data files are the exclusive source for the following data.

Surface Distress

Michigan combines the extent and severity of surface distress features to create a “distress index (DI)” value. A newly constructed pavement has a DI equal to zero. When the pavement's condition reaches a DI value of 50, preventive maintenance treatments are no longer considered to be cost effective to extend service life. Hence, major rehabilitation or reconstruction becomes the only cost-effective option. A DI value is created for each 1/10 mile increment of pavement.

Freeway pavements, like I-75, are surveyed every other year. The right outside lane in each travel direction is normally selected for distress measurements, which are done at normal traffic speed by video taping the pavement's surface. The tapes are later reviewed to capture any distress features.

Table 1 is the historical summary of the pavement's DI for the Michigan and European pavements since construction. The latest available data are for 2011. The data shows the pavement's average DI has not changed significantly for either type through 2007. However, the average DI values for 2009 and 2011 indicates the possible beginning of the trend toward increased levels of surface distress for the Euro-pavement section.

<u>DI Values</u>	<u>Rating</u>
0 – 25	Good
26 – 49	Fair
50 or Greater	poor

Year	European Section		Michigan Section (Control)	
	DI Average	DI Range	DI Average	DI Range
1995	1	0-4	<1	0-1
1997	2	0-14	<1	0-2
1999*	1	0-2	<1	0-2
2003*	1	0-2	2	0-4
2005	1	0-1	1	0-3
2007*	2.9	0-11	1	0-4
2009	7.8	2-20	6	3-14
2011	26.7	4-46	3	2-6

Table 1. Historical Pavement Distress Index

*Survey lane changed intermittently within project limits

Ride Quality

Michigan’s PMS reports two measures for ride quality: (1) the Michigan Ride Quality Index (RQI) and (2) the International Roughness Index (IRI), which is the universally accepted method for measuring surface roughness. Although MDOT’s pavement measurement equipment has the capabilities of collecting both RQI and IRI data, the reporting of RQI for construction acceptance was discontinued in January 2008, and in 2010, it was discontinued for pavement management purposes. MDOT currently reports ride quality measurements in terms of IRI.

Michigan’s RQI¹⁰ was developed during the 1970s as part of a department research study. The index correlates a driver’s subjective assessment of the pavement’s ride quality with the longitudinal profile characteristics of the pavement slab. RQI has no units. The rating scale is from 0 (perfect surface) to 100 (roughest surface). When the I-75 project was constructed the following scale was used to judge a pavement in subjective terms:

<u>RQI Value</u> <u>(MDOT)</u>	<u>IRI Value (in./mi.)</u> <u>(RQI Equiv.)</u>	<u>Rating</u>
0-30	0 - 49	Excellent
31-50	50 - 81	Good
51-70	82 - 133	Fair
> 70	> 133	Poor

In 1993 MDOT used ride quality as a measure for pavement acceptance. A project’s RQI value had to be less than 49.8 for acceptance. If the RQI was less than 40.5 a scaled incentive bonus payment was made. Table 2 is the historical summary of the ride quality values for the Michigan standard control and Euro-pavements since their construction.

¹⁰ The 2nd year performance report (No.1343) has more detailed information on the derivation and calculation of Michigan’s RQI.

	European Section		Michigan Section	
Year	RQI Range/avg.	IRI Range/avg.	RQI Range/avg.	IRI Range/avg.
Dec. 1993	30-52/41	73-106/94	30-69/44	44-98/53
Feb. 1995	43-54/47	74-139/102	34-52/43	53-99/72
Feb. 1997	40-50/48	65-105/80	29-54/40	45-90/66
1999	40-57/47	81-122/95	40-58/46	69-104/84
2001*				
2003	42-53/48	80-107/91	32-54/45	72-180/93
2005	40-68/50	80-122/97	37-54/47	65-126/86
2007	46-79/60	79-180/115	43-65/54	66-121/88
2009	50-89/67	80-212/122	40-66/52	63-121/85
2011	49-100/70	79-277/133	41-62/51	64-108/83

Table 2. Historical Summary of Ride Quality

* The 2001 data are not included because they have questionable accuracy due to a change in calculation method. After 2001, a profile for each wheel-path is measured, and then the two values are averaged to calculate the value shown for those years.

Neither pavement shows a definite trend, as the measurements are mixed. The IRI values have tended to increase at a more rapid rate than has RQI. As expected, the quality of ride has declined since construction, but overall is still acceptable.

Surface Friction

A Friction Number (FN) represents the available wet-sliding friction for a pavement surface at a test site. The value is determined using a tow trailer with full size tires in a locked position. Test parameters are in accordance with ASTM E-274. The field test values are converted to equivalent standard FN units using a correlation equation developed at the Field Test and Evaluation Center for Eastern States in East Liberty, Ohio.

Table 3 is a historical summary of FN values since construction for each lane. The November 1993 values were determined prior to traffic opening after paving. The April 1994 values were taken the following spring before SB I-75 traffic was detoured to northbound (two-way traffic) to reconstruct the southbound pavement.

	European Section			Michigan Section		
Date	Lane			Lane		
	1	2	3	1	2	3
Nov. 1993	35	36	42	49	46	44
April 1994	44	42	40	54	53	52
Oct. 1997	33	32	35	44	43	48
July 2000	40-43	35-41	35-36	53-60	45-53	37-50
July 2003	33-37	34-36	32-37	52-52	46-47	39-46
July 2006	39-42	34-42	33-36	55-55	45-49	44-47
Dec. 2012	33-35	28-32	25-30	45-50	35-45	29-45

Table 3. Historical Summary of Friction Numbers

Notes: Values for 1993, 1994, and 1997 are averages for project length. Values since are low and high values for project length. Lane #1 is adjacent to median concrete barrier.

Since the project was opened to normal traffic, the FN values for both pavement surfaces have remained consistent. The Michigan tinned surface has consistently measured higher FN values, in contrast to the European exposed aggregate surface, which has stabilized in the middle 30s. Values in the low 30s are sometimes a possible precursor that more traffic accidents related to wet-sliding may occur, but no such trend has developed to date.

The European exposed aggregate surface was intended to improve friction characteristics versus a traditional tinned surface. Early performance reports pondered reasons why this enhancement did not occur. The most likely possibility focused on the excessive aggregate spacing that increased macro-texture as the most plausible explanation.

4.0 2006 PAVEMENT CONDITION

In 2006, the Metro Region reported that the Euro-pavement was developing longitudinal cracking (LC) and intermittent areas of severe surface spalling. This condition was found during routine field distress reviews of region-wide pavements. A more detailed condition review was made which justified a Capital Preventive Maintenance (CPM) project was needed. The Metro Region scheduled the CPM project for 2008 in conjunction with major bridge rehabilitation work along the I-75 corridor in Detroit. In February 2007, to prepare a fix plan for the CPM project, pavement cores of cracked and un-cracked slabs were made to help determine a cause for the

cracking. The coring was done only in the outside right lane that was closed to traffic. The field report for the February investigative work is included in the appendix.

Euro-Pavement Distress Condition

The LC is intermittent over the project length, but it occurs mostly amongst groups of two and three contiguous slabs. The LC has slight wander and occurs in the right third of the slab width (13.5'), shoulder side of the right wheel-path. It may skip to the next slab with a slight offset at a transverse joint. A picture of a slab with a typical LC is shown in figure 5, when it was replaced. Most LC is occurring in the outside right lane.



FIGURE 5. Typical Longitudinal Crack (LC) with Euro-pavement

The February 2007 coring found the LC to be full-depth through the 10" two-layer, surface pavement. There was no indication that reflective cracking was occurring, as no cracking was found below in the lean concrete base. Where cracks existed, the cores found no bond between these pavement layers, as well as, no indication of scour or erosion at their interface. The crack width was noticeably wider through the carbonate portion of the 10" layer, which would indicate the cracks are occurring bottom-up. Figure 6 is a core which depicts the contrast in crack width between the layers. Where multiple cores were taken in the same panel, the lower crack width was wider near mid-panel, than near a transverse joint.



Figure 6. Contrast in Crack Width per Depth of Euro-Pavement Longitudinal Crack

Areas of surface spalling were also cored. Visually, the spalling is not confined to any particular lane or location within the project limits, but does occur mostly adjacent to joints and cracks. The cores showed the spalling to more resemble a delamination action of the top-course. It appears to be initiating within the depth limits of the top-layer and not at the interface with the carbonate layer. Sounding with a heavy metal rod or hammer produced a classic hollow-thud, indicating internal layer separation. Site inspection of the cores showed the exposed layer depth was poorly consolidated with indication of possible freeze-thaw deterioration. Figure 7 through 9 show a series of picture examples of the severity levels of the surface spalling from a starting condition without breakup to where patching with cold-patch becomes necessary.



FIGURE 7. Beginning Spall of Euro-Pavement
Note: White substance in crack is salt (de-icing) residue.



FIGURE 8. Spall on Both Sides of Transverse Joint of Euro-Pavement



FIGURE 9. High Severity Spall/Delamination of Euro-Pavement

Two consecutive panels without distress were cored near mid-panel to determine if any bond existed with the underlying lean concrete base (LCB). The cores found the layers bonded, such that minor disturbance and handling of the cores did not break the bond.

2007 FHWA Site Visit

In early April 2007, FHWA representatives from Washington and their local Division office conducted a site review of the condition of the Euro-pavement and the Michigan control section to affirm the fix actions for the upcoming CPM project in 2008¹¹. The FHWA field report of their site review is included in the appendix. A summary of findings follows herein.

As in February, the right outside lane of the Euro-pavement was closed to traffic for coring and to provide a closer visual inspection. Two adjacent panels exhibiting typical LC were cored through the cracks and in the adjacent shoulder over the outside drain trench. The cores through the cracks found the same condition as discovered in February. The cracks are full-depth, wider at the bottom, and there is no indication of scour occurring at contact with the LCB. Any bond with the LCB, if it ever existed, was non-existent at this time.

The cores over the drain trench¹² were taken to determine how well the system was functioning. The core exposed the Michigan Series 34R (peastone) backfill. There was no indication that the trench liner may have been inadvertently placed over the backfill during construction. Several gallons of water were continuously poured into the core hole which freely dispersed into the backfill without backup.

At several locations, including the fore-mentioned core location, the drain pipes were inspected for possible obstructions with a video camera used for pipe inspections. The camera inspection began at the drain outlets at catch-basins along the outside edge (valley-gutter) of the shoulder. The camera inspection results were inconclusive. At all eight locations the camera could only enter the drain a short distance from the catch-basin due to severe bends in the 6" diameter corrugated plastic pipe. At most locations water was observed passing through the pipe into the drainage structure.

No coring was done at surface spall/delamination areas as no additional confirmation of their condition was believed warranted. The FHWA recommendation was the delaminated areas should be repaired with traditional partial depth patching methods.

The condition of the Euro-pavement joint seals was also discussed, as they are being considered for replacement during the CPM project. Since construction, the EPDM material has dropped lower in the joint cavity with occasional humping. In many areas the depressed area is significant enough, where debris, incompressibles, and de-icer material can lodge causing possible concrete damage. The review members agreed with MDOT's previous recommendation to replace the EPDM seals with hot-pour rubber sealant, but to leave a group of EPDM seals in-place (see section 5.0) for future comparison.

¹¹ "European Pavement FHWA Site Review", David L. Smiley, April 12, 2007.

¹² The center of the trench is directly below the longitudinal slab/shoulder joint. The 6" diameter pipe lies just above subgrade elevation.

Possible Causes for Distress Deterioration

The Euro-pavement is experiencing two distinct, but independent distress patterns: (1) longitudinal cracking near the right wheel-path and (2) delamination of the exposed aggregate surface layer adjacent to transverse cracks. Findings from the February and April site investigations provide the following plausible explanations:

- Water intrusion between the 10” two-layer surface slab and the LCB is occurring. There are two apparent sources for the water; (1) entry through the longitudinal shoulder joint and (2) internal ground seepage, under head pressure from the adjacent cut slopes¹³. FHWA opinion is that both theories are plausible, but the seepage hypothesis was favored because of the existing site condition¹⁴.
- Water upon entering the interface between the 10” surface slab and LCB, begins to degrade any bond. During winter it freezes, then acting as a fulcrum lifts the outside edge of the 10” surface slab. The lifting action (ice formation) forms a gap (void space) adjacent to the ice formation, leaving that portion of the slab unsupported during truck loading. A tensile stress forms in the area of this gap at the bottom of the slab. From normal fatigue, especially during melting¹⁵, the crack initiates. Over time, the process continues and the crack propagates to the surface and free edge (joint). This postulate is supported by the fact that the LC is wider with depth (bottom-up initiated).
- The LC may also be related to a restrained differential lateral movement between the layers from a varying bond condition and differing thermal gradients with the layers. Here, the LC would initiate along the bond perimeter, working inward from the longitudinal shoulder joint. Water entry at the interface would also exacerbate this action.

As stated, the surface delamination of the exposed aggregate surface layer is easier to explain. The delamination appears to be solely material-moisture related. The joint cavities are retaining water and de-icer (chloride) materials, providing a source for freeze-thaw action and/or degradation of the concrete’s air-void system from infilling. MDOT conducted a petrographic examination and hardened air determination of core samples. The report with results is included in the appendix. The air-void system exhibited post-construction deposits, most likely a carbonate formation that is compromising freeze-thaw resistance. Measured entrained air properties are marginal per PCA guidelines. Although no permeability testing was performed, microscopic examination of the cores and broken pavement fragments indicates the concrete is highly susceptible (permeable) to water entry. The concrete breakup is occurring under traffic loading after internal expansion cracking from freezing action.

Additional testing was done to determine the split tensile strength and the coefficient of thermal expansion (CTE) of the Euro-concrete layers. Three cores (carbonate bottom layer) were tested

¹³ The Euro-pavement section of I-75 is a cut section, typically 10-15’ below street grade.

¹⁴ The back slopes exhibited seepage areas during the April site review. Occasionally, water was also ponding (from likely snow melt) in the grass area at the top of back slope between the service drive. Theory = Water is traveling under a head through the ground, then entering the pavement structure under the shoulder through the aggregate base.

¹⁵ After ice melting, which is likely rapid, the slab’s edge would be precariously unsupported and subjected to high deflections. Whether re-contact between the layers occurs is subject to conjecture.

for split tensile strength. The results were 441, 581 and 664 psi with an average of 562 psi, which meets specification requirements.

The top-layer concrete and the lean concrete base were tested for CTE by the University of Michigan (UM) using their modified version of AASHTO TP60-00. A description of their test modification and a report of the results are in the appendix. The CTE for the carbonate layer was approximately $3.9 \times 10^{-6}/^{\circ}\text{F}$, while the basalt top-layer was $4.5 \times 10^{-6}/^{\circ}\text{F}$. Both are relatively low CTE values for concrete. Their value difference was of interest as a possible distress formation factor, but that is not likely the case with these results.

Michigan Pavement – Condition Comparison

Compared to the Euro-pavement, the Michigan pavement section has no pronounced distress features. The distress condition of the JRCP section has remained about the same for the past fifteen years since the MSU study was completed. A visual walking assessment was made in the spring of 2008 when the entire NB direction of I-75 was closed to traffic during bridge rehabilitation activities. The estimated amount of slab cracking remains unchanged since the last MDOT performance report. About 25-30 percent of the 41ft. slabs are cracked transversely (1-2 cracks per slab) with very few longitudinal cracks. The cracks are mostly low severity, straight, tight, and have minimal associated spalling. This explains why the distress index for the Michigan section has remained basically unchanged over time. The slight increase is from associated distress forming along joints and cracks and not because of additional crack formation.

5.0 2008 PREVENTIVE MAINTENANCE PROJECT

In November 2007, the contract work (IM 82251-79138A) for pavement repairs for the Euro-pavement, as well as the Michigan control section, was awarded. The proposed work was a small portion of a major contract (BHO 82252-59295A) for extensive bridge repairs along the I-75 corridor through northern Detroit and Hamtramck. All pavement work was done in 2008 when NB I-75 was closed to traffic for bridge repairs. Pavement repairs were done in accordance with MDOT's 2003 Standard Specifications for Construction and applicable project Special Provisions (SP), which are included in the appendix. The pavement repairs consisted of the following major work items:

Michigan Control Section

- Resealing all transverse and longitudinal joints with low-modulus, hot-poured rubber sealant.
- Removal of a weight-in-motion scale necessitating full-depth pavement replacement.
- Sealing an estimated 1300 lft. of transverse cracking with hot-poured rubber sealant.
- Estimated 4 syds. of partial-depth patching along cracks/joints. (SP).

The existing neoprene seals in the transverse contraction joints were removed and the joint cavity cleaned with oil-free compressed air (min. 90 psi.) before re-sealing. The existing longitudinal joints used hot-poured, rubber sealant, which was removed and the joint cavity similarly cleaned.

Euro-pavement Section

- Full-depth slab (10" pavement only) replacement (SP).
- Partial-depth repairs (SP).
- Resealing transverse and longitudinal joints with low-modulus, hot-poured rubber sealant.
- Crack sealing (design est. 200 lft.) with hot-poured rubber sealant.

EPDM Seal Replacement

All existing EPDM seals were removed, except for 20 transverse EPDM seals that were left-in-place across all lanes (sta 128+31 to 143+02), which are near the south limit of the Euro-pavement section. The performance of these remaining EPDM seals will be monitored over time.

Partial-depth Repairs

The most extensive pavement work was partial-depth patching of the Euro-pavement spalling. Table 4 is a summary of the as-constructed patch sizes and distribution among the lanes. There were 100 patches totaling 340 sft. (38 syds.), which exceeded the plan estimate of 24 syds. The plan quantity estimate was derived from a distress survey made in November 2006. The dispersed patch distribution amongst lanes does not reflect traffic usage (repetitions) as much as one might conclude, although the 55 patches in the middle lane and the relative larger (> 3 sft.) repair area may be indicative of traffic. The Euro-pavement section normally consists of three lanes, so that lane receives the most traffic. Most likely¹⁶ the patch distribution reflects the time (conditions) when a lane was paved and the particular concrete characteristics of the top layer, as described previously. The Euro-pavement project was being constructed when the 1993 AASHTO Conference was held in Detroit. The project's construction progress was controlled¹⁷ to display all its major pavement features to AASHTO attendees via site tours. The majority of the Euro-pavement was paved during September/October time period and opened to full traffic in late November. Michigan fall weather conditions are generally beneficial for concrete paving.

¹⁶ This assumption is solely the opinion of the author who visited the site frequently during construction and was the research project manager when the early performance of the Euro-pavement was being monitored.

¹⁷ Relative short lengths of a single lane in different areas of the project were paved to comply with the modified progress schedule. Construction records were not reviewed to match these site areas with partial-depth repair locations.

SIZE PATCH (sft.)	LANE			
	MEDIAN	MIDDLE	MIDDLE	OUTSIDE
<1	2	0	1	3
1-2	11	8	14	2
>2-3	3	4	5	2
>3	5	1	35	4
Total # Patches	21	13	55	11

Table 4. Partial-depth Repairs for Euro-pavement

The surface concrete was removed by sawing the perimeter and the body of the repair area to an approximate 2 inch depth and using a max. 30 lb. chipping hammer for removal. The area was cleaned with high-pressure (min. 3000 psi) water. The concrete patching mixture used a Michigan Series 29A coarse aggregate (carbonate), Type I Portland cement, 0.45 w/c ratio, water reducer, with 5.0 to 8.0 percent entrained air. It had been previously decided to not replicate the original top-layer concrete mixture/exposed aggregate surface for patching, including full slab replacement. The surface received a broom finish and was sprayed with curing compound. All joints and full-depth cracks were maintained through the repair area with isolation joint material.

Full-depth Repair

Euro-pavement full-depth pavement repairs for longitudinal cracking were made in only two areas¹⁸ in the outside lane. The repair area included the entire slab width. The SP included a schematic of the repair detail, which is included in the appendix. The lane ties were replaced with larger No. 9 epoxy-coated, deformed bars. The lean concrete base was not disturbed during the repair of the 10" surface pavement. As with the partial-depth repairs, the surface received a broom finish and was coated with curing compound. No deterioration of the polyethylene dowel bar coating after 15 years of service was reported during slab removal.

Figure10 is a revealing picture of the lean concrete base after pavement removal showing standing water. The water is apparently unable to gravity drain through the shoulder interface to the underdrain trench. Whether this standing water is evidence of a non-existent drainage path or a clogged interface (pathway) is subject to conjecture. But, the condition is still relevant as it may provide confirmation of why designs emphasizing structural performance need to account for the eventual onset of non-structural causes for deterioration.

¹⁸ Sta 124+57 to 126+20 (11 slabs/212 syds.) and sta 170+87 to 171+24 (2.5 slabs/53 syds.)



**FIGURE 10. Exposed Lean Concrete Base of Euro-Pavement
(Note standing water)**

6.0 2008 SUMMARY REVIEW AND CONCLUSIONS

Overall, the performance of the Euro-pavement has been satisfactory. The unexpected onset of the recent surface spalling condition is troublesome. Unfortunately, this condition will most likely continue to develop where the top-layer concrete has substandard material characteristics/properties that were previously discussed. The spalling problem appears to have developed from design mixture desires for high strength and a post-construction, diminishing air-void protection system for freeze-thaw resistance. The Detroit freeway system, including this portion of I-75, receives considerable amounts of chloride (calcium/magnesium) de-icing mixture for winter snow removal. Thus, speculation would conclude that a form of “salt scaling” is also contributing to the degradation of the top-layer concrete where the concrete’s (paste) air-void system becomes marginal and can not preserve freeze-thaw protection.

The Euro-pavement’s structural design, as expected, has been shown to be very adequate to sustain heavy truck loadings without evidence of fatigue cracking. The exhibited longitudinal cracking has initiated by means unrelated to loading. The primary cause is attributed to internal drainage issues. The site investigations prior to the 2008 CPM project provide evidence that water is entering the structure, probably through joints, and is unable to further migrate to the underdrain located in the lower portion of the dense-graded aggregate base layer. The axiom that

adequate internal drainage is essential to achieve long-term pavement performance has been demonstrated once more. Narrow saw cuts and tight relief cracks through impermeable layers are not conducive conduits for water to find a gravity outlet.

The performance of the Michigan control section has been very satisfactory since construction. Considering that JRCP is presently disfavored nationally as a design alternative, this long-slab reinforced concrete pavement is performing very well, both structurally and functionally. The minimal amount of preventive treatment needed after twenty years of service attests to its performance thus far.

A recently completed department research study¹⁹ may provide an explanation for the success of the Michigan control section. The study confirmed that stabilization (asphalt or cement) of the open-graded base provides excellent, uniform support for the concrete slab which reduces joint deflection and improves load transfer efficiency from a 'locking' bonding action with the base. The study also provides a reminder that to achieve long-term performance base erosion must be prevented by assuring that water entering the structure doesn't become entrapped. Both of these findings are sensible as applied to the I-75 project and reaffirm traditional agreement amongst pavement practitioners for requirements to achieve long-term pavement performance.

The European demonstration project has helped to initiate changes with MDOT rigid pavement designs and construction oversight. Today, MDOT constructs a jointed-plain concrete pavement (JPCP). To improve initial pavement quality and its accepted link to longer performance, MDOT has upgraded its concrete mix design for JPCP by removing an unwanted tendency for gap-graded aggregate blends to occur, which promote excessive paste content and its associated risk factors for early distress formation. JPCP designs can reduce the tendency for transverse slab cracking, but to do so they require strict attention during construction to avoid excessive, troublesome curling and warping conditions that can occur years after construction is completed. Thus, MDOT continues to improve its construction QC/QA requirements to achieve this assurance.

6.1 Changes in MDOT Typical Concrete Designs

The MDOT typical concrete design section has been modified in the last ten years to incorporate some of the lower cost design concepts of the European section. The design changes include:

- 1) Moved to shorter joint spacing (41 and 27 feet down to 15 feet)*
* temperature & shrinkage steel is placed in the concrete when 41 and 27 foot spacing was used.
- 2) Requiring higher quality aggregates in the concrete on certain high traffic volume routes.
- 3) Modified the gradation of the Open Graded Drainage Course to provide a more stable paving platform.
- 4) 14' widened truck lane to provide improved edge support for truck loadings.

¹⁹ RC-1523 "Performance Evaluation of JRCP with Stabilized Open-Graded Drainage Course", Principal Investigator Dr. Will Hansen, University of Michigan

6.2 Cost Differences

A European pavement section costs approximately 110 to 120% more than the MDOT pavement section to construct initially. Any future maintenance costs for the European section will be recorded by the Department. To date, one round of preventive maintenance was performed on the Euro-pavement section. The initial cost difference reflects the difference between the European design and today's MDOT standard design which includes the modifications listed above.

7.0 2011 MDOT FIELD INVESTIGATION²⁰

A field review was performed on March 1, 2011 by MDOT Metro Region staff and Lansing Construction Field Services staff to discuss pavement repair strategies for the Euro-pavement section²¹.

Some of the partial depth repairs performed during the 2008 preventive maintenance project have already failed. However, the full depth repairs installed at the same time are performing in good condition. Some joint seals have already failed, and based on micro-cracking at the transverse joints, a majority of these joints are likely to exhibit spalls.

Figures 11 and 12 show the current condition (in 2012) of the Euro-pavement section.

During the 2011 field review and subsequent meeting, the rehabilitation options described in Table 5 were developed²¹. The scope of work, expected life, traffic impact and estimated costs are included. The cost estimate was provided by the Detroit TSC considering 2011 distress levels.

²⁰ "I-75 European Pavement Rehabilitation", Nishantha Bandara, MDOT Metro Region M&T, 2011

²¹ "I-75 European Pavement Repair Strategy Meeting Minutes" MDOT-Detroit TSC Medium Conference Room, March 1, 2011



FIGURE 11. 2012 Pavement Condition - Spalls at Transverse Joints



FIGURE 12. 2012 Pavement Condition - High Severity Spall at a Transverse Joint

Option	Scope of Work	Expected Life	Traffic Impact	Estimated Cost
1-1	Full Lane width full-depth (10") concrete pavement repairs for transverse joints experiencing distress 3 feet, or greater across the lane width.	Need repairs every 3 to 4 years as spalls continue to develop	High due to concrete curing time, requires a project every few years	\$ 273,000
1-2	Full lane width full-depth (10") concrete pavement repairs for transverse joints experiencing any level/length of distress across the lane width.	Need repairs every 3 to 4 years as spalls continue to develop	High due to concrete curing time, requires a project every few years	\$ 462,000
2-1	Full lane width by 3.5" depth cold milling with HMA repairs at transverse joints experiencing distress 3 feet, or greater across the lane width.	Need repairs every 3 to 4 years as spalls continue to develop, Pavement ride quality may be an issue due to different surface types	Low but requires a project every few years	\$ 136,000
2-2	Full lane width by 3.5" depth cold milling with HMA repairs at transverse joints experiencing any level/length of distress across the lane width.	Need repairs every 3 to 4 years as spalls continue to develop, Pavement ride quality may be an issue due to different surface type.	Low but requires a project every few years	\$ 167,000
3	3R repair consists of 3.5" depth cold milling of entire surface and paving 3.5" HMA across all lanes. Includes drainage structure adjustments.	5 to 10 years	High, one time impact	\$ 757,000

Table 5. European Pavement Repair Options

Based on the options described in Table 5, the review team agreed that most effective rehabilitation option would be Option 3 (cold milling 3.5" of the entire concrete surface and paving 3.5" HMA across all lanes, including drainage structure adjustments). This option was selected considering following facts:

1. This option will remove the degraded top 3.5" concrete layer and leave remaining 7" bottom layer and lean concrete base intact.
2. The future traffic impacts will be minimal; all other options include projects every few years as anticipated spalls continue to develop adjacent to new repairs.
3. This option will provide a smoother ride compared to other options.

References.

¹ “Report on the 1992 US Tour of European Concrete Highways”, US Tech, Sponsors were: AASHTO, ACPA, FHWA, PCA, SHRP, TRB.

² “European Concrete Pavement Tour”, Michigan Department of Transportation, November 1992, authors Roger D. Till and Randy VanPortfliet .

³ “Construction of European Concrete Pavement on Northbound I-75 – Detroit, Michigan”, Michigan Department of Transportation, Report No. R-1333, September 1994.

“Demonstration Project No. 75 - Michigan Demonstration Project I-75 Detroit, Michigan”, Federal Highway Administration, March 1994.

⁴ The Michigan DOT during this time period was using both joint spacings for JRCP depending upon the amount of anticipated truck traffic to correspond with the potential for transverse cracks developing. The change was made to 27’ on SB I-75 to allow a comparison in performance to take place. All other design features and material sources remained the same with NB I-75.

⁵ The project specified a coarse aggregate with high durability requirements with a maximum dilation value of 0.008 percent per 100 freeze-thaw cycles per MTM 115. The aggregate sampling and acceptance requirements were also modified for this project and applied to both pavements.

⁶ MDOT published the following three reports:

Report No. R-1338 – “First Year Performance of the European Concrete Pavement on Northbound I-75, Detroit, Michigan” February 1995.

Report No. R-1343 – “Second Year Performance of the European Concrete Pavement on Northbound I-75, Detroit, Michigan” June 1996.

Report No. unknown – “Third Year Performance of the European Concrete Pavement on Northbound I-75, Detroit, Michigan” March 1997.

Report No. R-1538 – “Fifteen Year Performance Review of Michigan’s European Concrete Pavement” February 2010.

⁷ Report No. RC-1381 – “Cost Effectiveness of European Demonstration Project: I-75 Detroit” May 2000.

⁸ MDOT uses an assumed schedule of needed preventive maintenance treatments during a pavement’s service life, which is estimated at 35 years. Each treatment action is intended to add service life. During design for pavement type selection, the life/cycle cost of equivalent flexible and concrete pavements are compared, if the pavement cost exceeds one million dollars. The type with the lowest cost is selected.

⁹ The construction cost (using only pavement pay items) per unit area of the Euro-pavement was about 2 ½ times the cost of the Michigan section. The Euro-pavement cost included special features (exposed texture, joint seals, LCB) and adjustments to the paving schedule which inflated its overall project cost.

¹⁰ The 2nd year performance report (No.1343) has more detailed information on the derivation and calculation of Michigan’s RQI.

¹¹ “European Pavement FHWA Site Review”, David L. Smiley, April 12, 2007

¹²The center of the trench is directly below the longitudinal slab/shoulder joint. The 6” diameter pipe lies just above subgrade elevation.

¹³ The Euro-pavement section of I-75 is a cut section, typically 10-15’ below street grade.

¹⁴The back slopes exhibited seepage areas during the April site review. Occasionally, water was also ponding (from likely snow melt) in the grass area at the top of back slope between the service drive. Theory = Water is traveling under a head through the ground, then entering the pavement structure under the shoulder through the aggregate base.

¹⁵ After ice melting, which is likely rapid, the slab's edge would be precariously unsupported and subjected to high deflections. Whether re-contact between the layers occurs is subject to conjecture.

¹⁶ This assumption is solely the opinion of the author who visited the site frequently during construction and was the research project manager when the early performance of the Euro-pavement was being monitored.

¹⁷ Relative short lengths of a single lane in different areas of the project were paved to comply with the modified progress schedule. Construction records were not reviewed to match these site areas with partial-depth repair locations.

¹⁸ Sta 124+57 to 126+20 (11 slabs/212 syds.) and sta 170+87 to 171+24 (2.5 slabs/53 syds.)

¹⁹ RC-1523 "Performance Evaluation of JRCP with Stabilized Open-Graded Drainage Course", Principal Investigator Dr. Will Hansen, University of Michigan

²⁰ "I-75 European Pavement Rehabilitation", Nishantha Bandara, MDOT Metro Region M&T, 2011.

²¹ "I-75 European Pavement Repair Strategy Meeting Minutes" MDOT-Detroit TSC Medium Conference Room, March 1, 2011

APPENDIX

SITE PAVEMENT CORING SUMMARY I-75 EUROPEAN PAVEMENT PROJECT

On Friday, February 2, 2007 a field site coring investigation was conducted of the European Pavement on NB I-75 in Detroit. The 1993 demonstration project has recently exhibited (past year) longitudinal cracking and scattered, severe spalling (surface delamination) in the proximity of transverse joints. The primary focus of the coring was to be the longitudinal cracking at the north end of the one mile project. MDOT's TSC has scheduled a preventive maintenance project for 2008, so the coring was to verify crack depths and appropriate repair contract items.

The outer right (truck) lane of the three lane pavement was closed to traffic from approximately Warren Avenue northerly to the project POE, north of I-94. The closure allowed a more thorough visual inspection of the pavement's condition which led to additional coring. The weather was very cold, but partly sunny. The Metro Region did the coring (4 in. diameter). In addition to the coring crew, several persons from the Region office and TSC were present during the coring.

Longitudinal Cracking

The LC of concern exists in the last three panels at the north end. The cracks exist in the right one-third area of the panel toward the outside shoulder. They are contiguous across the panels with associated spalling with little wander. From the surface they appear as a fissure, thus not likely to be full-depth. The crack was cored in several locations among the effected panels. However, all cores found the cracks to be full-depth through the 10 in. top pavement, but did not penetrate the 6 in. lean concrete pavement. The cores showed high variability in thickness among all concrete mixtures. There was no indication of scour (or bond) at the interface between the lean concrete and the 10 in. top pavement. The crack width in the bottom (carbonate) layer of the 10 in. concrete was much wider than expected. Thus, the crack appears to initiate bottom-up. A core near a TJ found the crack in the proximity of the dowel, which showed no indication of corrosion.

Additional Core Site

As mentioned, the closure allowed an inspection of the right lane pavement. Considerable random surface cracking that resembles drying shrinkage was observed. A location was selected for coring about ¼ mile south of the POE with probable additional LC and surface delamination near a TJ. The LC location was similar to the north end and crossed two panels. The crack width was very tight being only noticeable due to a salt residue filling the crack at the surface. The salt residue also accented the "shrinkage cracking".

As at the north end, the LC was found to be full-depth. Although the crack width was very tight at the surface, it was remarkably wide through the carbonate concrete layer. The crack width contrast was dramatic at the layer interface, much unexpected. Again, there was no indication of bond at the interface with the lean concrete base which showed no scour or cracking. The cores also found (surprisingly) the sub-crack width wider away from the TJ, nearer mid-panel.

At the same location a core was also made to verify the extent (depth) of low severity surface delamination near a TJ that was found by sounding with a steel rod. The core verified delamination was present, which did not originate at the interface and was confined to the top concrete (trap rock) layer. The core showed the surface (trap rock) concrete is cracking laterally, perhaps an indication of freeze-thaw action.

Finally, in the same area two consecutive panels were selected for coring that exhibited no indication of distress. Each was cored near mid-panel. Both cores found the 6 in. lean concrete bonded to the 10 in. top pavement with no indication of any subsurface-distress formation. The cores will be used for further material analysis to be decided.

General Observations

The cored concrete in distressed areas appears to be poorly consolidated. Honeycombing was evident in both layers of the 10 in. pavement.

The dense-graded aggregate base (crushed carbonate stone) readily retained core water, if exposed to core the lean concrete layer. The crushed carbonate stone was specified to be well-graded to enhance its stiffness for slab support.

Water entry through joint openings, primarily the shoulder joint, appears to contribute to LC. Cracking is definitely bottom-up – a likely tensile mechanism.

Definite evidence of freeze-thaw action after crack initiates – primarily in surface concrete. Heavy chloride de-icing application for the Detroit freeway system may be an adverse factor in promoting F-T deterioration.

Visual distress in right lane is very much non-uniform in extent and severity.

Possible Causes for Deterioration

Although limited coring was conducted due to closure time constraints, some plausible conclusions are evident:

There are two distinct distress patterns occurring. They are longitudinal cracking (LC) and delamination of the surface concrete adjacent to transverse joints. A hypothesis for the LC could be that there is restrained differential lateral movement between the 10 in. and 6 in. concrete layers. Stress points occur from thermal movement depending on the extent and magnitude of any bond that exists between the layers. The LC is initiating not at a TJ, but somewhere mid-slab.

The delamination is solely material-moisture related. Eventually, breakup of material results from loading. The joints are likely retaining water which is not getting to the underdrains or another gravity outlet providing a source for F-T action.

Unfortunately, both situations only become evident long after the deterioration begins below the surface. Thus, the true extent of the distress formation with the European pavement is unknown.

Possible Future Actions

Verify air content of concrete types in 10 in. pavement.

Conduct freeze-thaw testing of concrete types by method and procedure to be determined.

Possible permeability testing, although residual chloride from de-icing would affect results.

In any case, MDOT will keep FHWA informed of project's condition and investigation findings, as they are very interested in this past demonstration project that retains national interest.

DLS: 2-09-07

PRELIMINARY REPORT: INVESTIGATION OF SPALLING AND CRACKING IN EUROPEAN CONCRETE PAVEMENT ON NORTHBOUND I-75 DETROIT, MI

Report Prepared By: Jon I. Mullarky, P.E
April 30, 2007

Following a 1992 FHWA sponsored SCAN Tour focusing on European concrete pavement practice; the Michigan Department of Transportation (MDOT) constructed an experimental pavement segment using procedures common Germany and Austria. A 1.3 mile section of Northbound I-75 (Chrysler Freeway) in downtown Detroit was constructed in the fall of 1993 that include the following features:

- Lean concrete base
- Two layer concrete pavement with exposed aggregate surface treatment
- Ethylene Propylene Diene Terpolymer (EPDM) joint seals

The pavement section has performed very well for 13 years; however some deterioration (spalling and longitudinal cracking) was noticed in the late winter of 2007. Cores extracted by MDOT revealed the longitudinal cracks promulgated upward from the interface between the lean concrete base and the lower layer of the two-course concrete pavement. Longitudinal cracks were observed in the outside wheel path of the right lane. Examination of cores from the spall areas indicated that the deterioration was confined to the surface layer of the two-course section. Deposits of material identified by MDOT's petrographer as calcium carbonate were found in air-voids.

OBSERVATIONS:

On April 3, 2007, Suneel Vanikar, Charles Goodspeed and Jon Mullarky from FHWA's Office of Pavement Technology, visited the site with representatives of the FHWA Michigan Division Office, MDOT and the Michigan Concrete Pavement Association. Significant observations from the visit:

- Moderate to severe spalling was occurring throughout the 1.3 mile Euro-pavement section, but was almost entirely confined to concrete immediately adjacent to joints. The EPDM joint material was depressed well below the pavement surface, leaving a cavity that contained debris and could trap water, road salt and ice.
- Longitudinal cracking was observed in the outside wheel path of the right (truck) lane. Only the right lane was closed for inspection, thus cracking in other lanes could not be confirmed due to traffic. Cracking was observed only at the bottom of vertical curves in deep cut sections. Shoulder and slope drains in the area were inspected by MDOT personnel and appeared to be plugged. The back slopes outside the concrete barrier on the right side of the pavement exhibited settlement and surface sliding. A considerable amount of spilled ready mixed concrete was observed in the shoulder adjacent to one of the non-functioning drain inlets. A core hole through the pavement and LCB at the longitudinal shoulder joint was filled with water and appeared to drain during a short drainage test. MDOT

personnel augered down to the clay subgrade back of the barrier wall. Water was observed in the select fill material just above the clay. At the location of longitudinal cracking near the I-94 overpass, water was observed flowing from the toe of a similar back slope in a cut section.

- Water could also enter the pavement through failed joint seals and pavement cracks.
- A clay-like material was observed just above the interface between the lean concrete base (LCBC) and the lower concrete pavement course, in the crack found in a core extracted by MDOT during the visit. There was no bond between the LCBC and the concrete pavement.

RECOMMENDATIONS:

Two distinctly different mechanisms appear to be causing the deterioration of the I-75 Euro-pavement section, spalling as a result of failure of the joint sealing system, and longitudinal cracking as a result of infiltration of water into the pavement structure adjacent to the right shoulder.

Spalling

In concrete pavement, spalling usually results from excessive stresses at a joint or crack caused by infiltration of incompressible materials and subsequent expansion and/or traffic loading. Spalling is usually found at the slab surface within 2 ft. of joints and is compounded by ingress of moisture and salts into the damaged surface. Traffic loading accelerates damage. The depressed EPDM joint seals of the I-75 pavement allow debris, and water to collect in the joint. Expansion from freezing water or blockage from incompressible debris creates the stress, results in the initial spall.

The spalling can be repaired by partial depth patching in the spall areas. Replacement of the joint sealing system throughout the project should prevent additional spalling of the pavement.

Longitudinal Cracks

Longitudinal cracks in concrete pavement are often caused by a combination of heavy load repetition, loss of foundation support, and stress caused by curling and warping. In this case we believe the initiating cause is failure of the drainage system at the bottom of hills. This failure allows water, under considerable head pressure, to enter the pavement substructure. The water may be saturating the aggregate subbase and infiltrating into the subgrade. The design detail shown in Figure 1 and observations on site also raise the possibility that water is being forced into the pavement structure between the lean concrete base and the concrete pavement. Water infiltration is on the right side of the pavement, under the shoulder and truck lane. Because of the pavement cross slope, the right tire of any axle would also place a somewhat greater load on the pavement than under the left tires. Fatigue cracking would probably initiate in the concrete pavement in the right wheel path midway between transverse joints. Loading, hydraulic fracture and pressure from freezing water in the crack along with curling and warping stress would be

factors causing debonding of the LCB from the upper pavement and crack to propagate in the wheel path.

Repair efforts should be made to restore drainage in the deep cut sections. This may require additional drainage behind the barrier wall. Pavement panels exhibiting severe longitudinal cracking should be removed and replaced.

Priority of Repairs

- Priority 1 Replace joint seal and repair spalling by partial depth patching.
- Priority 2 Restore drainage system in deep cut areas.
- Priority 3 Install additional drainage behind the barrier wall in deep cut areas and replace severely cracked pavement panels.

DATE: April 16, 2007

TO: Andrew Bennett
Engineering Technician
Materials Technology Unit

FROM: Robert Muethel
Petrographic Specialist
Petrography Group

SUBJECT: Petrographic Examination of Concrete Specimens from the I-75 European Pavement in Detroit, Project IM 82251/30613A

This report presents the results of petrographic examination for possible presence of clay deposits, requested on concrete core specimens from the I-75 European pavement in Detroit.

Sample

Pieces of four-inch diameter concrete cores obtained from the I-75 European pavement in Detroit were received for examination to determine the nature of fine deposits on exposed crack surfaces on the specimens.

Petrographic Examination

Petrographic examination was conducted according to ASTM C856 *Standard Practice for Petrographic Examination for Hardened Concrete*, including visual examination using a stereomicroscope, and testing with dilute hydrochloric acid and water.

Results

Examination of the exposed crack surfaces found two types of deposits. One type is a tan to gray, soft powdery material. When tested with dilute hydrochloric acid, the material dissolved with strong effervescence, typical of concrete slurry generated during coring. The other type of deposit is dark brown and cohesive. Testing with dilute hydrochloric acid produced no effervescence. The material did not become muddy with application of water, which would indicate the presence of clay. Water was noted to bead up, indicating the presence of an oily residue similar to that present in road grime.

Andrew Bennett
Page 2 of 2
April 16, 2007

Remarks

Examination of the deposits on crack surfaces of the core pieces indicated that the deposits appear to be slurry material generated during coring, and road grime that migrated into cracks in the concrete. The deposits did not have characteristics of clay.

CONSTRUCTION AND TECHNOLOGY DIVISION



RWM:lw
cc: J. Staton

DATE: March 30, 2007

TO: Andrew Bennett, ET
Materials Technology

FROM: Robert Muethel, Petrographic Specialist
Petrography Group

SUBJECT: Petrographic Examination and Determination of Hardened Air
Void Content of Concrete from the I-75 Detroit European Pavement,
Project IM 82251-30613A.

This report presents the results of petrographic examination and hardened air content determinations requested on a concrete core sample obtained from the I-75 European pavement, project IM 82251-30613A in Detroit.

Sample

A four-inch diameter concrete core obtained from the I-75 European pavement in Detroit was received for examination of the top and bottom courses.

Sample Preparation and Analysis

One-half inch thick slices were prepared from the top and bottom courses of the core, and then ground and polished for analysis by linear traverse measurement according to ASTM C457, *Standard Test Method for Microscopical Determination of Parameters of the Air-Void System in Hardened Concrete*. Petrographic examination was conducted according to ASTM C856 *Standard Practice for Petrographic Examination for Hardened Concrete*.

Results

Examination of the polished surfaces of both the top and bottom course specimens revealed a considerable quantity of air voids containing various amounts of white deposits, both as void linings and complete fillings. Many of the void deposits displayed sharp, angular crystal growths typical of calcium carbonate. The deposits effervesced vigorously when contacted with dilute hydrochloric acid, indicating the presence of carbonate compounds.

The hardened air void distributions in both the top and bottom core slices were found to be typical of entrained concrete. The following table shows the results of the hardened air determinations, including the results of determinations that were conducted on top and bottom course specimens obtained from the newly constructed I-75 project in 1993.

Specimen		Hardened Air, %	Voids per Inch	Specific Surface, In. -1	Spacing Factor, In.
Top Course,	2007	6.2	10.0	644	0.008
Bottom Course,	2007	5.6	9.0	639	0.007
Top Course,	1993	7.1	9.3	525	0.008
Bottom Course,	1993	5.0	8.8	689	0.006

The air void intercepts recorded for this analysis included open voids and open portions of the partially-filled voids. Completely-filled original voids were not included. According to the Portland Cement Association Bulletin EB001.14, guidelines for adequate freeze-thaw resistance recommend specific surface greater than 600 in.⁻¹ and spacing factor less than 0.008 inch. The concrete in both the top and bottom courses are shown to be at or near the guideline limits.

Remarks

The results of this examination indicate that the concrete in the core specimen has air void properties similar to the new concrete from the project analyzed in 1993. The measured parameters were found to be at or near the PCA guideline limits for adequate freeze-thaw resistance.

Deposits noted in the air voids could lessen resistance to freezing and thawing. Many of the small voids, although open, contain linings of white deposits that could cause such voids to be impermeable to water, further reducing the freeze-thaw resistance of the concrete.

CONSTRUCTION AND TECHNOLOGY DIVISION

R. W. Muethel

RWM:ai

cc: Attachments
J. F. Staton

MODIFIED AASHTO TEST METHOD


In pavement design, CTE is typically represented as an average value rather than a mix-specific input. This, however, may lead to erroneous evaluation of the pavement's thermal response and potential development of distress. Conducting CTE tests will help pavement design engineers better predict the impact of mix-specific thermal expansion on pavement behavior.

The American Association of State Highway and Transportation Officials (AASHTO) provisional test standard TP60-00 was adopted to measure the Coefficient of Thermal Expansion (CTE) of concrete in this study. In the AASTHTO TP60-00 test method, the specimen is heated in a water-bath from 50°F to 122°F (10°C to 50°C), and then cooled down to 50°F. The lengths and temperatures of specimen at the points of 50°F and 122°F are recorded for CTE calculation for each segment. The CTE value of the test specimen is taken as the average of the heating and cooling segments, provided the two values are within 0.5 micro strain/°F (0.3 micro strain/°C). Apparently, there are a few limitations in the AASHTO TP60-00 method for these reasons:


- The actual curve of temperature versus length change is unknown within each segment: thus it is unclear whether the thermal equilibrium is reached during the test.
- Only the water bath temperature is measured, which may not represent the concrete specimen's temperature.

Therefore, a few modifications were made at U of M based on AASHTO TP60-00 to provide a better control on the measurement accuracy. The modifications are as follows:

- The modified method measures the entire curve of temperature versus length change of specimen, and the CTE value is calculated using only the linear part of the temperature versus length change curve to achieve accuracy (Figure 1 and 2).
- A companion specimen, with a thermal couple embedded at the center, is submerged in the water for temperature monitoring. This temperature is taken as the temperature of the tested concrete specimen.
- Two specimens can be measured at the same time, which improves the test efficiency (Figure 3).

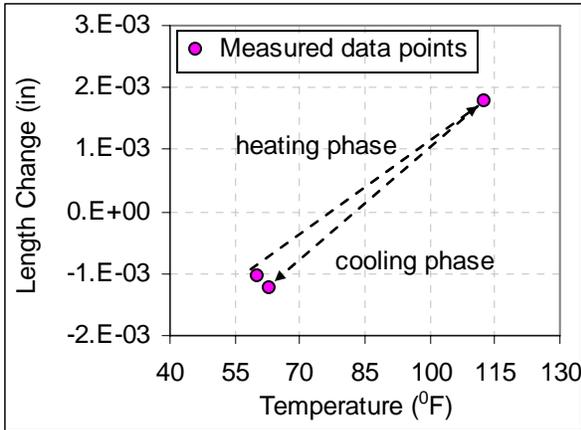

(a) AASHTO TP60-00 test method

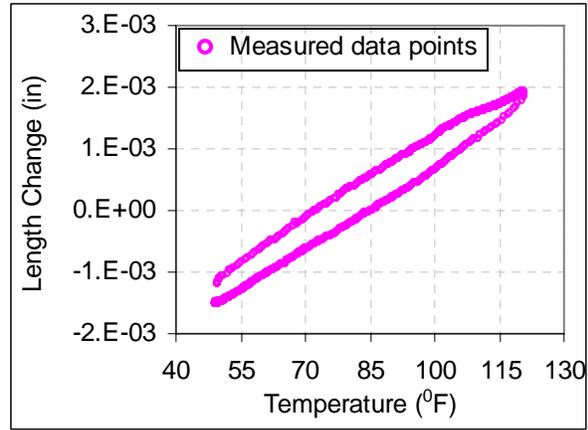

(b) U of M modified method

Figure 1
CTE Test Methods (AASHTO versus U of M)

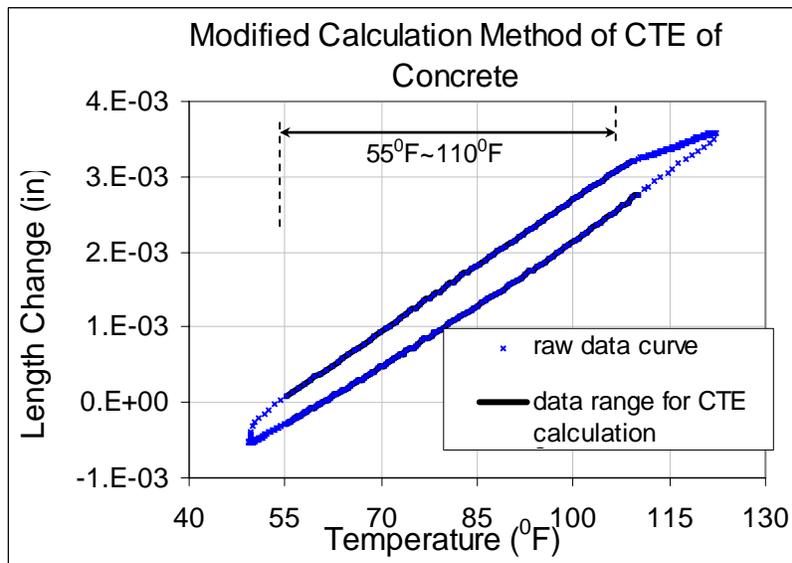


Figure 2
Calculation Method of CTE in the Modified Test Method

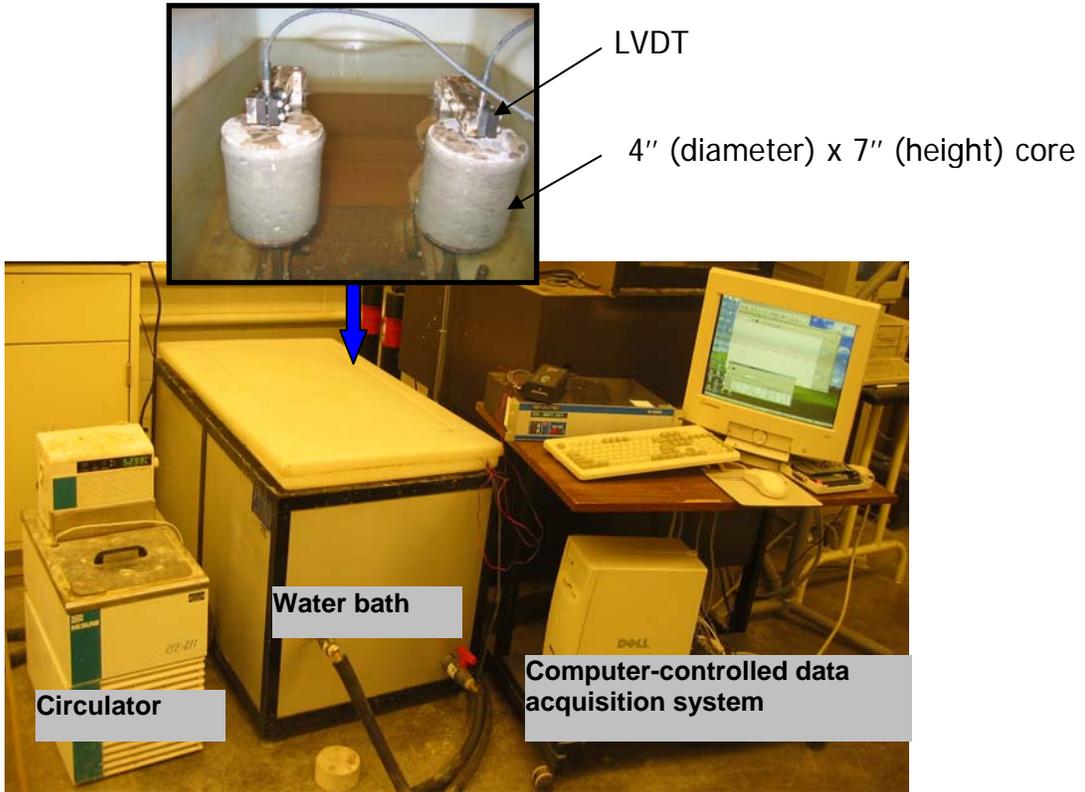


Figure 3
CTE Test Setup at U of M

Results of Field Cores from I-75

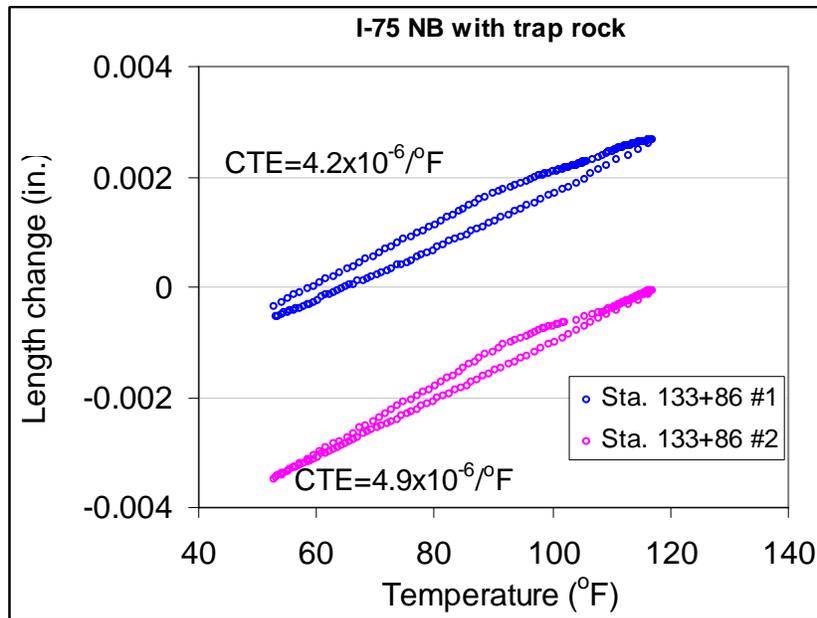


Figure 4
CTE of Cores with Trap Rock

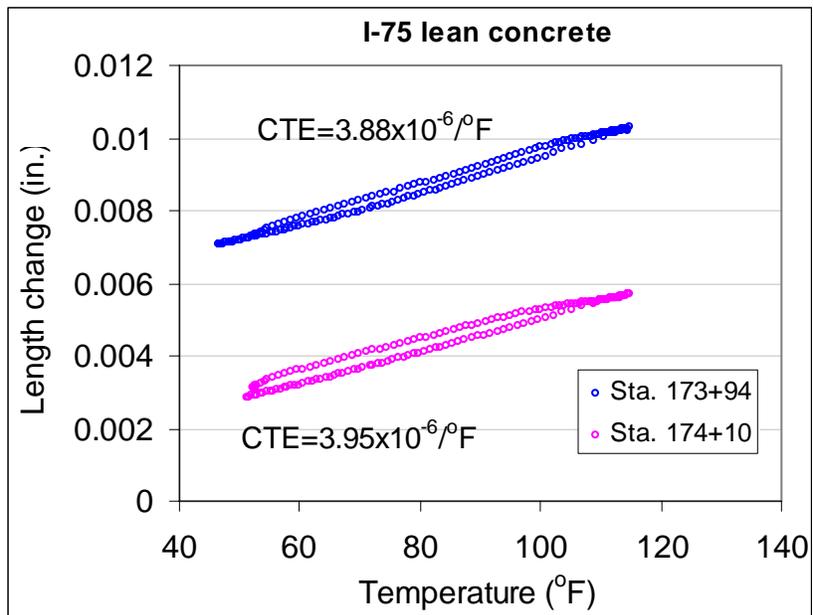


Figure 5
CTE of Lean Concrete Cores

APPENDIX: *Coefficient of Thermal Expansion*

1. Scope

- 1.1 This test method covers the determination of the coefficient of thermal expansion (CTE) of hydraulic cement concrete cores or cylinders. The specimens must be in a saturated condition.

2. Referenced Documents

- 2.1 AASTHTO Standards:

TP60-00 Standard Test Method for the Coefficient of Thermal Expansion of Hydraulic Cement Concrete

3. Apparatus and Supplies

- 3.1 A concrete saw capable of sawing the ends of a cylindrical specimen perpendicular to the axis and parallel to each other.
- 3.2 Calipers suitable for measuring the specimen length to the nearest 0.004 in (0.1mm).
- 3.3 A temperature controlled water bath with a temperature range of 50°F (10°C) to 122°F (50°C), capable of controlling the temperature to 0.18°F (0.1°C).
- 3.4 A rigid support frame for the specimen to be used during length change measurement. The frame should be designed to have minimal influence on the length change measurements obtained during the test, and support the specimen such that the specimen is allowed to freely adjust to any change in temperature.
- 3.5 Three submersible temperature-measuring devices with resolution of 0.18°F or 0.1°C.
- 3.6 A reference concrete cylinder with a built-in thermal couple for measuring cylinder's temperature.
- 3.7 A submersible LVDT gage head with excitation source and digital readout, with a minimum resolution of 0.00001 in. (0.00025 mm), and a range suitable for the test.
- 3.8 A computer-controlled data acquisition system capable of recording data continuously, with thermal couples connected to it.
- 3.9 A micrometer or other suitable device for calibrating the LVDT over the range to be used in the test.

4. Sample

- 4.1 Test specimens shall consist of drilled 4-in. diameter cores sampled from the concrete structure being evaluated, or 4-in. diameter cylinders. The specimens shall be sawed perpendicular to the axis at a length of 7 ± 0.08 in. The standard reference material used for calibration shall be the same length as the test specimen so that the frame does not have to be adjusted between calibration and testing. The sawed ends should be flat and parallel.

5. Procedure

- 5.1 The specimen shall be conditioned by submersion in saturated limewater at $73\pm 4^{\circ}\text{F}$ for not less than 48 hours.
- 5.2 Place the measuring apparatus, with LVDT attached, in the water bath and fill the bath with cold tap water. Place the three thermal couples in the bath at locations that will provide an average temperature for the bath as a whole.
- 5.3 Remove the specimen from the saturation tank and place the specimen in the measuring apparatus located in the controlled temperature bath, making sure that the lower end of the specimen is firmly seated against the support buttons, and that the LVDT tip is seated against the upper end of the specimen.
- 5.4 Place the reference concrete cylinder, with an embedded thermal couple, in the water bath for monitoring the temperature change in the tested specimen.
- 5.5 Set the temperature of the water bath to $50\pm 2^{\circ}\text{F}$. When the bath reaches this temperature, allow the bath to remain at this temperature until thermal equilibrium of the specimen has been reached, as indicated by consistent readings of the LVDT to the nearest 0.00001 in. taken every ten minutes over a one-half hour time period. The recorded data are the initial readings.
- 5.6 Set the temperature of the water bath to $122\pm 2^{\circ}\text{F}$. Once the bath has reached $122\pm 2^{\circ}\text{F}$, allow the bath to remain at this temperature until thermal equilibrium of the specimen has been reached, as indicated by consistent readings of the LVDT to the nearest 0.00001 in. taken every ten minutes over a one-half hour time period. The recorded data are the second readings.
- 5.7 Set the temperature of the water bath to $50\pm 2^{\circ}\text{F}$. When the bath reaches this temperature, allow the bath to remain at this temperature until thermal equilibrium of the specimen has been reached, as indicated by consistent readings of the LVDT to the nearest 0.00001 in. taken every ten minutes over a one-half hour time period. The recorded data are the final reading.

6. Calculations

6.1 Calculate the Coefficient of Thermal Expansion, as follows:

$$CTE = \left(\frac{\Delta L_a}{L_0} \right) / \Delta T \quad (1)$$

Where:

ΔL_a = actual length change of specimen during temperature change

L_0 = measured length of specimen at room temperature

ΔT = measured temperature change

$$\Delta L_a = \Delta L_{measured} + \Delta L_{system} \quad (2)$$

Where:

$\Delta L_{measured}$ = measured length change of specimen during temperature change

ΔL_{system} = length change of the supporting frame during temperature change

$$\Delta L_{system} = \alpha_{in\ var} \cdot \Delta T - \Delta L_{calibration} \quad (3)$$

Where:

$\alpha_{in\ var}$ = CTE of invar used in the calibration run for determining the length change of the measuring apparatus

$\Delta L_{calibration}$ = measured length change of the 7-in. long invar bar which is used in the calibration run. The calibration run follows the same procedure as the one in determining the CTE of specimen.

6.2 The test result is the average of the two CTE values obtained from the two test segments provided the two values are within $0.5 \times 10^{-6}/^{\circ}\text{F}$. If the two values are not within $0.5 \times 10^{-6}/^{\circ}\text{F}$ of each other, one or more additional test segments are completed until two successive test segments yield CTE values within $0.5 \times 10^{-6}/^{\circ}\text{F}$ of each other. The final CTE is the average of these two CTE values of each cylinder.

MICHIGAN
DEPARTMENT OF TRANSPORTATION

SPECIAL PROVISION
FOR
PARTIAL DEPTH REPAIR

C&T:ARB

1 of 3

REVISED:04-18-07

a. Description.- This specification covers requirements for all labor, equipment, and materials necessary to remove all unsound concrete, reform the pavement joint groove, and patch the removal area with concrete. Complete all work according to the Standard Specifications for Construction, except as specified herein.

A meeting between the Contractor and a MDOT representative will be held at the project site prior to the beginning of work to mark up all repairs as per the log and any additional repairs found at the time of the meeting. The Contractor is responsible for contacting the Engineer to schedule the on-site meeting.

b. Materials. - Use a concrete mixture that conforms to the following (per cubic yard).

Mix Water (total)	282 pounds
Net w/c Ratio	0.45 maximum
Portland Cement, Type I	658 pounds
2NS Fine Aggregate, Dry	1476 pounds
29A Coarse Aggregate, Dry	1519 pounds
Fine Agg to Total Agg Ratio	0.50 by absolute volume
Water Reducer	manufacturer recommendations
Entrained Air	5.0 - 8.0 percent
Slump	2 - 4 inches after addition of water reducer

Values are assumed for the fine aggregate (specific gravity, 2.64; absorption, 0.95) and coarse aggregate (specific gravity, 2.72; absorption, 1.10; unit weight, 89 pcf). Make the necessary proportion adjustments for actual aggregate absorption and specific gravity and submit the adjusted mix design to the Engineer at least five days prior to concrete placement.

Use curing compound meeting subsection 903.05.A of the Standard Specifications for Construction.

c. Construction Methods.-

Repair Area Preparation.-Construct repair limits by sawing the perimeter of the repair area to depths of 2 inches \pm 1/4 inch. Use concrete saws with a maximum blade diameter of 12 inches for sawing the perimeter of the repair area. Cut 2 inches beyond the widest and longest portion of the spalled or delaminated area to control the repair size. All Saw Cuts shall be parallel to the longitudinal and transverse joints. Construct repair areas to a minimum depth of 3 inches after chipping. All repairs shall be constructed to a minimum of 6 inches wide. Additional saw cuts can be made within the repair area to facilitate the removal of the unsound concrete by if necessary.

Remove unsound concrete by hand chipping with a light weight chipping hammer (30 lb max.), unless otherwise approved by the Engineer. The slope of the bottom of the repair area shall not exceed 1 vertical to 4 horizontal, unless otherwise approved by the Engineer. Use a steel bar to sound all exposed surfaces after completing sawing and chipping to verify no delaminations remain. Remove any delaminated concrete detected and resound again. Clean the exposed surfaces with high pressure water using a 15 degree tip with a minimum pressure of 3000 psi. Prepare the concrete surface to meet a saturated surface dry condition immediately prior to concrete placement. Dispose of all waste material and debris as per subsection 204.03B of the Standard Specification for Construction.

Concrete Placement.-Place and screed the concrete to the elevation of the surrounding pavement surface seal all edges with mortar by working concrete outward toward existing concrete pavement. Apply a broom finish to the concrete. Immediately after finishing, apply curing compound at 1 gallon per 100 ft². Place concrete repairs at air temperatures of 50 to 90 degree F, inclusive. Insulate repairs when air temperature is below 60 degree F or when the concrete pavement temperature is below 50 degree F.

Joint and Crack Relief.- Crack relief is required at all locations where the repair is intersected by a full-depth pavement crack. Prior to concrete placement, establish joint and crack relief through the full depth of the repair by sawing and installing a 1/4-inch wide compressible isolation joint material extending 1 inch below and 3 inches beyond the repair boundaries as shown in the Partial Depth Concrete Pavement Repair Detail below. Maintain isolation joint material in a vertical orientation through the entire thickness of the repair. Re-establish transverse joint reservoirs in the same configuration as the existing pavement using a rigid compressible form wedged into position, or other suitable methods approved by the Engineer. A bond breaker is required on the surface of the form in contact with the patching material to prevent adhesion between the form and the patching material.


All dowel bars exposed in the repair area shall be coated with a heavy grease to prevent a bond between the dowel bar and the repair mortar.

Opening to Traffic.-The repairs may be open to traffic when the new concrete has attained a flexural strength of 300 psi.

d. Measurement and Payment.-

Contract Item (Pay Item)	Pay Unit
Partial Depth Repair, Special.....	square foot

Payment for **Partial Depth Repair, Special** includes all labor and materials required to saw the repair limits, remove the unsound concrete, isolate and form the joint groove, and to furnish, place, consolidate, finish, and cure the concrete.

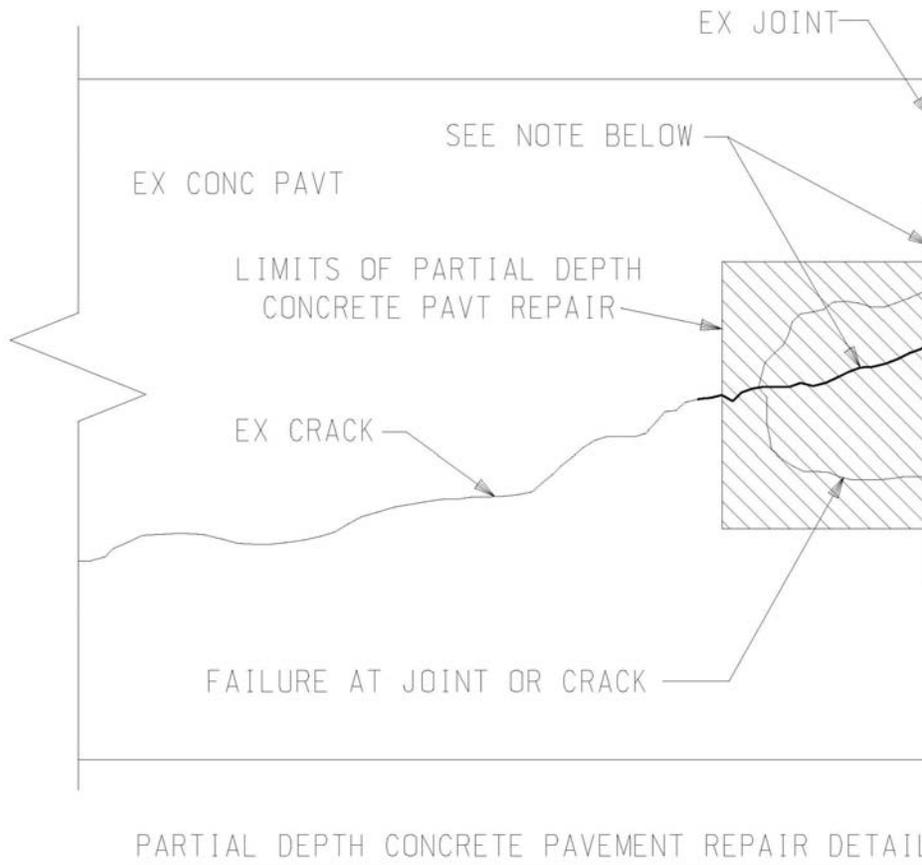

NOTE: Install ¼ inch wide compressible isolation joint material.

MICHIGAN
DEPARTMENT OF TRANSPORTATION

SPECIAL PROVISION
FOR
FULL DEPTH CONCRETE VARIABLE WIDTH REPAIR

C&T:ARB

1 of 2

C&T:APPR:TES:JFS:04-18-07

a. Description. This special provision sets forth requirements for full depth concrete variable width longitudinal repair of jointed plain concrete, at locations determined by the Engineer. Complete this work according to Section 603 of the Standard Specifications for Construction, except as modified herein.

b. Equipment. The drilling machine must produce drilled holes of proper diameter, depth, and location as shown in Figure 1, Full Depth Centerline Repair, included in this special provision.

c. Construction. Ensure that all sawcuts for removal do not extend more than two inches into the lean concrete base. The lean concrete base is to remain in place, undisturbed. Where a #7 lane tie bars are to be removed, replace with #9 deformed bars, according to Figure 1, Full Depth Variable Width Repair, provided in this special provision.

Construct the concrete pavement repair according to Figure 1, Full Depth Variable Width Repair. Sawcut a reservoir where the new concrete meets the existing concrete, according to Figure 1, Full Depth Variable Width Repair. Make the sawcut when the concrete has hardened enough that no excess raveling or spalling occurs. Establish transverse joint reservoirs in the same configuration as the existing pavement.

d. Acceptance. Repair damage to any adjacent pavement, roadway structure, or appurtenance that results from the repair operation prior to final acceptance, as directed by the Engineer. Repairing damage to any adjacent pavement is the burden of the contractor.

e. Measurement and Payment. The completed work as described will be paid for at the contract unit price for the following contract items (pay items):

Contract Item (Pay Item)	Pay Unit
Pavt Repr, Rem – Special	Square
Yard	
Pavt Repr, Nonreinf, 10 inch – Special	Square
Yard	
Joint,	Tied,
Longit.....	Foot

Pavt Repr, Rem – Special includes saw cuts as needed for concrete pavement removal; full depth removal and disposal of concrete and HMA patches; lifting the repair section out; loading, hauling, and disposing of the material removed. The lean concrete base is to remain in place.

Pavt Repr, Nonreinf, 10 inch – Special includes furnishing, placing, finishing, texturing, and curing the concrete; furnishing any additional concrete required to correct low base conditions; saw, clean, and prepare the transverse and longitudinal joint reservoir; and furnishing and installing joint sealant.

Joint, Tied, Longit includes drilling and cleaning the holes for the deformed bars; furnishing, mixing, and installing the grout; and furnishing and installing the deformed bars.

Figure1

