


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 17
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Grants House
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			1999 Quantity	2009 Quantity	Remarks	
							Surf.(S)	Therm.(T)	Misc.(M)				
				% Damage									
				0-1 ND	1-10 MD	10-25 D(L)	10-25 SD(G)	>25 SD					
107	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified - Wood Under Carpet - Walls and Ceiling - White Paint	
108	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - Four Walls of Drywall - Wood Floor	
109	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - Wood Floor - Grey Paint - Four Walls of Drywall	
110	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - Wood Under Carpet	
111	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - Wood Under Carpet - Walls and Ceiling	
112	4/3/2009	2	12" x 12" Floor Tile - Off-White - Octagon Pattern	Chrysotile	3%	NF	M	G	ND	17 Sq. Ft.	17 Sq. Ft.	White Paint - Under New Floor Tile	
112	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - Walls and Ceiling	
112	4/3/2009	6	12" x 12" Floor Tile with Tan Marbling	None Detected	---	NF	M	---	---	Sq. Ft.	25 Sq. Ft.		
113	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified - Wood Under Carpet - One Wall of Plaster - White and Tan Paint	
113	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - Three Walls of Drywall and Ceiling	

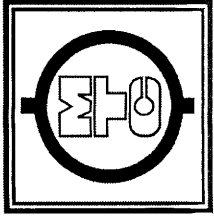


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) Gen.(G)	% Damage		Remarks
									0-1 ND	1-10 MD	
101	4/22/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	1755 Sq. Ft.	1755 Sq. Ft.	White Paint
101	4/22/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	None Detected	---	NF	M	---	132 Sq. Ft.	0 Sq. Ft.	
101	4/22/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	184 Lin. Ft.	0 Lin. Ft.	
101	4/22/2009	4	Plaster	None Detected	---	NF	S	---	NQ	NQ	Not Quantified - Four Walls
101	4/22/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	20 Lin. Ft.	204 Lin. Ft.	
101	4/22/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	Chrysotile	20%	F	T	G	16 Joints	10 Joints	Above Ceiling
101	4/22/2009	8	Drywall	None Detected	---	NF	S	---	NQ	NQ	Not Quantified
101	4/22/2009	11	12" x 12" Floor Tile, Gray with White and Black Flecks	None Detected	---	NF	M	---	Sq. Ft.	160 Sq. Ft.	
102	4/22/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	89 Sq. Ft.	89 Sq. Ft.	White Paint
102	4/22/2009	4	Plaster	None Detected	---	NF	S	---	NQ	NQ	Not Quantified - Four Walls
102	4/22/2009	7	4" Black Cove Base	None Detected	---	NF	M	---	36 Lin. Ft.	36 Lin. Ft.	Concrete Under Carpet
102	4/22/2009	8	Drywall	None Detected	---	NF	S	---	NQ	NQ	Not Quantified

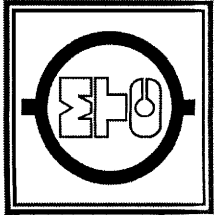


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 18
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Administration Building
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage		Remarks
								0-1 ND	1-10 MD	
103	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	---	F	M	---	149 Sq. Ft.	---	149 Sq. Ft. Concrete Under Carpet
103	4/2/2009	4	Plaster	---	NF	S	---	NQ	---	Not Quantified - Four Walls
103	4/2/2009	5	4" Brown Cove Base	---	NF	M	---	48 Lin. Ft.	---	48 Lin. Ft. White Paint
103	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	20%	F	T	G	5 Joints	ND	6 Joints Above Ceiling
104	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	---	F	M	---	189 Sq. Ft.	---	189 Sq. Ft. White Paint
104	4/2/2009	3	4" Grey Cove Base	---	NF	M	---	54 Lin. Ft.	---	54 Lin. Ft. Concrete Under Carpet
104	4/2/2009	4	Plaster	---	NF	S	---	NQ	---	Not Quantified - Four Walls
104	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	20%	F	T	G	3 Joints	ND	3 Joints Above Ceiling
105	4/2/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	---	NF	M	---	40 Sq. Ft.	---	40 Sq. Ft. Yellow Paint
105	4/2/2009	5	4" Brown Cove Base	---	NF	M	---	50 Lin. Ft.	---	50 Lin. Ft. Block Walls
105	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	20%	F	T	G	20 Joints	ND	17 Joints Above Ceiling
106	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	---	F	M	---	Sq. Ft.	---	128 Sq. Ft.

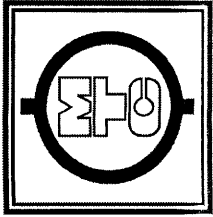


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		% Damage		1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	0-1 ND	1-10 MD			
106	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified - Ceramic Tile Floor - Four Walls and Ceiling	
106	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
107	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified - Ceramic Tile Floor - Four Walls and Ceiling	
107	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	Chrysotile	20%	F	T	G	ND	26 Joints	26 Joints	Above Ceiling	
107	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
108	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	138 Sq. Ft.	138 Sq. Ft.	Concrete Under Carpet	
108	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
108	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	---	46 Lin. Ft.	46 Lin. Ft.		
108	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
109	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	138 Sq. Ft.	138 Sq. Ft.	Concrete Under Carpet	
109	4/2/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	None Detected	---	NF	M	---	---	Sq. Ft.	138 Sq. Ft.		
109	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	

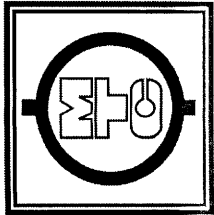


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage		Remarks
								Damage 10-25 D(L) Loc.(L) Gen.(G)	10-25 SD(G) >25 SD	
109	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	46 Lin. Ft.	46 Lin. Ft.
109	4/2/2009	8	Drywall	None Detected	---	NF	S	---	NQ	Not Quantified
110	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	48 Sq. Ft.	48 Sq. Ft.
110	4/2/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	None Detected	---	NF	M	---	48 Sq. Ft.	48 Sq. Ft.
110	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	3 Lin. Ft.	3 Lin. Ft.
110	4/2/2009	4	Plaster	None Detected	---	NF	S	---	NQ	Not Quantified
110	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	21 Lin. Ft.	21 Lin. Ft.
110	4/2/2009	8	Drywall	None Detected	---	NF	S	---	NQ	Not Quantified
111	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	231 Sq. Ft.	231 Sq. Ft.
111	4/2/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	None Detected	---	NF	M	---	231 Sq. Ft.	231 Sq. Ft.
111	4/2/2009	4	Plaster	None Detected	---	NF	S	---	NQ	Not Quantified
111	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	60 Lin. Ft.	60 Lin. Ft.

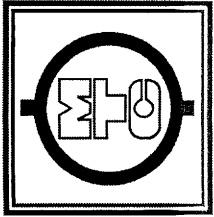


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5489 • FAX (616) 456-5784

Job No.: 081563
Building No.: 18
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Administration Building
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage			Remarks
									0-1 ND	1-10 MD	>25 SD	
111	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
111	4/2/2009	9	Fire Door	Assumed	---	NF	M	G	ND	Door(s)	1 Door(s)	
112	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	225 Sq. Ft.	225 Sq. Ft.	
112	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	64 Lin. Ft.	64 Lin. Ft.	Concrete Under Carpet
112	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
112	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	Chrysotile	20%	F	T	G	ND	12 Joints	12 Joints	Above Ceiling
112	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
113	4/2/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	None Detected	---	NF	M	---	---	40 Sq. Ft.	0 Sq. Ft.	White Paint - Block Walls
113	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified - Ceiling
113	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	---	13 Lin. Ft.	13 Lin. Ft.	
113	4/2/2009	9	Fire Door	Assumed	---	NF	M	---	---	1 Door(s)	1 Door(s)	
113	4/2/2009	11	12" x 12" Floor Tile, Gray with White and Black Flecks	None Detected	---	NF	M	---	---	Sq. Ft.	40 Sq. Ft.	

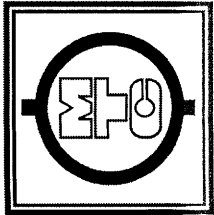


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage Loc.(L) Gen.(G)	1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	10-25 D(L) 10-25 SD(G) >25 SD				
114	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	12 Lin. Ft.	---	
114	4/2/2009	4	Plaster	None Detected	---	NF	S	---	NQ	NQ	---	Not Quantified
114	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	12 Lin. Ft.	0 Lin. Ft.	---	
114	4/2/2009	9	Fire Door	Assumed	---	NF	M	---	1 Door(s)	1 Door(s)	---	
114	4/2/2009	10	12" x 12" White - Random Grooves and Pinholes	None Detected	---	F	M	---	96 Sq. Ft.	120 Sq. Ft.	---	Ceramic Tile Floor
201	4/2/2009	4	Plaster	None Detected	---	NF	S	---	NQ	NQ	---	Not Quantified - Ceramic Tile Floor Under Carpet - Walls and Ceiling
201	4/2/2009	9	Fire Door	Assumed	---	NF	M	G ND	Door(s)	1 Door(s)	---	
202	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	Sq. Ft.	66 Sq. Ft.	---	
202	4/2/2009	4	Plaster	None Detected	---	NF	S	---	NQ	NQ	---	Not Quantified - Ceramic Tile Floor - Walls and Ceiling
202	4/2/2009	8	Drywall	None Detected	---	NF	S	---	NQ	NQ	---	Not Quantified
203	4/2/2009	4	Plaster	None Detected	---	NF	S	---	NQ	NQ	---	Not Quantified - Ceramic Tile Floor - Plaster Walls and Ceiling
204	4/2/2009	2	12" x 12" Floor Tile - Off-White with Black Textured Streaks	None Detected	---	NF	M	---	117 Sq. Ft.	117 Sq. Ft.	---	Block Walls

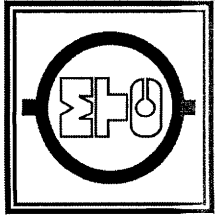


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 18
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Administration Building
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage		Remarks
									0-1 ND	1-10 MD	
204	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	Not Quantified - Concrete Deck
204	4/2/2009	5	4" Brown Cove Base	None Detected	---	NF	M	---	---	46 Lin. Ft.	46 Lin. Ft.
204	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	Chrysotile	20%	F	T	---	---	6 Joints	6 Joints
204	4/2/2009	9	Fire Door	Assumed	---	NF	M	G	ND	1 Door(s)	1 Door(s)
205	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	48 Lin. Ft.	0 Lin. Ft.
205	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	Not Quantified - Concrete Under Carpet
205	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	Not Quantified
206	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	60 Lin. Ft.	0 Lin. Ft.
206	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	Not Quantified
206	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	Not Quantified
207	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	247 Sq. Ft.	247 Sq. Ft.
207	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	64 Lin. Ft.	0 Lin. Ft.

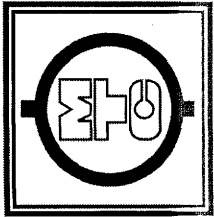


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage		1999 Quantity	2009 Quantity	Remarks
								Loc.(L) Gen.(G)	10-25 SD(G)			
207	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
208	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	276 Sq. Ft.	276 Sq. Ft.	Concrete Under Carpet
208	4/2/2009	7	4" Black Cove Base	None Detected	---	NF	M	---	---	66 Lin. Ft.	66 Lin. Ft.	
209	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	323 Sq. Ft.	323 Sq. Ft.	Concrete Under Carpet
209	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	72 Lin. Ft.	72 Lin. Ft.	
209	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
209	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
210	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	290 Sq. Ft.	290 Sq. Ft.	
210	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	68 Lin. Ft.	0 Lin. Ft.	Concrete Under Carpet - Gray Paint
210	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
210	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
211	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	290 Sq. Ft.	290 Sq. Ft.	

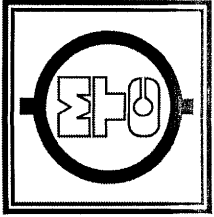


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		% Damage		1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	0-1 ND	1-10 MD			
211	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	68 Lin. Ft.	0 Lin. Ft.	Concrete Under Carpet - Gray Paint	
211	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
211	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
212	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	290 Sq. Ft.	Sq. Ft.		
212	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	68 Lin. Ft.	0 Lin. Ft.	Concrete Under Carpet - Gray Paint	
212	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
212	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
213	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	360 Sq. Ft.	360 Sq. Ft.		
213	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified - Concrete Under Carpet	
213	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified	
214	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	503 Sq. Ft.	503 Sq. Ft.	Concrete Under Carpet	
214	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	124 Lin. Ft.	0 Lin. Ft.		

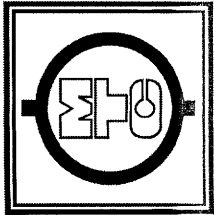


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 18
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Administration Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage		1999 Quantity	2009 Quantity	Remarks
								Loc.(L)	Gen.(G)			
214	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
214	4/2/2009	6	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	Chrysotile	20%	F	T	---	---	Joints	4 Joints	
214	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
215	4/2/2009	1	2' x 4' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	299 Sq. Ft.	299 Sq. Ft.	
215	4/2/2009	3	4" Grey Cove Base	None Detected	---	NF	M	---	---	20 Lin. Ft.	0 Lin. Ft.	
215	4/2/2009	4	Plaster	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
215	4/2/2009	8	Drywall	None Detected	---	NF	S	---	---	NQ	NQ	Not Quantified
301	4/2/2009	12	Sheet Roofing	None Detected	---	NF	M	---	---	NQ	NQ	Roof - Not Quantified - Rubber Membrane roof, with old roofing below, no flashing.

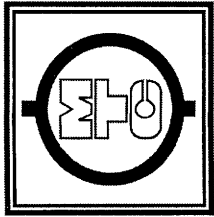


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD			
1	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	None Detected	---	F	T	G	ND	32 Joints	32 Joints	Block Walls - Concrete Floor
1	4/2/2009	14	Green - Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	20 Sq. Ft.	20 Sq. Ft.	
2	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	40 Lin. Ft.	40 Lin. Ft.	White Paint
2	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	19 Joints	19 Joints	Concrete Deck
2	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	40 Lin. Ft.	40 Lin. Ft.	
2	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	100 Sq. Ft.	100 Sq. Ft.	Block Walls
3	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	22 Lin. Ft.	22 Lin. Ft.	Concrete Deck- White Paint - Block Walls
3	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	Joints	3 Joints	
3	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	5 Sq. Ft.	5 Sq. Ft.	Ceramic Tile Floor
4	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	20 Lin. Ft.	20 Lin. Ft.	
4	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	4 Joints	4 Joints	
4	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	127 Lin. Ft.	127 Lin. Ft.	

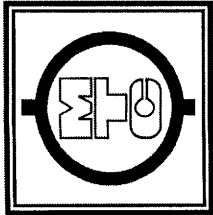


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage 10-25 D(L) 10-25 SD(G) >25 SD	1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Gen.(G)				
4	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	28 Joints	28 Joints	
4	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	468 Sq. Ft.	468 Sq. Ft.	Concrete Deck
4	4/2/2009	14	Green - Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	8 Sq. Ft.	8 Sq. Ft.	
4	4/2/2009	26	4" Grey Vinyl Cove Base	None Detected	---	NF	M	---	---	86 Lin. Ft.	86 Lin. Ft.	Block Walls - White Paint
5	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	19 Lin. Ft.	19 Lin. Ft.	
5	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	4 Joints	4 Joints	
5	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	124 Lin. Ft.	124 Lin. Ft.	White Paint
5	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	25 Joints	25 Joints	
5	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	86 Lin. Ft.	86 Lin. Ft.	Block Walls
5	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	468 Sq. Ft.	468 Sq. Ft.	Concrete Deck
5	4/2/2009	14	Green - Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	8 Sq. Ft.	8 Sq. Ft.	
6	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	23 Lin. Ft.	23 Lin. Ft.	White Paint

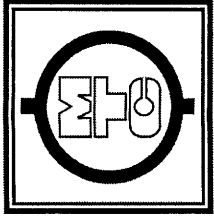


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			% Damage			Quantity	Remarks
							Therm.(T) Misc.(M)	Surf.(S) Damage	Loc.(L) Gen.(G)	0-1 ND	1-10 MD	10-25 D(L)		
6	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	ND	ND	ND	10 Joints	Concrete Deck
6	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	None Detected	---	F	T	---	---	---	---	---	4 Joints	Block Walls
6	4/2/2009	26	4" Grey Vinyl Cove Base	None Detected	---	NF	M	---	---	---	---	---	40 Lin. Ft.	Concrete Deck
7	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	ND	ND	ND	16 Lin. Ft.	Concrete Deck
7	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	ND	ND	ND	5 Joints	White Paint - Ceramic Tile Floor
101	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	L	D	D	D	D	311 Lin. Ft.	Block Walls - Metal Deck - Concrete Floor - Light Green Paint - Patch and Repair
101	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	L	D	D	D	D	92 Joints	Patch and Repair
101	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Glass Heating Lines	None Detected	---	F	T	---	---	---	---	---	7 Joints	
101	4/2/2009	4	Boiler Insulation/Wrap	Chrysotile Amosite	10 - 45% 35%	F	T	L	D	D	D	D	56 Sq. Ft.	Patch and Repair
101	4/2/2009	5	Boiler Duct Insulation	Chrysotile Amosite	10 - 45% 35%	F	T	G	ND	ND	ND	ND	168 Sq. Ft.	Patch and Repair
101	4/2/2009	6	Magnesium Silicate Pipe Insulation on Heat Exchanger	Chrysotile Amosite	10 - 45% 35%	F	T	G	ND	ND	ND	ND	21 Sq. Ft.	
101	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	ND	ND	ND	ND	2 Door(s)	

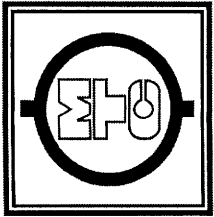


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD		
101	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	L	D	66 Lin. Ft.	Patch and Repair
101	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	L	D	31 Joints	Patch and Repair
101	4/2/2009	25	Internal Boiler Material	Assumed	---	NF	T	---	---	Each	1 Boiler (Pacific Steel Boiler)
102	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	3 Lin. Ft.	Block Walls - Brown and White Paint - Concrete Floor
102	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	2 Joints	
102	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	L	D	8 Lin. Ft.	Patch and Repair
102	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	L	D	2 Joints	Patch and Repair
102	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Not Quantified - Block Walls - Plaster Ceiling
103	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	---	---	40 Lin. Ft.	Assumed - Above Ceiling - No Access
103	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	---	---	8 Joints	Assumed - Above Ceiling - No Access
103	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Not Quantified - Terrazzo Floor - Plaster Ceiling
104	4/2/2009	4	Boiler Insulation/Wrap	Chrysotile Amosite	10 - 45% 35%	F	T	---	---	Sq. Ft.	Not Quantified

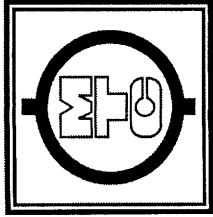


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Quantity	Remarks	
							Surf.(S)	Therm.(T)	Damage Loc.(L) Gen.(G)			
				% Damage								
				0-1 ND	1-10 MD	10-25 D(L)			1999	2009		
				Misc.(M)	>25 SD			Quantity	Quantity			
104	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	ND	2 Door(s)	4 Door(s)	
104	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	L	D	516 Lin. Ft.	516 Lin. Ft.	Above Ceiling
104	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	L	D	104 Joints	104 Joints	Above Ceiling
104	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Block Walls - Concrete Floor
104	4/2/2009	11	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	NF	M	---	---	23364 Sq. Ft.	23364 Sq. Ft.	
105	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	40 Lin. Ft.	40 Lin. Ft.	Assumed in Walls - No Access - Ceramic and Block Walls - Terrazzo Floor - Concrete Deck - Yellow and White Paint
105	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	20 Joints	20 Joints	No Access - Piping Assumed in Walls
106	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	204 Lin. Ft.	58 Lin. Ft.	Block Walls - White Paint - Concrete Deck
106	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	58 Sq. Ft.	204 Sq. Ft.	
106	4/2/2009	26	4" Grey Vinyl Cove Base	None Detected	---	NF	M	---	---	Lin. Ft.	20 Lin. Ft.	
107	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	32 Lin. Ft.	0 Lin. Ft.	
107	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	---	68 Sq. Ft.	68 Sq. Ft.	Terrazzo Floor - Block Walls - White and Purple Paint

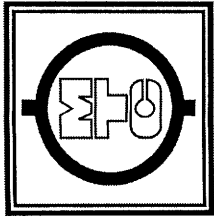


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)			
				% Damage								
				0-1 ND	1-10 MD	10-25 D(L)	10-25 SD(G)					
				Loc.(L)	Gen.(G)	>25 SD						
				Lin. Ft.	Lin. Ft.	Lin. Ft.	Lin. Ft.	Lin. Ft.	Lin. Ft.	Lin. Ft.	Lin. Ft.	
107	4/2/2009	26	4" Grey Vinyl Cove Base	None Detected	---	NF	M	---	---	20	Lin. Ft.	
108	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Block Walls - White and Yellow Paint
109	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	32	Lin. Ft.	0	Lin. Ft. Block Walls - Terrazzo Floor
109	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	68	Sq. Ft.	68	Sq. Ft. Purple and White Paint
110	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	32	Lin. Ft.	0	Lin. Ft. Block Walls - Terrazzo Floor
110	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	68	Sq. Ft.	68	Sq. Ft. Purple and White Paint
110	4/2/2009	26	4" Grey Vinyl Cove Base	None Detected	---	NF	M	---	---	Lin. Ft.	20	Lin. Ft.
111	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	40	Lin. Ft.	40	Lin. Ft. Assumed in Walls - No Access - Concrete Deck - Ceramic and Block Walls - Terrazzo Floor - Yellow and White Paint
111	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	20	Joints	20	Joints No Access - Assumed Piping Above Ceiling
112	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	58	Lin. Ft.	58	Lin. Ft. Concrete Deck - Block Walls - White and Purple Paint
112	4/2/2009	16	9" x 9" Floor Tile - Green with White Streaks	Chrysotile	5%	NF	M	G	204	Sq. Ft.	204	Sq. Ft.
113	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	32	Lin. Ft.	0	Lin. Ft. Block Walls - Purple and White Paint - Terrazzo Floor

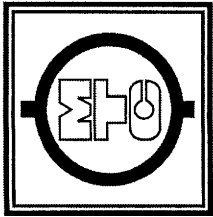


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD		
113	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	68 Sq. Ft.	68 Sq. Ft.	
113	4/2/2009	26	4" Grey Vinyl Cove Base	None Detected	---	NF	M	---	Lin. Ft.	20 Lin. Ft.	
114	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	240 Lin. Ft.	Above Ceiling
114	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	26 Joints	Above Ceiling
114	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	1920 Sq. Ft.	1920 Sq. Ft.	
114	4/2/2009	17	Drywall	None Detected	---	NF	M	---	---	NQ	Not Quantified - Above Ceiling Tile
114	4/2/2009	20	4" Brown Cove Base	None Detected	---	NF	M	---	240 Sq. Ft.	240 Sq. Ft.	Block Walls - Purple and White Paint - Terrazzo Floor
115	4/2/2009	10	Plaster	None Detected	---	NF	S	---	Sq. Ft.	Sq. Ft.	Restroom - Not Quantified - Block Walls - Ceramic Tile Floor
116	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	70 Lin. Ft.	Above Ceiling
116	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	Joints	Assumed
116	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	14 Lin. Ft.	Above Ceiling
116	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	68 Lin. Ft.	68 Lin. Ft.	

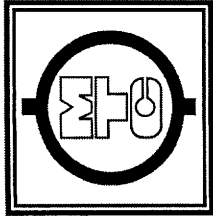


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			1999 Quantity	2009 Quantity	Remarks	
							Surf.(S)	Therm.(T)	Misc.(M)				
				% Damage									
				0-1 ND	1-10 MD	10-25 D(L)	10-25 SD(G)	>25 SD					
116	4/2/2009	17	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified	
116	4/2/2009	18	9" x 9" Floor Tile - Red with White Streaks	Chrysotile	5%	NF	M	G	ND	280 Sq. Ft.	280 Sq. Ft.	White Paint - Floor Tile Under Carpet - Block Walls	
116	4/2/2009	19	12" x 12" Ceiling Tile - White with Random Holes and Pinholes - Glued On	None Detected	---	F	M	---	---	280 Sq. Ft.	280 Sq. Ft.		
117	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	65 Lin. Ft.	78 Lin. Ft.	Above Ceiling	
117	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	Joints	2 Joints		
117	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	13 Lin. Ft.	0 Lin. Ft.	Above Ceiling	
117	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	66 Lin. Ft.	66 Lin. Ft.	White Paint	
117	4/2/2009	16	9" x 9" Floor Tile - Green with White Streaks	Chrysotile	5%	NF	M	G	ND	260 Sq. Ft.	260 Sq. Ft.	Block Walls - Under Carpet	
117	4/2/2009	17	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - One Wall and Above Ceiling Tile	
117	4/2/2009	19	12" x 12" Ceiling Tile - White with Random Holes and Pinholes - Glued On	None Detected	---	F	M	---	---	260 Sq. Ft.	20 Sq. Ft.	Edges Only - Majority of Floor Tile gone	
118	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	76 Lin. Ft.	90 Lin. Ft.	Above Ceiling	
118	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	18 Joints	4 Joints	Above Ceiling	

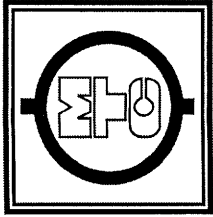


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) Loc.(L) Gen.(G)	% Damage		Remarks	
									0-1 ND	1-10 MD		
118	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	12 Lin. Ft.	0 Lin. Ft.	Above Ceiling
118	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	62 Lin. Ft.	62 Lin. Ft.	Three Block Walls
118	4/2/2009	16	9" x 9" Floor Tile - Green with White Streaks	Chrysotile	5%	NF	M	G	D	230 Sq. Ft.	230 Sq. Ft.	White Paint
118	4/2/2009	17	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - One Wall
118	4/2/2009	19	12" x 12" Ceiling Tile - White with Random Holes and Pinholes - Glued On	None Detected	---	F	M	---	---	260 Sq. Ft.	260 Sq. Ft.	
119	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	26 Lin. Ft.	40 Lin. Ft.	Above Ceiling
119	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	23 Joints	33 Joints	Four Assumed in Wall - Above Ceiling
119	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	14 Lin. Ft.	0 Lin. Ft.	Above Ceiling
119	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	10 Joints	0 Joints	Four Assumed in Wall - Above Ceiling
119	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Block Walls - Terrazzo Floor
120	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	47 Lin. Ft.	89 Lin. Ft.	Twelve in Wall - Above Ceiling
120	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	26 Joints	42 Joints	Four in Wall - Above Ceiling

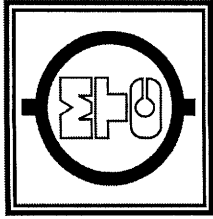


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD			
120	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	42 Lin. Ft.	42 Lin. Ft.	Twelve in Wall - Above Ceiling
120	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	16 Joints	16 Joints	Eight in Wall - Above Ceiling
120	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Terrazzo Floor - White Paint - Block Walls - Plaster Ceiling
121	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	8 Lin. Ft.	0 Lin. Ft.	Above Ceiling - In Wall
121	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	2 Joints	0 Joints	Above Ceiling - In Wall
121	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	8 Lin. Ft.	8 Lin. Ft.	Above Ceiling - In Wall
121	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	2 Joints	2 Joints	Above Ceiling - In Wall
121	4/2/2009	17	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified
121	4/2/2009	19	12" x 12" Ceiling Tile - White with Random Holes and Pinholes - Glued On	None Detected	---	F	M	---	---	20 Sq. Ft.	20 Sq. Ft.	Block Walls - Terrazzo Floor - Pink Paint
122	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	16 Lin. Ft.	16 Lin. Ft.	Above Ceiling
122	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	2 Joints	2 Joints	Above Ceiling
122	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	60 Lin. Ft.	60 Lin. Ft.	

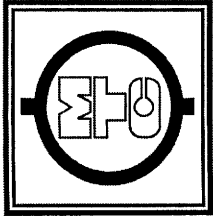


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Quantity	Remarks	
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD			
122	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	220 Sq. Ft.	220 Sq. Ft.	Cinderblock Walls
122	4/2/2009	17	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified
122	4/2/2009	19	12" x 12" Ceiling Tile - White with Random Holes and Pinholes - Glued On	None Detected	---	F	M	---	---	220 Sq. Ft.	220 Sq. Ft.	
123	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Pink Paint - Terrazzo Floor
124	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	24 Lin. Ft.	24 Lin. Ft.	Above Ceiling
124	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	ND	4 Door(s)	4 Door(s)	
124	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	---	592 Sq. Ft.	592 Sq. Ft.	Block Walls - Terrazzo Floor - White and Purple Paint
124	4/2/2009	20	4" Brown Cove Base	None Detected	---	NF	M	---	---	82 Sq. Ft.	82 Sq. Ft.	
125	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	---	---	Lin. Ft.	Lin. Ft.	Not Quantified
125	4/2/2009	13	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M	G	D	5160 Sq. Ft.	5160 Sq. Ft.	
125	4/2/2009	15	12" x 12" Ceiling Tile - White with Lateral Grooves and Random Pinholes - Glued On	None Detected	---	F	M	---	---	270 Sq. Ft.	270 Sq. Ft.	On Wall
125	4/2/2009	20	4" Brown Cove Base	None Detected	---	NF	M	---	---	292 Sq. Ft.	292 Sq. Ft.	White and Purple Paint - Block Walls

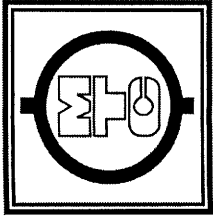


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Quantity	Remarks	
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD			
125	4/2/2009	21	Sprayed On Acoustical Material	Chrysotile	15%	F	S	L	D	5848 Sq. Ft.	5848 Sq. Ft.	Some patch and repair above the entrance to the auditorium
126	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	6 Lin. Ft.	6 Lin. Ft.	
126	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	4 Joints	4 Joints	
126	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Block Walls - Cream Paint - Wood and Terrazzo Floor
126	4/2/2009	20	4" Brown Cove Base	None Detected	---	NF	M	---	---	74 Sq. Ft.	74 Sq. Ft.	
127	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	ND	2 Lin. Ft.	2 Lin. Ft.	
127	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	ND	2 Joints	2 Joints	
127	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	ND	2 Door(s)	2 Door(s)	Block Walls
127	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - White Paint
127	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	30 Lin. Ft.	30 Lin. Ft.	Terrazzo Floor
128	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	ND	2 Door(s)	2 Door(s)	Block Walls
128	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Terrazzo Floor

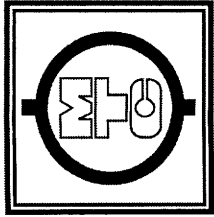


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func-tion Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri-able	Type		Damage Loc.(L) Gen.(G)	% Damage 0-1 ND 1-10 MD 10-25 D(L) 25-50 SD(G) >25 SD	1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Surf.(S) Therm.(T) Misc.(M)					
128	4/2/2009	12	4" Black Cove Base	None Detected	---	NF	M	---	---	---	30 Lin. Ft.	30 Lin. Ft.	White Paint
201	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	---	30 Lin. Ft.	30 Lin. Ft.	Metal Deck - Concrete Floor
201	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	---	14 Joints	14 Joints	
201	4/2/2009	14	Green - Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	---	62 Sq. Ft.	62 Sq. Ft.	
202	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	ND	---	40 Lin. Ft.	40 Lin. Ft.	Metal Deck - Concrete Floor
202	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	ND	---	14 Joints	14 Joints	
202	4/2/2009	14	Green - Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	---	62 Sq. Ft.	62 Sq. Ft.	
203	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	D	---	1 Door(s)	1 Door(s)	
203	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Cinderblock Walls
203	4/2/2009	21	Sprayed On Acoustical Material	Chrysotile	15%	F	S	L	D	---	60 Sq. Ft.	80 Sq. Ft.	Patch and repair
204	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Plaster Walls - White Paint - Concrete Floor
204	4/2/2009	21	Sprayed On Acoustical Material	Chrysotile	15%	F	S	G	SD	---	180 Sq. Ft.	180 Sq. Ft.	*Severe Damage - Do Not Enter!

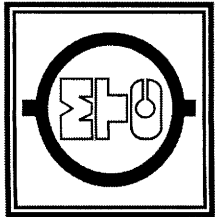


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 19
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Community Arts Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L)		
							Loc.(L)	Gen.(G)	1999 Quantity	2009 Quantity		
205	4/2/2009	1	Aircell Pipe Insulation on Heating Lines	Chrysotile	40%	F	T	G	D	26 Lin. Ft.	0 Lin. Ft.	Block Walls - Metal Deck- Concrete Floor
205	4/2/2009	2	Aircell Pipe Insulation on Joints on Heating Lines	Chrysotile	10%	F	T	G	D	12 Joints	0 Joints	
205	4/2/2009	7	Fire Door	Assumed	---	NF	M	G	ND	1 Door(s)	1 Door(s)	
205	4/2/2009	8	Woolfelt Pipe Insulation on Domestic Cold Water	Chrysotile	40%	F	T	G	D	36 Lin. Ft.	0 Lin. Ft.	
205	4/2/2009	9	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation	Chrysotile	10%	F	T	G	D	5 Joints	0 Joints	
205	4/2/2009	10	Plaster	None Detected	---	NF	S	---	---	Sq. Ft.	Sq. Ft.	Not Quantified
205	4/2/2009	14	Green - Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	32 Sq. Ft.	0 Sq. Ft.	
301	4/2/2009	23	Roof Flashing	Chrysotile	3%	NF	M	---	---	2276 Sq. Ft.	2276 Sq. Ft.	Gravel Ballast
301	4/2/2009	24	Roofing Tar	Assumed	---	NF	M	---	---	34724 Sq. Ft.	34724 Sq. Ft.	

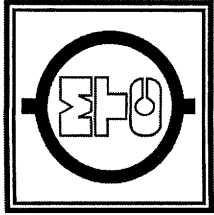


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 23
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Exhibit Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage		1999 Quantity	2009 Quantity	Remarks
								Loc.(L)	Gen.(G)			
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - White and Grey Paint - Metal Walls and Ceiling - Concrete Floor
102	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	22 Sq. Ft.	22 Sq. Ft.	Wood Ceiling - White Paint - Concrete Floor - Block Walls and Metal
103	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	22 Sq. Ft.	22 Sq. Ft.	Wood Ceiling - White Paint - Concrete Floor - Block Walls and Metal
104	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Ceiling - White Paint - Concrete Floor - Block Walls and Metal

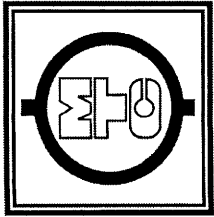


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 24
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Poultry Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD	% Damage 0-1 ND 1-10 MD	1999	2009	Remarks
										Quantity	Quantity	
101	4/2/2009	1	2' x 2' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	269 Sq. Ft.	269 Sq. Ft.	Block Walls - Cream Paint - Ceramic Tile Floor
102	4/2/2009	1	2' x 2' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	269 Sq. Ft.	269 Sq. Ft.	Block Walls - Cream Paint - Ceramic Tile Floor
103	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Ceiling - Brown Paint - Concrete Floor - Block Walls
104	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Wood Ceiling - Concrete Floor - White Paint
105	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Dumb Waiter
106	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Ceiling - White Paint - Concrete Floor - Block Walls
107	4/2/2009	2	Fire Door	Assumed	---	NF	M	G	ND	1 Door(s)	1 Door(s)	Brick Walls - Concrete Floor - Wood Ceiling
108	4/2/2009	3	12" x 12" Floor Tile - Dark Red with Red and Tan Streaks	Chrysotile	3%	NF	M	G	D	85 Sq. Ft.	85 Sq. Ft.	Block Walls - Wood Ceiling - Concrete Floor
109	4/2/2009	2	Fire Door	Assumed	---	NF	M	G	ND	1 Door(s)	1 Door(s)	Wood Ceiling - Concrete Floor - Block Walls
110	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - White Paint - Concrete Floor - Wood Ceiling
111	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - White Paint - Concrete Floor - Wood Ceiling
112	4/2/2009	1	2' x 2' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	84 Sq. Ft.	84 Sq. Ft.	Concrete Under Carpet - Wood Walls

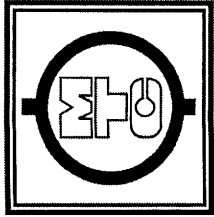


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 24
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Poultry Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) 10-25 SD(G) Gen.(G) >25 SD	% Damage		Quantity	Remarks
									0-1 ND	1-10 MD		
113	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Ceramic Tile Floor - Block Walls - Wood Ceiling
114	4/2/2009	1	2' x 2' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	83 Sq. Ft.	83 Sq. Ft.	Block Walls - White Paint - Concrete Under Carpet
115	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Wood Ceiling - Concrete Floor - White and Salmon Paint
116	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls and Ceiling - Concrete Floor
117	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls and Ceiling - Concrete Floor - White and Salmon Paint
201	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood - White and Salmon Paint - Stairs
202	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - White and Salmon Paint - Wood Walls and Floor
203	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - White Paint - Wood Floor and Ceiling
204	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - White Paint - Wood Floor and Ceiling
205	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Floor and Walls
206	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood and Block Walls - Wood Floor
207	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood and Block Walls - Wood Floor

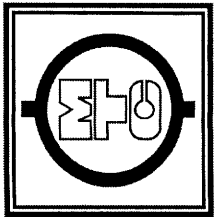


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 24
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Poultry Building
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage Loc.(L) 10-25 SD(G) Gen.(G) >25 SD	1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L)				
208	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Wood Floors - White Paint
209	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood and Block Walls
210	4/2/2009	2	Fire Door	Assumed	---	NF	M	G	ND	1 Door(s)	1 Door(s)	Wood Steps - Brick Walls - White and Salmon Paint
211	4/2/2009	2	Fire Door	Assumed	---	NF	M	G	ND	1 Door(s)	1 Door(s)	Wood Steps - Brick Walls - White and Salmon Paint
301	4/2/2009	4	Roof Shingles - Brown	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified
401	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Bricks

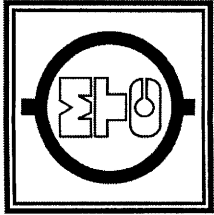


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5489 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 25
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Milk House
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD	% Damage		Remarks
									0-1 ND	1-10 MD	
101	4/2/2009	2	Window Caulk	None Detected	---	NF	M	---	240 Lin. Ft.	240 Lin. Ft.	Concrete Walls - Wood Ceiling - Ceramic Tile Floor - White Paint
201	4/2/2009	1	Transite Panels	Chrysotile	30%	NF	M	G	24 Sq. Ft.	24 Sq. Ft.	Attic Area
301	4/2/2009	3	Roof Shingles - Red/Grey	None Detected	---	NF	M	---	Sq. Ft.	Sq. Ft.	Not Quantified

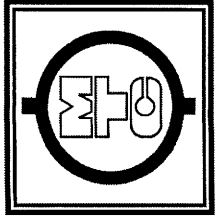


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 26
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Red Brick Comfort Station
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type			1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)			
							% Damage					
							0-1 ND	1-10 MD	>25 SD	1999	2009	
101	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	60 Lin. Ft.	60 Lin. Ft.	Block Walls - Wood Ceiling - Concrete Floor - Brown Paint
102	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	240 Lin. Ft.	240 Lin. Ft.	Block Walls - Wood Ceiling - Concrete Floor - Grey Paint
103	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	40 Lin. Ft.	40 Lin. Ft.	Block Walls - Wood Ceiling - Concrete Floor
104	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	60 Lin. Ft.	60 Lin. Ft.	Block Walls - White Paint - Concrete Floor - Wood Ceiling
105	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	240 Lin. Ft.	240 Lin. Ft.	Block Walls - Wood Ceiling - Concrete Floor - Grey Paint
106	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	60 Lin. Ft.	60 Lin. Ft.	Wood Ceiling - Concrete Floor - Block Walls
107	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	30 Lin. Ft.	30 Lin. Ft.	Block Walls - Wood Ceiling - Concrete Floor
108	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	30 Lin. Ft.	30 Lin. Ft.	Block Walls - Wood Ceiling - Concrete Floor
109	4/3/2009	1	Window Caulk	None Detected	---	NF	M	---	---	60 Lin. Ft.	60 Lin. Ft.	Concrete Floor - Wood Floor - Block Walls - Brown Paint
201	4/3/2009	2	Roof Tar on Flashing	Chrysotile	5%	NF	M	G	D	1870 Sq. Ft.	1870 Sq. Ft.	

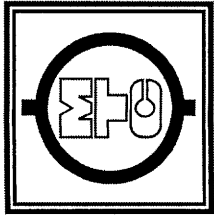


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 27
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Pavilion South of Band Shell
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) Loc.(L) 10-25 SD(G) >25 SD	% Damage 0-1 ND 1-10 MD 10-25 D(L) 10-25 SD(G) >25 SD	1999	2009	Remarks
										Quantity	Quantity	
0	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - No Walls - Metal Deck - Concrete Floor

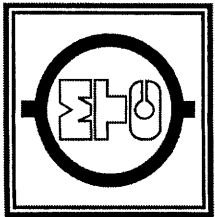


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 28
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Restrooms (North)
Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type			Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)		
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Ceramic Tile Floor - Block Walls - Metal Pan Ceiling - Cream and Brownish Paint
102	4/3/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Waqter Lines	None Detected	---	F	T	---	70 Joints	70 Joints	Concrete Floor - Block Walls
102	4/3/2009	2	Fire Door	Assumed	---	NF	M	G	1 Door(s)	1 Door(s)	
103	4/3/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Waqter Lines	None Detected	---	F	T	---	2 Joints	2 Joints	Block Walls - Metal Pan Ceiling - Ceramic Tile Floor - Joints in Chase
104	4/3/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Waqter Lines	None Detected	---	F	T	---	92 Joints	92 Joints	Concrete Floor - Block Walls
105	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Cream Paint - Metal Pan Ceiling - Ceramic Tile Floor - Block Walls
106	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Cream Paint - Metal Pan Ceiling - Ceramic Tile Floor - Block Walls
107	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Metal Pan Ceiling - Brick Walls - Concrete Floor
201	4/3/2009	3	Black, Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	12 Sq. Ft.	12 Sq. Ft.	
201	4/3/2009	4	Drywall	None Detected	---	NF	M	---	NQ	NQ	Not Quantified - Above Function Area 102
301	4/3/2009	5	Roof Shingles - Brown	None Detected	---	NF	M	---	NQ	NQ	Not Quantified

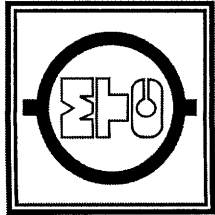


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 29
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Plaza Toilet Building
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			Remarks
								0-1 ND	1-10 MD	>25 SD	
							Loc.(L)	Gen.(G)	1999 Quantity	2009 Quantity	
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Ceramic Tile Floor -
102	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Block Walls
103	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Block Walls
104	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Block Walls
105	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Ceramic Tile Floor - Brown Paint
106	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected

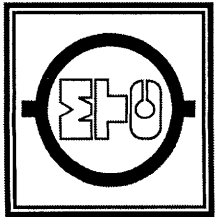


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5489 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 30
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: White Brick Comfort Station
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			% Damage			Quantity	Quantity	Remarks
							Therm.(T)	Misc.(M)	Damage	0-1 ND	1-10 MD	10-25 D(L)			
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Brick Walls - Brown, Cream and Grey Paint - Concrete Floor - Wood Ceiling
102	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Brown, Cream and Grey Paint - Concrete Floor
103	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Brown, Cream and Grey Paint - Wood Ceiling
201	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Brown, Cream and Grey Paint - Block Walls
301	4/3/2009	1	Roofing Material - Upper Layer - Reddish Brown	None Detected	---	NF	M	---	---	---	---	1920 Sq. Ft.	1920 Sq. Ft.	---	No Asbestos Detected - Brick Walls
301	4/3/2009	2	Roofing Material - Lower Layer - Silver	Chrysotile	3%	NF	M	G	ND	---	---	1920 Sq. Ft.	1920 Sq. Ft.	---	Below Upper Roof

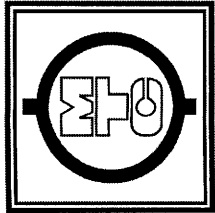


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 31
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: White Electrical Shack
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) 10-25 SD(G) Gen.(G) >25 SD	% Damage		Remarks
									0-1 ND	1-10 MD	
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - Asphalt Floor - Wood Walls and Ceiling - White Paint
102	4/3/2009	2	Transite Sheets	Chrysotile	15%	NF	M	G	Sq. Ft.	36 Sq. Ft.	Asphalt Floor - Wood Walls and Ceiling - White Paint
102	4/3/2009	3	Fire Door	Assumed	---	NF	M	G	Door(s)	1 Door(s)	Assumed
201	4/3/2009	1	Roof Shingles	Chrysotile	3%	NF	M	---	220 Sq. Ft.	220 Sq. Ft.	

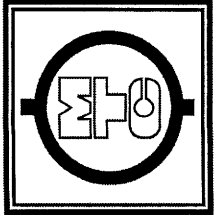


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 32
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: South Goat Barn
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD	% Damage 0-1 ND 1-10 MD	1999	2009	Remarks
										Quantity	Quantity	
101	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - White Paint - Metal Roof - Concrete Floor - No Walls

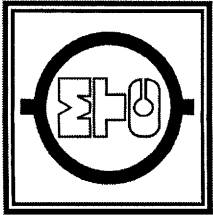

Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 33
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: North Goat Barn
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage		Remarks
									0-1 ND	1-10 MD	
101	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	No Asbestos Detected - White Paint - Metal Roof - Concrete Floor - No Walls
									1999	2009	Quantity