


SECTION 4.4 – ASBESTOS INSPECTION REPORT

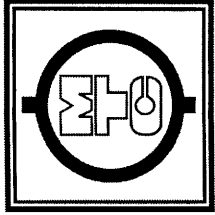

**Materials
Testing
Consultants, Inc.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 1


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Michigan Mart

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage Loc.(L) Gen.(G)	% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD		0-1 ND	1-10 MD				
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey, Brown, Tan, Cream and White Paint - Concrete Floor - Block Walls
102	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey, Brown, Tan, Cream and White Paint - Concrete Floor - Block Walls
103	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Tan, White and Cream Paint - Concrete Floor
104	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - White and Brown Paint - Concrete Floor - Metal Walls
104.1	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	---	---	NQ	NQ		Not Quantified
105	4/3/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	---	5 Joints	5 Joints		Concrete Floor - Block Walls - Grey and Green Paint
106	4/3/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	---	18 Joints	18 Joints		Concrete Floor - Block Walls
106	4/3/2009	2	Grey, Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	---	---	8 Sq. Ft.	8 Sq. Ft.		
107	4/3/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	---	2 Joints	2 Joints		Grey and Cream Paint - Concrete Floor - Block Walls
108	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Concrete Floor - Grey and Cream Paint
109	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Ceiling - Concrete Floor - Block Walls
110	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	---	---	NQ	NQ		Not Quantified

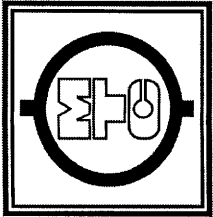


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 1
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Michigan Mart
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) Loc.(L) 10-25 SD(G) >25 SD	% Damage 0-1 ND 1-10 MD	1999 Quantity	2009 Quantity	Remarks
201	4/3/2009	3	Roof Shingles - Black	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified

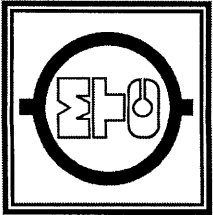


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 2
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: West Mall
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Damage 10-25 D(L) 10-25 SD(G) >25 SD	1999 Quantity	2009 Quantity	Remarks																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																						
							Surf.(S)	Therm.(T)	Misc.(M)																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																										
							% Damage																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																												

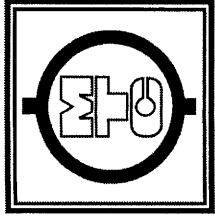

**Materials
Testing
Consultants, Inc.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 3


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Agriculture Building

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Damage 10-25 D(L)	Loc.(L)	0-1 ND	1-10 MD	>25 SD			
101	4/3/2009	1	Window Caulk	Chrysotile	3%	NF	M	G	D				6410 Lin. Ft.	6410 Lin. Ft.	Brick Walls - Blue Paint
101	4/3/2009	2	1' x 2' Block Flooring Material - Black	Chrysotile	10%	NF	M	G	D				24990 Sq. Ft.	24990 Sq. Ft.	Majority of HA-2 in now under Basketball Court
101	4/3/2009	6	4" Black Vinyl Cove Base	None Detected	---	NF	M	---	---				Lin. Ft.	338 Lin. Ft.	
102	4/3/2009	1	Window Caulk	Chrysotile	3%	NF	M	G	D				135 Lin. Ft.	135 Lin. Ft.	Concrete Floor - Block Walls - White Paint
103	4/3/2009	1	Window Caulk	Chrysotile	3%	NF	M	G	D				135 Lin. Ft.	135 Lin. Ft.	White Paint - Concrete Floor - Brick Walls
104	4/3/2009	3	Cork Insulation Board	None Detected	---	NF	M	---	---				275 Sq. Ft.	275 Sq. Ft.	Brick Walls - Ceramic Tile Floor
105	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---				---	---	No Asbestos Detected - Block Walls - Concrete Floor - White Paint
106	4/3/2009	3	Cork Insulation Board	None Detected	---	NF	M	---	---				275 Sq. Ft.	275 Sq. Ft.	Ceramic Tile Floor - Block Walls
107	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---				---	---	No Asbestos Detected - Brick Walls - Concrete Floor and Deck
108	4/3/2009	4	Fire Door	Assumed	---	NF	M	G	D				2 Door(s)	2 Door(s)	Concrete Floor - Block Walls - Blue Paint - Concrete Deck
109	4/3/2009	1	Window Caulk	Chrysotile	3%	NF	M	G	D				140 Lin. Ft.	140 Lin. Ft.	Light and Dark Green Paint - Concrete Deck - Concrete Floor - Brick Walls
110	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---				---	---	No Asbestos Detected - Brick Walls - Concrete Floor and Deck - Grey Paint

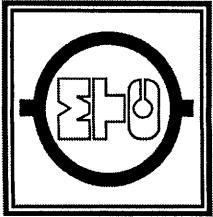


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 3
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Agriculture Building
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type			% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)	Damage Loc.(L)	Gen.(G)	>25 SD			
111	4/3/2009	4	Fire Door	Assumed	---	NF	M			G	D	0-1 ND	2 Door(s)		Blue Paint - Concrete Floor and Deck - Block Walls
112	4/3/2009	1	Window Caulk	Chrysotile	3%	NF	M			G	D	1-10 MD	140 Lin. Ft.		Concrete Floor and Deck - Block Walls - Light and Dark Green Paint
113	4/3/2009	4	Fire Door	Assumed	---	NF	M			G	D	10-25 D(L)	2 Door(s)		Concrete Floor and Deck - Blue and Grey Paint - Brick Walls
114	4/3/2009	4	Fire Door	Assumed	---	NF	M			G	D	10-25 SD(G)	2 Door(s)		
115	4/3/2009	1	Window Caulk	Chrysotile	3%	NF	M			G	D	>25 SD	360 Lin. Ft.		
115	4/3/2009	4	Fire Door	Assumed	---	NF	M			G	D		8 Door(s)		Concrete Floor and Deck - Brick Walls - Grey and Blue Paint
116	4/3/2009	4	Fire Door	Assumed	---	NF	M			G	D		1 Door(s)		
116	4/3/2009	5	Plaster	None Detected	---	NF	S			---	---		NQ		Not Quantified - Ceramic Tile Floor - Block Walls - Blue Paint - Plaster Ceiling
117	4/3/2009	4	Fire Door	Assumed	---	NF	M			G	D		1 Door(s)		Plaster Ceiling
117	4/3/2009	5	Plaster	None Detected	---	NF	S			---	---		NQ		Not Quantified - Blue Paint - Ceramic Tile Floor - Block Walls

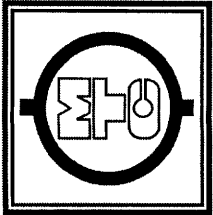


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 4
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: East Mall
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Damage Loc.(L) Gen.(G)	1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD	% Damage 0-1 ND 1-10 MD				
101	4/3/2009	0	No Suspect Asbestos Containing Materials Found In This Area										No Asbestos Detected - Metal Deck - Brown Paint - Concrete Floor

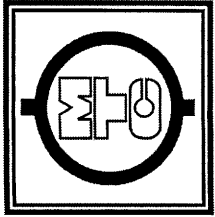


Materials Testing Consultants, INC.
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) Loc.(L) Gen.(G)	% Damage		2009 Quantity	Remarks
									0-1 ND	1-10 MD		
101	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	L	D		220 Lin. Ft.	Concrete Floor - Block Walls - Patch and Repair
101	4/1/2009	4	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	35%	F	T	L	D		63 Joints	Grey Paint - Patch and Repair
101	4/1/2009	5	Tank Insulation	Chrysotile Amosite	40% 20%	F	T	L	D		264 Sq. Ft.	Patch and Repair
101	4/1/2009	6	Boiler Insulation	Amosite Chrysotile	35% 10%	F	T	L	D		672 Sq. Ft.	Patch and Repair
101	4/1/2009	7	Interior Boiler Materials	Assumed	---	F	T	---	---	NQ	NQ	Not Quantified - No Access
101	4/1/2009	8	Boiler Duct Insulation	Amosite Crocidolite Chrysotile	20% 5% 3%	F	T	G	ND		242 Sq. Ft.	
102	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D		2 Door(s)	Block Walls - White Paint - Ceramic Tile Floor
102	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	Not Quantified - South Wall Only
103	4/1/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - White Paint - Concrete Floor - Black Paint Walls
104	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D		2 Door(s)	Block Walls - White/Blue Paint - Ceramic Tile Floor
105	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D		1 Door(s)	White and Blue Paint - Concrete Floor - Block Walls
106	4/1/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Brick Walls - Concrete Floor

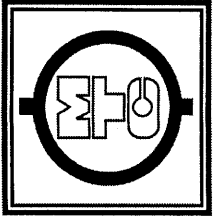


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type			Damage Loc (L) 10-25 SD(G) >25 SD	1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)				
										% Damage			
										0-1 ND			
										1-10 MD			
										10-25 D(L)			
										10-25 SD(G)			
										>25 SD			
107	4/1/2009	11	9" x 9" Floor Tile - Tan with Brown and White Streaks	Chrysotile	3%	NF	M			D	109 Sq. Ft.	109 Sq. Ft.	Nothing Above Ceiling - Wood Paneling On Walls
108	4/1/2009	12	3' x 3' Vinyl Sheet Flooring - Off-White with Light Grey Streaks	None Detected	---	NF	M			---	1950 Sq. Ft.	1950 Sq. Ft.	
108	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M			---	190 Sq. Ft.	190 Sq. Ft.	
108	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M			---	1950 Sq. Ft.	1950 Sq. Ft.	
108	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T			---	14 Joints	14 Joints	Block Walls - Above Ceiling
109	4/1/2009	12	3' x 3' Vinyl Sheet Flooring - Off-White with Light Grey Streaks	None Detected	---	NF	M			---	1508 Sq. Ft.	1508 Sq. Ft.	Block Walls
109	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M			---	162 Sq. Ft.	162 Sq. Ft.	
109	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M			---	1508 Sq. Ft.	1508 Sq. Ft.	
109	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T			---	22 Joints	22 Joints	Above Ceiling
110	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T			---	17 Joints	17 Joints	Debris on Floor - Pipe Chase
111	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T			---	65 Joints	65 Joints	Concrete Floor - Block Walls
112	4/1/2009	10	Drywall	None Detected	---	NF	M			---	NQ	NQ	Not Quantified

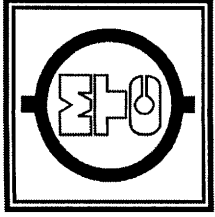


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 5
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Coliseum
 Date: 16-May-09

Building Survey Summary

Func- Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-Fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	Damage 10-25 D(L) Loc.(L) Gen.(G) >25 SD			
112	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	38 Joints	38 Joints	AHU Above - Concrete Floor
112	4/1/2009	29	Tank Wrap on Domestic Hot Water	None Detected	---	F	T	G	ND	---	168 Sq. Ft.	168 Sq. Ft.	4 Tanks
113	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	104 Sq. Ft.	104 Sq. Ft.	
113	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	258 Sq. Ft.	258 Sq. Ft.	
113	4/1/2009	16	2' x 2' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	---	30 Sq. Ft.	30 Sq. Ft.	Block Walls
113	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---	---	240 Sq. Ft.	240 Sq. Ft.	
113	4/1/2009	30	Dark Green Rubber Flooring	None Detected	---	NF	M	G	D	---	240 Sq. Ft.	240 Sq. Ft.	
114	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	G	SD	---	8 Lin. Ft.	8 Lin. Ft.	Poor Condition
114	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	76 Joints	76 Joints	Block Walls
115	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	6 Joints	6 Joints	Above Ceiling
115	4/1/2009	18	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	---	492 Sq. Ft.	492 Sq. Ft.	Block Walls - Ceramic Tile Floor
116	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	57 Joints	57 Joints	Debris on Floor - Pipe Chase

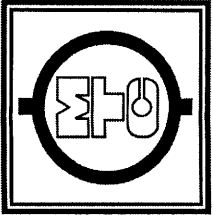


Materials Testing Consultants, INC.
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			Remarks
								0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD	
117	4/1/2009	18	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	408 Sq. Ft.	Blue Walls - Ceramic Tile Floor
118	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	16 Joints	16 Joints	Pipe Chase
119	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	30 Lin. Ft.	30 Lin. Ft.	Concrete Floor - Brick Walls
120	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	30 Lin. Ft.	30 Lin. Ft.	Concrete Floor - Brick Walls
121	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	L	D	6 Lin. Ft.	Concrete Floor - Brick Walls - White and Tan Paint - Patch and Repair
122	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	276 Sq. Ft.	Block Walls - Ceramic Tile Floor
123	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	Not Quantified - Southwest Walls Only - White Paint - Ceramic Tile Floor - Block Walls
124	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	Not Quantified - Above Ceiling
124	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	208 Sq. Ft.	Cream Paint - Block Walls - Ceramic Tile Floor
125	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	Not Quantified - Above Ceiling
125	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	208 Sq. Ft.	Block Walls - Ceramic Tile Floor - Cream Paint
126	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	Not Quantified - Block Walls - Ceramic Tile Floor

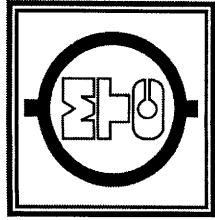

**Materials
Testing
Consultants, Inc.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 5


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Coliseum

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage Loc.(L) Gen.(G)	% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)		0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD			
126	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	---	---	---	---	240 Lin. Ft.	240 Lin. Ft.	
126	4/1/2009	21	2' x 4' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	---	---	---	209 Sq. Ft.	209 Sq. Ft.	
126	4/1/2009	22	2' x 4' Ceiling Tile - White - Textured	None Detected	---	F	M	---	---	---	---	---	322 Sq. Ft.	322 Sq. Ft.	White Paint
127	4/1/2009	23	2' x 4' Ceiling Tile - White - Lateral Pits and Random Pinholes	None Detected	---	F	M	---	---	---	---	---	336 Sq. Ft.	336 Sq. Ft.	Block Walls - Concrete Floor
128	4/1/2009	24	Textured Paint	None Detected	---	NF	M	---	---	---	---	---	NQ	NQ	Not Quantified - Two Walls
128	4/1/2009	25	2' x 4' Ceiling Tile - White - Random Pits and Pinholes	None Detected	---	F	M	---	---	---	---	---	192 Sq. Ft.	192 Sq. Ft.	Rust and White Paint
129	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	---	---	NQ	NQ	Not Quantified - Four Walls - Ceramic Tile Floor
129	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	---	---	94 Sq. Ft.	94 Sq. Ft.	Rust and White Paint
130	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	---	---	NQ	NQ	Not Quantified - Three Walls - One Block Wall - Ceramic Tile Floor
130	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	---	---	633 Sq. Ft.	633 Sq. Ft.	Rust and White Paint
131	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	---	---	288 Sq. Ft.	288 Sq. Ft.	Rust and White Paint
131	4/1/2009	16	2' x 2' Ceiling Tile - White - Smooth	None Detected	---	F	M	---	---	---	---	---	Sq. Ft.	Sq. Ft.	Not Quantified - Ceramic Tile Floor

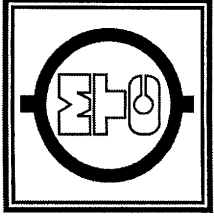


**Materials
Testing
Consultants, INC.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) Loc(L) Gen.(G)			
132	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Four Walls - Rust and White Paint
132	4/1/2009	26	2' x 2' Ceiling Tile - White - Long Lateral Grooves and Pinholes	None Detected	---	F	M	---	---	---	285 Sq. Ft.	285 Sq. Ft.	Ceramic Tile Floor
133	4/1/2009	26	2' x 2' Ceiling Tile - White - Long Lateral Grooves and Pinholes	None Detected	---	F	M	---	---	---	66 Sq. Ft.	66 Sq. Ft.	Block Walls - White Paint - Ceramic Tile Floor
134	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	559 Sq. Ft.	559 Sq. Ft.	
134	4/1/2009	27	12" x 12" Floor Tile - Tan and Light Brown - Square Pattern	None Detected	---	NF	M	---	---	---	559 Sq. Ft.	559 Sq. Ft.	Wood Paneling On Walls
135	4/1/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Furnace Room
136	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Four Walls - White Paint
136	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	36 Sq. Ft.	36 Sq. Ft.	Ceramic Tile Floor
137	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Four Walls - Ceramic Tile Floor
137	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	51 Sq. Ft.	51 Sq. Ft.	White Paint
138	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	49 Sq. Ft.	49 Sq. Ft.	Ceramic Tile Floor - Block Walls - White Paint
139	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Two Walls - Block Walls - Concrete Floor

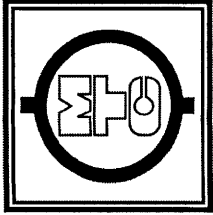


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) Loc (L) Gen.(G)			
139	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	34 Sq. Ft.	34 Sq. Ft.	
140	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	NQ	Not Quantified
140	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	---	228 Sq. Ft.	228 Sq. Ft.	Block Walls - Cream Paint - Ceramic Tile Floor
141	4/1/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Concrete Floor - Blue/White Paint
142	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	NQ	NQ	NQ	Not Quantified - Above Ceiling
142	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	---	208 Sq. Ft.	208 Sq. Ft.	Block Walls - Ceramic Tile Floor
143	4/1/2009	18	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	---	456 Sq. Ft.	456 Sq. Ft.	Ceramic Tile Floor - Block Walls
144	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	10 Joints	10 Joints	Pipe Chase
145	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	56 Joints	56 Joints	Debris on Floor
145	4/1/2009	28	Black Fine Weave Vibration Dampening Cloth	None Detected	---	NF	M	---	---	---	8 Sq. Ft.	8 Sq. Ft.	
146	4/1/2009	18	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	---	432 Sq. Ft.	432 Sq. Ft.	Block Walls - Ceramic Tile Floor
147	4/1/2009	15	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	None Detected	---	F	T	---	---	---	20 Joints	20 Joints	Pipe Chase

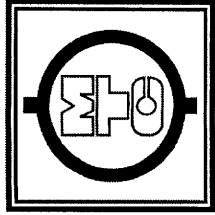

**Materials
Testing
Consultants, INC.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 5


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Coliseum

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) Loc.(L) Gen.(G)			
148	4/1/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected
149	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Block Walls - Ceramic Tile Floor
150	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	28 Sq. Ft.	28 Sq. Ft.	Block Walls - Concrete Under Carpet
150	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	51 Sq. Ft.	51 Sq. Ft.	
150	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---	---	51 Sq. Ft.	51 Sq. Ft.	
151	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	40 Sq. Ft.	40 Sq. Ft.	
151	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	99 Sq. Ft.	99 Sq. Ft.	
152	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D	---	1 Door(s)	1 Door(s)	
153	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	64 Sq. Ft.	64 Sq. Ft.	
153	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	257 Sq. Ft.	257 Sq. Ft.	Block Walls - Cream Paint
153	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---	---	257 Sq. Ft.	257 Sq. Ft.	
154	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	96 Sq. Ft.	96 Sq. Ft.	Cream and Blue Paint

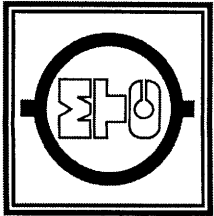


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type		Damage Loc (L) Gen (G)	% Damage		1999 Quantity	2009 Quantity	Remarks
							Surf (S) Therm (T) Misc (M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD		0-1 ND	1-10 MD			
154	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---	---	---	192 Sq. Ft.	192 Sq. Ft.	Block Walls
155	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D	---	---	1 Door(s)	1 Door(s)	Concrete Floor
156	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	56 Sq. Ft.	56 Sq. Ft.	Block Walls - Cream Paint - Concrete Under Carpet
157	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	50 Sq. Ft.	50 Sq. Ft.	Concrete Under Carpet
157	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	---	---	158 Sq. Ft.	158 Sq. Ft.	Block Walls - Cream Paint
158	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	38 Sq. Ft.	38 Sq. Ft.	Cream Paint - Block Walls - Concrete Under Carpet
159	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D	---	---	43 Lin. Ft.	43 Lin. Ft.	Ceramic Tile Floor
159	4/1/2009	4	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D	---	---	1 Joints	1 Joints	Blue and White Paint
159	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D	---	---	1 Door(s)	1 Door(s)	
160	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D	---	---	19 Lin. Ft.	19 Lin. Ft.	Ceramic Tile Floor
160	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D	---	---	2 Door(s)	2 Door(s)	Blue and White Paint
161	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---	---	---	788 Sq. Ft.	788 Sq. Ft.	Blue and Cream Paint

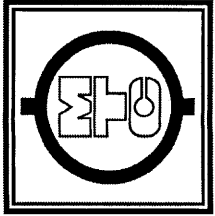


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 5
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Coliseum
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-Fri- able	Type			% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Therm.(T)	Damage Loc.(L) Gen.(G)	0-1 ND	1-10 MD	10-25 D(L)			
162	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	64 Sq. Ft.	64 Sq. Ft.		
162	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	---	257 Sq. Ft.	257 Sq. Ft.		Block Walls - Cream Paint
162	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---	---	---	257 Sq. Ft.	257 Sq. Ft.		
163	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	---	NQ	NQ		Not Quantified - Block Walls - Ceramic Tile Floor
164	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	40 Sq. Ft.	40 Sq. Ft.		
164	4/1/2009	14	2' x 2' Ceiling Tile - White with Random Pits and Pinholes	None Detected	---	F	M	---	---	---	---	99 Sq. Ft.	99 Sq. Ft.		Block Walls - Concrete Under Carpet
165	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D	---	---	1 Door(s)	1 Door(s)		
166	4/1/2009	9	Fire Door	Assumed	---	NF	M	G	D	---	---	1 Door(s)	1 Door(s)		
167	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	50 Sq. Ft.	50 Sq. Ft.		Concrete Under Carpet
167	4/1/2009	20	2' x 2' Ceiling Tile - White with Random Pits and Pinholes - Recessed	None Detected	---	F	M	---	---	---	---	158 Sq. Ft.	158 Sq. Ft.		Block Walls - Cream Paint
168	4/1/2009	13	4" Black Cove Base	None Detected	---	NF	M	---	---	---	---	56 Sq. Ft.	56 Sq. Ft.		Concrete Under Carpet - Block Walls - Cream Paint
201	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	L	D	---	---	1071 Lin. Ft.	1071 Lin. Ft.		Patch and Repair

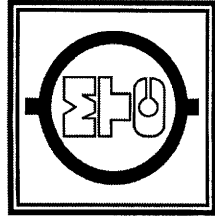

**Materials
Testing
Consultants, Inc.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-3784

Job No.: 081563

Building No.: 5


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Coliseum

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	D	1-10 MD	10-25 D(L)	>25 SD			
201	4/1/2009	4	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	35%	F	T	L	D				46 Joints	46 Joints	Patch and Repair
201	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---				NQ	NQ	Not Quantified
201	4/1/2009	17	3' x 3' Vinyl Flooring - Teal with White Streaks	None Detected	---	NF	M	---	---				208 Sq. Ft.	208 Sq. Ft.	
201	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	---				1968 Lin. Ft.	1968 Lin. Ft.	Blue Paint - Concrete Floor
202	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D				46 Lin. Ft.	46 Lin. Ft.	Debris on Floor - Patch and Repair
202	4/1/2009	4	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D				2 Joints	2 Joints	Debris on Floor - Patch and Repair
202	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---				NQ	NQ	Not Quantified - Blue Paint - Two Walls of Drywall - Concrete Floor
202	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	---				96 Lin. Ft.	96 Lin. Ft.	
203	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D				42 Lin. Ft.	42 Lin. Ft.	Debris on Floor - Patch and Repair
203	4/1/2009	4	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D				4 Joints	4 Joints	Debris on Floor - Patch and Repair
203	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---				NQ	NQ	Not Quantified - White and Blue Paint - Two Walls of Drywall - Concrete Floor
203	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	---				48 Lin. Ft.	48 Lin. Ft.	

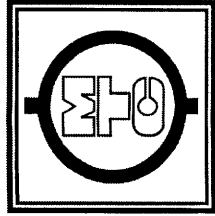

**Materials
Testing
Consultants, INC.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 5


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Coliseum

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) Loc.(L) 10-25 SD(G) >25 SD			
204	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Concrete Floor - Two Walls
204	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	---	---	48 Lin. Ft.	48 Lin. Ft.	Two Windows
205	4/1/2009	3	Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D	---	42 Lin. Ft.	42 Lin. Ft.	Patch and Repair
205	4/1/2009	4	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	35%	F	T	G	D	---	2 Joints	2 Joints	Patch and Repair
205	4/1/2009	10	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified - Two Walls of Drywall - Concrete Floor
205	4/1/2009	19	Window Caulk	None Detected	---	NF	M	---	---	---	48 Lin. Ft.	48 Lin. Ft.	Two Windows

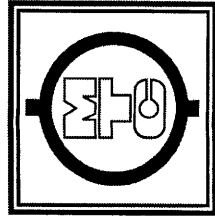

**Materials
Testing
Consultants, INC.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 6


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Dairy Cattle Building

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage Loc.(L) Gen.(G)	% Damage		1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	10-25 D(L) 10-25 SD(G) >25 SD		0-1 ND 1-10 MD				
101	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block/Brick Walls - Concrete Floor - Blue and Yellow Paint
102	4/2/2009	1	Window Caulk	None Detected	---	NF	M	---	---	---	108 Lin. Ft.	108 Lin. Ft.	108 Lin. Ft.	Concrete Floor - Block Walls - Blue Paint
103	4/2/2009	1	Window Caulk	None Detected	---	NF	M	---	---	---	120 Lin. Ft.	120 Lin. Ft.	120 Lin. Ft.	Concrete Floor - Block Walls - Blue Paint
104	4/2/2009	1	Window Caulk	None Detected	---	NF	M	---	---	---	3840 Lin. Ft.	3840 Lin. Ft.	3840 Lin. Ft.	Block Walls - Blue Paint - Concrete Floor
105	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Ceramic Tile Floor - Concrete Roof Deck - Brick Walls
106	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Concrete Roof Deck - Ceramic Tile Floor
107	4/2/2009	3	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	NQ	Not Quantified - Block Walls - Drywall Wall and Ceiling - Concrete Floor
201	4/2/2009	1	Window Caulk	None Detected	---	NF	M	---	---	---	50 Lin. Ft.	50 Lin. Ft.	50 Lin. Ft.	Concrete Walls
201	4/2/2009	2	Fire Door	Assumed	---	NF	M	G	D	---	1 Door(s)	1 Door(s)	1 Door(s)	Blue Paint - Concrete Floor
202	4/2/2009	1	Window Caulk	None Detected	---	NF	M	---	---	---	90 Lin. Ft.	90 Lin. Ft.	90 Lin. Ft.	Concrete Floor - Wood Paneling on Walls
203	4/2/2009	1	Window Caulk	None Detected	---	NF	M	---	---	---	45 Lin. Ft.	45 Lin. Ft.	45 Lin. Ft.	Blue Paint - Concrete Floor and Walls
204	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Walls

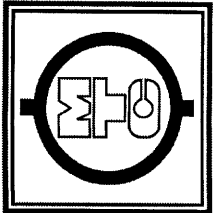

**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 7
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Pole Barn
Date: 16-May-09

Building Survey Summary


Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage				Remarks
								0-1 ND	1-10 MD	10-25 D(L)	>25 SD	
101	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	No Asbestos Detected - Metal Roof - Concrete and Dirt Floor



Job No.:	081563
Building No.:	8
Project:	Updated Michigan
Building:	North River
Date:	16-May-08

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	% Damage				Remarks																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																								
							Type	Surf.(S)	Therm.(T)	Damage Loc.(L)																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																									
												1-10 MD	10-25 D(L)	10-25 SD(G)																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																					
															0-1 ND	1999 Quantity	2009 Quantity																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																		
101	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																

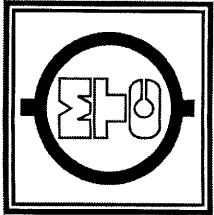


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 9
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Main Horse Barn
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type			% Damage			Quantity	Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)	Damage	10-25 D(L)	10-25 SD(G)			
101	4/2/2009	1	Window Caulk	Chrysotile	5%	NF	M			G	D		720 Lin. Ft.	720 Lin. Ft.	Concrete Floor - Brick Walls - Assumed - White and Tan Paint
102	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---			---	---		---	---	No Asbestos Detected - Concrete Floor - Tan Paint, Plaster Ceiling
103	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---			---	---		---	---	No Asbestos Detected - Tan and White Paint - Single-Ply Roof - Concrete Floor and Walls
201	4/2/2009	2	Transite Panels - Corrugated	Chrysotile	30%	NF	M			G	D		360 Sq. Ft.	360 Sq. Ft.	

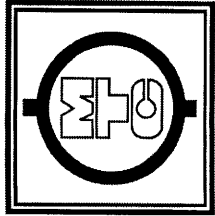


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 10
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: South Riding Arena
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) Loc.(L) 10-25 SD(G) >25 SD	% Damage		Remarks
									0-1 ND	1-10 MD	
101	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	Metal Walls - White Paint - Brick and Concrete Floor

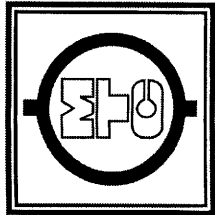

**Materials
Testing
Consultants, INC.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563

Building No.: 11


Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center

Building: Grand Champion Barn

Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage			1999 Quantity	2009 Quantity	Remarks
									0-1 ND	1-10 MD	10-25 D(L)			
101	4/3/2009	1	Roof Shingles - Green	None Detected	---	NF	M	---	---	---	---	1664 Sq. Ft.	1664 Sq. Ft.	No Walls - Concrete - Wood Roof

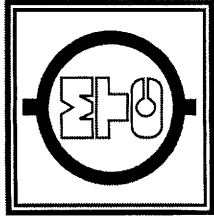


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 12
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Mult-Livestock Barn
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage				Remarks
								0-1 ND	1-10 MD	10-25 D(L)	>25 SD	
101	4/3/2002	1	12" x 12" Floor Tile - Tan, Brown and Cream Mottling	None Detected	---	NF	M	---	---	289 Sq. Ft.	289 Sq. Ft.	White Paint - Block Walls - Concrete Under Carpet
101	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	1715 Sq. Ft.	1715 Sq. Ft.	
101	4/3/2002	3	2' x 2' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	100 Sq. Ft.	100 Sq. Ft.	
101	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	74 Sq. Ft.	74 Sq. Ft.	
102	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	120 Sq. Ft.	120 Sq. Ft.	Concrete Under Carpet - Block Walls
102	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	44 Sq. Ft.	44 Sq. Ft.	White Paint
103	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	276 Sq. Ft.	276 Sq. Ft.	White Paint - Pink Paint - Block Walls
103	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	70 Sq. Ft.	70 Sq. Ft.	Concrete Under Carpet
104	4/3/2002	1	12" x 12" Floor Tile - Tan, Brown and Cream Mottling	None Detected	---	NF	M	---	---	36 Sq. Ft.	36 Sq. Ft.	Block Walls - White and Pink Paint
104	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	28 Sq. Ft.	36 Sq. Ft.	
104	4/3/2002	3	2' x 2' Ceiling Tile - White - Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	8 Sq. Ft.	0 Sq. Ft.	
104	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	24 Sq. Ft.	24 Sq. Ft.	

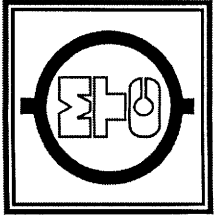


Materials Testing Consultants, Inc.
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 12
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Mult-Livestock Barn
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD			
105	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	---	60 Sq. Ft.	60 Sq. Ft.	White and Yellow Paint - Block Walls
105	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	32 Sq. Ft.	32 Sq. Ft.	
106	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	---	64 Sq. Ft.	64 Sq. Ft.	Block Walls - Concrete Floor
106	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	32 Sq. Ft.	32 Sq. Ft.	White and Yellow Paint
107	4/3/2002	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Metal Deck - Block Walls - Concrete Floor
108	4/3/2002	1	12" x 12" Floor Tile - Tan, Brown and Cream Mottling	None Detected	---	NF	M	---	---	---	149 Sq. Ft.	149 Sq. Ft.	Block Walls - Cream Paint
108	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	---	149 Sq. Ft.	149 Sq. Ft.	
108	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	48 Sq. Ft.	48 Sq. Ft.	
109	4/3/2002	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Metal Deck - Concrete Floor
110	4/3/2002	1	12" x 12" Floor Tile - Tan, Brown and Cream Mottling	None Detected	---	NF	M	---	---	---	114 Sq. Ft.	114 Sq. Ft.	Cream Paint
110	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	---	114 Sq. Ft.	114 Sq. Ft.	Block Walls
110	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	42 Sq. Ft.	42 Sq. Ft.	

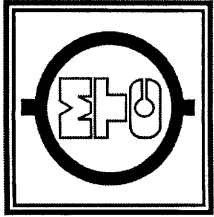


**Materials
Testing
Consultants, INC.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 12
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Mult-Livestock Barn
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD			
111	4/3/2002	1	12" x 12" Floor Tile - Tan, Brown and Cream Mottling	None Detected	---	NF	M	---	---	---	60 Sq. Ft.	60 Sq. Ft.	Cream Paint - Block Walls
111	4/3/2002	2	2' x 2' Ceiling Tile - White - Random Large and Small Holes	None Detected	---	F	M	---	---	---	60 Sq. Ft.	60 Sq. Ft.	
111	4/3/2002	4	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	40 Sq. Ft.	40 Sq. Ft.	
112	4/3/2002	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Metal Deck - Grey Paint - Concrete Floor - Block and Metal Walls
113	4/3/2002	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block and Metal Walls - Concrete Floor - White and Grey Paint

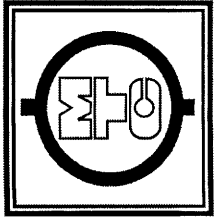


Materials Testing Consultants, Inc.
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 13
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Whitehall
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S)	Therm.(T)	Misc.(M)	Damage Loc.(L)	Gen.(G)	10-25 SD(G)			
101	4/2/2009	1	Plaster	None Detected	---	NF	S	---	---	---	---	---	NQ	NQ	Not Quantified - Concrete Under Wood Floor - Brick Walls - White Paint
101	4/2/2009	3	Roofing Material	Chrysotile	10%	NF	M	---	---	G	SD	---	Sq. Ft.	Sq. Ft.	Not Quantified - The roof has collapsed in areas and some asbestos roofing is now in the building
102	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Brick And Wood Walls - Blue paint
103	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls and Ceiling - Concrete Floor
104	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Grey Paint - Wood Walls and Ceiling
105	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Grey Paint - Wood Walls and Ceiling
201	4/2/2009	2	Window Caulk	None Detected	---	NF	M	---	---	---	---	---	3520 Lin. Ft.	3520 Lin. Ft.	
301	4/2/2009	3	Roofing Material	Chrysotile	10%	NF	M	---	---	---	---	---	12480 Sq. Ft.	12480 Sq. Ft.	The roof has caved in in some areas and some asbestos roofing is scattered inside

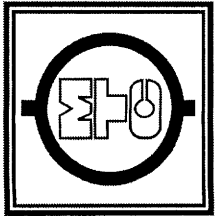


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 14
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Volunteer Headquarters
 Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L)			
101	4/2/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	Chrysotile	45%	F	T	L	D	D	4 Joints	4 Joints	Grey Paint - Concrete Floor, Patch and Repair
101	4/2/2009	2	Aircell Pipe Insulation	Chrysotile	40%	F	T	L	D	D	17 Lin. Ft.	17 Lin. Ft.	Patch and Repair
101	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	20%	F	T	L	D	D	5 Joints	5 Joints	Patch and Repair
102	4/2/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	Chrysotile	45%	F	T	---	---	---	4 Joints	4 Joints	White Paint and Green - Above Ceiling
102	4/2/2009	5	12" x 12" Ceiling Tile - White - Random Pinholes - Nailed On	None Detected	---	F	M	---	---	---	85 Sq. Ft.	85 Sq. Ft.	Ceramic Tile Floor
102	4/2/2009	6	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - Walls
102	4/2/2009	10	2' x 4' Ceiling Tile, White	None Detected	---	F	M	---	---	---	Sq. Ft.	85 Sq. Ft.	
103	4/2/2009	2	Aircell Pipe Insulation	Chrysotile	40%	F	T	G	ND	ND	4 Lin. Ft.	4 Lin. Ft.	Above Ceiling
103	4/2/2009	6	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - Walls and Ceiling - Green Paint
103	4/2/2009	7	9" x 9" Floor Tile - Tan with White and Brown Streaks	Chrysotile	1 - 2%	NF	M	---	---	---	23 Sq. Ft.	0 Sq. Ft.	
103	4/2/2009	8	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	20 Sq. Ft.	20 Sq. Ft.	
104	4/2/2009	2	Aircell Pipe Insulation	Chrysotile	40%	F	T	G	ND	ND	10 Lin. Ft.	10 Lin. Ft.	Above Ceiling

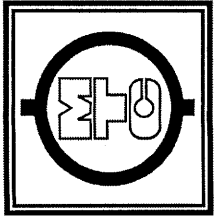


**Materials
Testing
Consultants, Inc.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 14
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Volunteer Headquarters
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD			
104	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	20%	F	T	G	ND		2 Joints	2 Joints	Above Ceiling
104	4/2/2009	6	Plaster	None Detected	---	NF	S	---	---		NQ	NQ	Not Quantified - Four Walls and Ceiling
104	4/2/2009	7	9" x 9" Floor Tile - Tan with White and Brown Streaks	Chrysotile	1 - 2%	NF	M	G	D		100 Sq. Ft.	100 Sq. Ft.	
104	4/2/2009	8	4" Brown Cove Base	None Detected	---	NF	M	---	---		40 Sq. Ft.	40 Sq. Ft.	
105	4/2/2009	1	Mud Compound Joint and Fitting Insulation on Glass Domestic Water Lines	Chrysotile	45%	F	T	G	ND		5 Joints	5 Joints	
105	4/2/2009	5	12" x 12" Ceiling Tile - White - Random Pinholes - Nailed On	None Detected	---	F	M	---	---		100 Sq. Ft.	100 Sq. Ft.	Ceramic Tile Floor
105	4/2/2009	6	Plaster	None Detected	---	NF	S	---	---		NQ	NQ	Not Quantified - Walls
105	4/2/2009	10	2' x 4' Ceiling Tile, White	None Detected	-----	F	M	---	---		Sq. Ft.	100 Sq. Ft.	
106	4/2/2009	2	Aircell Pipe Insulation	Chrysotile	40%	F	T	G	ND		101 Lin. Ft.	101 Lin. Ft.	
106	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	20%	F	T	G	ND		10 Joints	10 Joints	
106	4/2/2009	4	12" x 12" Ceiling Tile - White - Uniformed Pencil Holes - Glued On	None Detected	---	F	M	---	---		1659 Sq. Ft.	1659 Sq. Ft.	Wood Walls - Concrete Floor
106	4/2/2009	10	2' x 4' Ceiling Tile, White	None Detected	-----	F	M	---	---		Sq. Ft.	1659 Sq. Ft.	

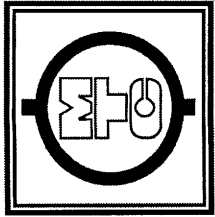


Materials Testing Consultants, Inc.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
 Building No.: 14
 Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
 Building: Volunteer Headquarters
 Date: 16-May-09

Building Survey Summary

Function Area No.	Inspection Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-friable	Type Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	% Damage			1999 Quantity	2009 Quantity	Remarks
									0-1 ND	1-10 MD	>25 SD			
107	4/2/2009	6	Plaster	None Detected	---	NF	S	---	---	---	---	NQ	NQ	Not Quantified - Four Walls and Ceiling
107	4/2/2009	7	9" x 9" Floor Tile - Tan with White and Brown Streaks	Chrysotile	1 - 2%	NF	M	---	---	---	---	11 Sq. Ft.	0 Sq. Ft.	
107	4/2/2009	8	4" Brown Cove Base	None Detected	---	NF	M	---	---	---	---	6 Sq. Ft.	0 Sq. Ft.	
108	4/2/2009	2	Aircell Pipe Insulation	Chrysotile	40%	F	T	---	---	---	---	23 Lin. Ft.	0 Lin. Ft.	Tan Paint - Concrete Under Carpet
108	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Aircell Pipe Insulation	Chrysotile	20%	F	T	---	---	---	---	2 Joints	0 Joints	Wood Walls
108	4/2/2009	6	Plaster	None Detected	---	NF	S	---	---	---	---	NQ	NQ	Not Quantified - Two Walls
201	4/2/2009	9	Roofing Materials	Assumed	---	NF	M	---	---	---	---	2625 Sq. Ft.	2625 Sq. Ft.	Assumed - No Access

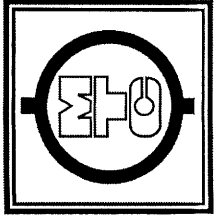


**Materials
Testing
Consultants, Inc.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 15
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Band Shell
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD			
101	4/2/2009	1	4" Black Cove Base	None Detected	---	NF	M	---	---	---	72 Lin. Ft.	72 Lin. Ft.	White Paint - Concrete Under Carpet
101	4/2/2009	2	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	---	288 Sq. Ft.	288 Sq. Ft.	Wood Walls - Metal Deck Above Ceiling
102	4/2/2009	1	4" Black Cove Base	None Detected	---	NF	M	---	---	---	48 Lin. Ft.	48 Lin. Ft.	White Paint - Concrete Under Carpet - Wood Walls and Ceiling
103	4/2/2009	3	3" Brown Cove Base	None Detected	---	NF	M	---	---	---	46 Sq. Ft.	46 Sq. Ft.	Concrete Under Carpet - Wood Walls - Wood Ceiling Above Ceiling Tile
103	4/2/2009	4	2' x 4' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	---	132 Sq. Ft.	132 Sq. Ft.	
104	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - Wood Walls - Grey and Tan Paint
105	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor and Wood Walls and Ceiling - Tan and Grey Paint
106	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls - Concrete Floor
107	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls - Concrete Floor
108	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls - Concrete Floor
109	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls - Concrete Floor
110	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls - Concrete Floor - Tan and Grey Paint

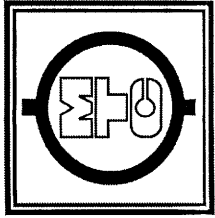


**Materials
Testing
Consultants, Inc.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 15
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Band Shell
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type		Damage Loc.(L) Gen.(G)	% Damage			1999 Quantity	2009 Quantity	Remarks
							Surf.(S) Therm.(T) Misc.(M)	Damage 10-25 D(L) 10-25 SD(G) >25 SD		0-1 ND	1-10 MD				
111	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	Wood Walls and Ceiling - Concrete Floor
112	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey Paint - Wood Walls and Ceiling - Concrete Floor
113	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and Tan Paint - Concrete Floor - Wood Walls and Ceiling
114	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls and Ceiling - Concrete Floor - Grey and White Paint
115	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls and Ceiling - Grey and White Paint
116	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Concrete Floor - White and Grey Paint - Wood Walls and Ceiling
117	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Wood Walls and Ceiling - Concrete Floor - Grey and White Paint
118	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and White Paint - Concrete Floor - Wood Walls and Ceiling
119	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and White Paint - Concrete Floor - Wood Walls and Ceiling
120	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and White Paint - Concrete Floor - Wood Walls and Ceiling
121	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and White Paint - Concrete Floor - Wood Walls and Ceiling
122	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and White Paint - Concrete Floor - Wood Walls and Ceiling

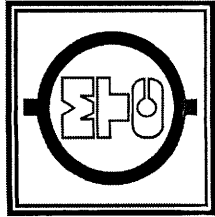


**Materials
Testing
Consultants, INC.**

693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 15
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Band Shell
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			Damage Loc.(L) Gen.(G)	% Damage			Remarks
							Surf.(S) Therm.(T) Misc.(M)	10-25 D(L) 10-25 SD(G) >25 SD	0-1 ND 1-10 MD		1999 Quantity	2009 Quantity		
123	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Grey and White Paint - Concrete Floor - Wood Walls and Ceiling
201	4/2/2009	5	Roof Flashing	None Detected	---	NF	M	---	---	NQ	NQ	NQ	NQ	Not Quantified
201	4/2/2009	6	Roof Shingles	None Detected	---	NF	M	---	---	NQ	NQ	NQ	NQ	Not Quantified
201	4/2/2009	7	Roofing Tar Paper	Chrysotile	60%	NF	M	G	D	7088 Sq. Ft.	7088 Sq. Ft.	7088 Sq. Ft.	7088 Sq. Ft.	Some material has fallen off onto the ground

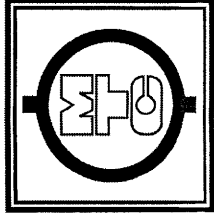


Materials Testing Consultants, INC.
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 16
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Dodge Pavilion
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type			% Damage			1999 Quantity	2009 Quantity	Remarks
							Friable Surf.(S) Therm.(T) Misc.(M)	Damage Loc.(L) Gen.(G)	Damage Loc.(L) Gen.(G)	0-1 ND	1-10 MD	10-25 D(L) 10-25 SD(G) >25 SD			
101	4/2/2009	1	12" x 12" Ceiling Tile - White - Glued-On - Lateral Grooves and Pinholes	Chrysotile	3%	F	M	G	G	ND	ND	ND	2310 Sq. Ft.	2310 Sq. Ft.	Windows for Walls - White Paint - Terrazzo Floor
102	4/2/2009	2	Woolfelt Pipe Insulation on Domestic Water Lines	Chrysotile	40%	F	T	G	G	ND	ND	ND	44 Lin. Ft.	44 Lin. Ft.	White Paint - 14 Assumed in Wall - Ceramic Tile Floor - Block Walls
102	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation on Domestic Water Lines	Chrysotile	30%	F	T	G	G	ND	ND	ND	10 Joints	13 Joints	Three Joints in Wall
103	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Ceramic Tile Floor
104	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---	---	---	---	---	---	No Asbestos Detected - Block Walls - Ceramic Tile Floor
105	4/2/2009	2	Woolfelt Pipe Insulation on Domestic Water Lines	Chrysotile	40%	F	T	G	G	ND	ND	ND	124 Lin. Ft.	124 Lin. Ft.	Concrete Floor - White Paint - Block Walls
105	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation on Domestic Water Lines	Chrysotile	30%	F	T	G	G	ND	ND	ND	25 Joints	25 Joints	
106	4/2/2009	1	12" x 12" Ceiling Tile - White - Glued-On - Lateral Grooves and Pinholes	Chrysotile	3%	F	M	G	G	ND	ND	ND	702 Sq. Ft.	702 Sq. Ft.	Terrazzo Floor - Block Walls - White Paint
106	4/2/2009	4	Drywall	None Detected	---	NF	M	---	---	---	---	---	NQ	NQ	Not Quantified
107	4/2/2009	1	12" x 12" Ceiling Tile - White - Glued-On - Lateral Grooves and Pinholes	Chrysotile	3%	F	M	L	L	SD	SD	SD	371 Sq. Ft.	371 Sq. Ft.	Block Walls - White Paint - Terrazzo Floor - Ceiling Tile on Floor
108	4/2/2009	2	Woolfelt Pipe Insulation on Domestic Water Lines	Chrysotile	40%	F	T	G	G	SD	SD	SD	85 Lin. Ft.	85 Lin. Ft.	Concrete Floor and Deck - DO NOT ENTER - DEBRIS ON FLOOR
108	4/2/2009	3	Mud Compound Joint and Fitting Insulation on Woolfelt Pipe Insulation on Domestic Water Lines	Chrysotile	30%	F	T	G	G	SD	SD	SD	15 Joints	15 Joints	Debris on Floor

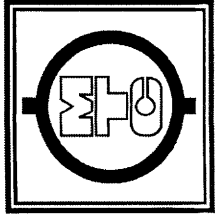


Materials Testing Consultants, INC.
 693 Plymouth NE • Grand Rapids, MI 49505
 (616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 16
Project: Updated Survey of Asbestos and Limited Lead Based Paint for Michigan State Fairgrounds & Exhibition Center
Building: Dodge Pavilion
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L)			
108	4/2/2009	5	Magnesium Silicate Pipe Insulation on Heat Exchanger	Chrysotile Amosite	35% 5%	F	T	G	SD		32 Lin. Ft.	32 Lin. Ft.	
108	4/2/2009	6	Magnesium Silicate Pipe Insulation on Heating Lines	Chrysotile Amosite	40% 5%	F	T	G	SD		20 Lin. Ft.	20 Lin. Ft.	Debris on Floor - Badly Damaged
108	4/2/2009	7	Mud Compound Joint and Fitting Insulation on Magnesium Silicate Pipe Heating Lines	Chrysotile	40%	F	T	G	SD		16 Joints	16 Joints	Debris on Floor
108	4/2/2009	8	Magnesium Silicate Pipe Insulation on Duct Insulation	Amosite	30%	F	T	G	SD		32 Sq. Ft.	32 Sq. Ft.	
108	4/2/2009	9	Fire Door	Assumed	---	NF	M	G	D		1 Door(s)	1 Door(s)	
108	4/2/2009	10	Boiler Materials	Chrysotile	80%	NF	M	G	SD		30 Lin. Ft.	30 Lin. Ft.	
109	4/2/2009	0	No Suspect Asbestos Containing Materials Found In This Area	---	---	---	---	---	---		---	---	No Asbestos Detected - Concrete Floor
110	4/2/2009	11	9" x 9" Floor Tile - Grey with Black and White Streaks	Chrysotile	3%	NF	M	G	D		54 Sq. Ft.	54 Sq. Ft.	Wood Paneling On Walls and Ceiling - Water Damaged
110	4/2/2009	12	9" x 9" Floor Tile - Red with White Streaks	Chrysotile	5%	NF	M	G	D		27 Sq. Ft.	27 Sq. Ft.	Water Damaged

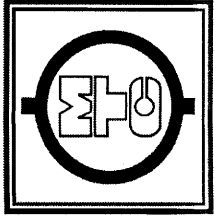

**Materials
Testing
Consultants, Inc.**
693 Plymouth NE • Grand Rapids, MI 49505
(616) 456-5469 • FAX (616) 456-5784

Job No.: 081563
Building No.: 17
Project: Updated Survey of Asbestos and Limited Lead Based Paint for
Michigan State Fairgrounds & Exhibition Center
Building: Grants House
Date: 16-May-09

Building Survey Summary

Func- tion Area No.	Inspec- tion Date	HA No.	Description	Asbestos Type	Asbestos Percent	Friable Non-fri- able	Type Surf.(S) Therm.(T) Misc.(M)	% Damage			1999 Quantity	2009 Quantity	Remarks
								0-1 ND	1-10 MD	10-25 D(L)			
								Loc.(L)	10-25 SD(G)	>25 SD			
101	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - Wood Walls - Plaster Ceiling
101	4/3/2009	2	12" x 12" Floor Tile - Off- White - Octagon Pattern	Chrysotile	3%	NF	M	G	ND		72 Sq. Ft.	72 Sq. Ft.	Under New Floor Tile
101	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified
101	4/3/2009	5	12" x 12" Floor Tile with Blue Marbling	None Detected	---	NF	M	---	---	---	Sq. Ft.	72 Sq. Ft.	
102	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - Plaster Walls and Ceiling - Wood Floor - Blue and Grey Paint
103	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - Wood Floor Under Carpet - Plaster Walls and Ceiling
103	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified
103	4/3/2009	5	12" x 12" Floor Tile with Blue Marbling	None Detected	---	NF	M	---	---	---	Sq. Ft.	51 Sq. Ft.	
104	4/3/2009	3	2' x 2' Ceiling Tile - White with Lateral Grooves and Random Pinholes	None Detected	---	F	M	---	---	---	51 Sq. Ft.	51 Sq. Ft.	Wood Floors and Walls
105	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - White Paint - Wood Walls and Ceiling
106	4/3/2009	1	Plaster	None Detected	---	NF	S	---	---	---	NQ	NQ	Not Quantified - Wood Floor Under Carpet - Plaster Walls and Ceiling
106	4/3/2009	4	Drywall	None Detected	---	NF	M	---	---	---	NQ	NQ	Not Quantified