Appendix B: Facility Conditions Index Report

DRAFT

Combined Condition Assessment

Jessie Loomis School

2001 Limerick Street, Saginaw, Michigan

February 2017

DTMB Technology, Management & Budget
State Facilities Administration

SRO
STATE SCHOOL REFORM/REDESIGN OFFICE
Michigan Department of Technology, Management and Budget

LARA
LICENSING AND REGULATORY AFFAIRS
CUSTOMER DRIVEN. BUSINESS MINDED
Bureau of Construction Codes

DRAFT

Executive Summary

This Combined Condition Assessment is the product of a collaborative site assessment and survey by the Department of Technology Management and Budget, State Facilities Administration (SFA) and the Department of Licensing and Regulatory Affairs (LARA) Bureau of Construction Codes at the request of the State School Reform/Redesign Office (SRO).

It has been designed to provide a general condition overview of the facility and major site assets. A team visits the site and collects data to determine two factors in eight facilities categories:

Factors:

- ***Remaining Service Life*** of Facility Elements or Systems which is then utilized to calculate an ***Age-Based Condition Index***.
- ***Operating Condition*** based upon visual observations the day of the visit along with supporting information/records provided by staff or contact personnel.
- Results of the two factors above are averaged/combined to produce a single ***Combined Condition Score (CCS)*** for the site.

Facilities Categories:

- Structure – Foundation, Parking Lots, Sidewalks, Access
- Exterior – Walls, Windows, Stairways, Doors
- Roofing – Roofing Type and Condition
- HVAC – Air Handlers, Boilers, Chillers, Gas Piping, Cooling Towers, Pumps, Exhaust, etc.
- Electrical – Service & Distribution, Lighting, Emergency Generator, Fire Alarm, Kitchen
- Plumbing – Restrooms, Backflow, Domestic Water/Heating, Distribution, Fire System
- Conveying – Elevators, Lifts
- Interior Construction – Doors, Stairways, Walls, Ceilings, Flooring

Results:

The Jessie Loomis School assessment was performed on ***February 21, 2017*** by the SFA team and resulted in a ***CCS*** of: **78.5**

DRAFT

Combined Condition Score (CCS)

There are many ways to measure physical condition of a facility. Performing full, detailed assessments necessary to calculate a Facility Condition Index (FCI), Extended Facility Condition Index (EFCI) or Facilities Needs Index (FNI) are very demanding in terms of input resources up front. This project required an efficient, lean approach whereby an assessment team could move through occupied space quickly with minimal disruption while collecting data. The output needed to be measurable and consistent. While additional information such as annual

reinvestment rates and replacement costs may also be desirable, these were outside the scope of this first visit.

The DTMB State Facilities Administration (SFA), Building Operations Division assesses buildings within their own portfolio for capital planning purposes. These assessments may be age-based, where the age of building elements or assets are compared to their respective design-life; or observed-condition-based where defects and site conditions are observed and rated.

The Combined Condition Score is a combination of both the age-based condition index and observed condition, equally weighted and averaged together resulting in a number between 0 and 100. This number will be indicative of overall facility condition and can be used to order facilities by respective condition relative to others.

- A score of 100 indicates a brand new, unoccupied facility with no construction defects and no code violations.
- A score of 0 indicates a very old facility with no usable architectural elements or attached assets.
- Realistically speaking, all occupied buildings will score more than zero and less than 100.
- The lower the score, the less cost effective to operate the building. A good rule-of-thumb is when the score falls below 34, equivalent annual cost to replace a facility will be less than continuing to operate and maintain the existing facility.

Building Exterior

DRAFT

DRAFT

Site Narrative

The assessment team completed the site visit/inspection on February 21, 2017. The Team reviewed the exterior of the building including roofing, exterior walls, generator and outdoor mechanicals. The team then moved inside and reviewed interior finishes and mechanicals including but not limited to, walls and ceilings, foundations, boiler heating, plumbing, HVAC systems, electrical and elevator systems in the building. The following was validated/noted during the inspection with site personnel:

- The site was originally constructed in 2006.
- The exterior is brick with a 2006 white membrane roof system.
- The building has an elevator.
- All areas reviewed were well maintained and in overall good condition.

The full Combined Condition Assessment is as follows:

BUILDING NAME: Jessie Loomis School | BUILT: 6/1/2006 | ASSESSMENT DATE: 2/21/2017

CATEGORY	SUB-CATEGORY	TYPE	INSTALLED DATE	(YEARS) SERVICE LIFE	AGE	REMAINING SERVICE LIFE	AGE-BASED CONDITION INDEX	INSPECTED OPERATING CONDITION	COMMENTS
STRUCTURE						27.6	76.1	75.0	
	FOUNDATION		6/1/2006	75.0	10.7	64.3	98.0	75.0	
	PARKING LOTS		6/1/2006	15.0	10.7	4.3	48.9	75.0	
	PEDESTRIAN PAVING		6/1/2006	25.0	10.7	14.3	81.6	75.0	
EXTERIOR						41.8	93.4	75.0	
	WALLS		6/1/2006	70.0	10.7	59.3	97.7	75.0	
	WINDOWS		6/1/2006	30.0	10.7	19.3	87.2	75.0	
	STAIRWAYS		6/1/2006	75.0	10.7	64.3	98.0	75.0	
	DOORS		6/1/2006	35.0	10.7	24.3	90.6	75.0	
ROOF						9.3	71.2	75.0	
	ROOF COVERING		6/1/2006	20.0	10.7	9.3	71.2	75.0	
HVAC						18.6	79.9	75.0	
	AIR HANDLING UNITS		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	BOILERS		6/1/2006	30.0	10.7	19.3	87.2	75.0	
	CHILLERS		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	GAS PIPING SYSTEMS		6/1/2006	75.0	10.7	64.3	98.0	75.0	
	COOLING TOWERS								
	PUMPS		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	EXHAUST SYSTEMS		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	WALK IN FREEZERS		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	VENT AND POOL HEATERS								
	COOLING PIPING		6/1/2006	75.0	10.7	64.3	98.0	75.0	
ELECTRICAL						14.3	77.9	75.0	
	ELECTRICAL SERVICE/DISTRIBUTION		6/1/2006	50.0	10.7	39.3	95.4	75.0	
	LIGHTING		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	EMERGENCY GENERATOR		6/1/2006	30.0	10.7	19.3	87.2	75.0	
	KITCHEN EQUIPMENT		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	INTERCOM / PA EQUIPMENT		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	FIRE ALARM SYSTEM		6/1/2006	20.0	10.7	9.3	71.2	75.0	
PLUMBING						19.3	72.6	75.0	
	RESTROOMS		6/1/2006	30.0	10.7	19.3	87.2	75.0	
	BACKFLOW PREVENTERS		6/1/2006	10.0	10.7	-0.7	0.0	75.0	
	GENERAL		6/1/2006	35.0	10.7	24.3	90.6	75.0	
	FOOD SERVICE		6/1/2006	35.0	10.7	24.3	90.6	75.0	
	DOMESTIC WATER HEATING		6/1/2006	15.0	10.7	4.3	48.9	75.0	
	WATER DISTRIBUTION		6/1/2006	75.0	10.7	64.3	98.0	75.0	
	FIRE SUPPRESSION		6/1/2006	40.0	10.7	29.3	92.8	75.0	
CONVEYING						14.3	81.6	75.0	
	ELEVATORS		6/1/2006	25.0	10.7	14.3	81.6	75.0	
INTERIOR CONSTRUCTION						36.3	90.6	75.0	
	DOORS		6/1/2006	40.0	10.7	29.3	92.8	75.0	
	STAIRWAYS		6/1/2006	50.0	10.7	39.3	95.4	75.0	
	WALLS		6/1/2006	75.0	10.7	64.3	98.0	75.0	
	CEILINGS		6/1/2006	20.0	10.7	9.3	71.2	75.0	
	FLOORS		6/1/2006	50.0	10.7	39.3	95.4	75.0	

BUILDING EXTERIOR FT^2
57,287

AVERAGE					COMBINED CONDITION SCORE
SERVICE LIFE	AGE	REMAINING SERVICE LIFE	CONDITION INDEX	OBSERVED CONDITION	
36.7	10.7	22.7	82.1	75.0	78.5

DRAFT

Exterior

Exterior

Exterior

Exterior

Computer Classroom

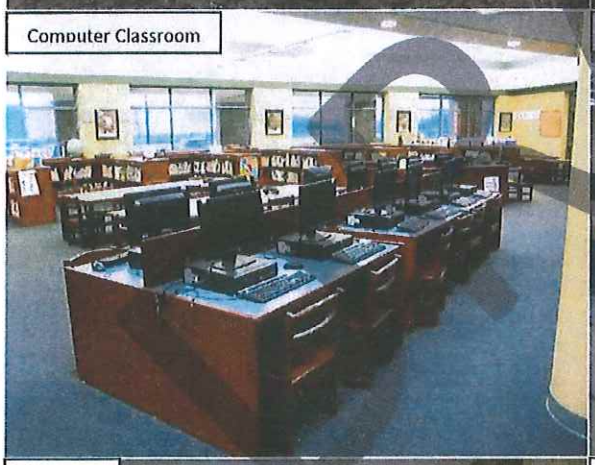

Gymnasium

Hallway

Classroom

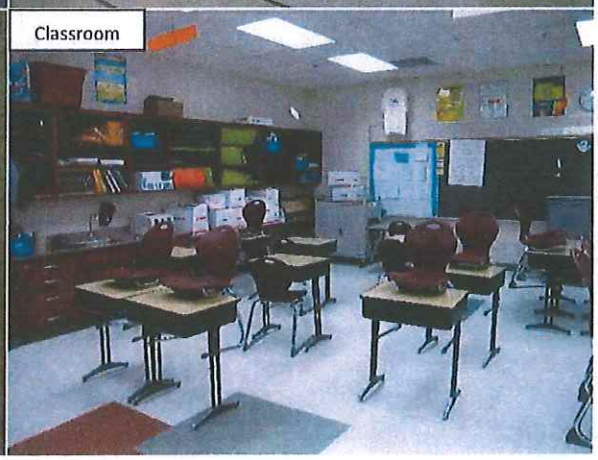

Restroom

Restroom

Playground

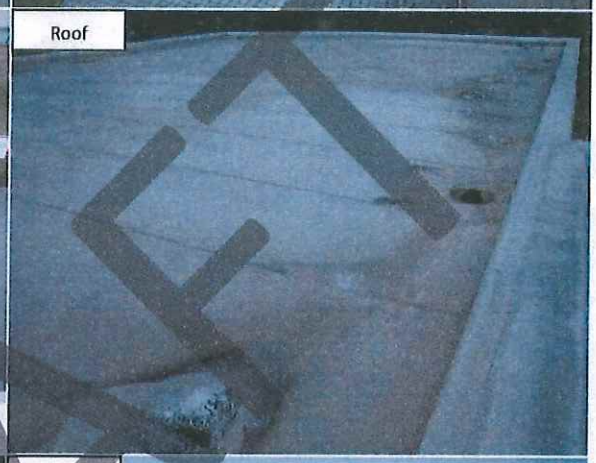
Roof

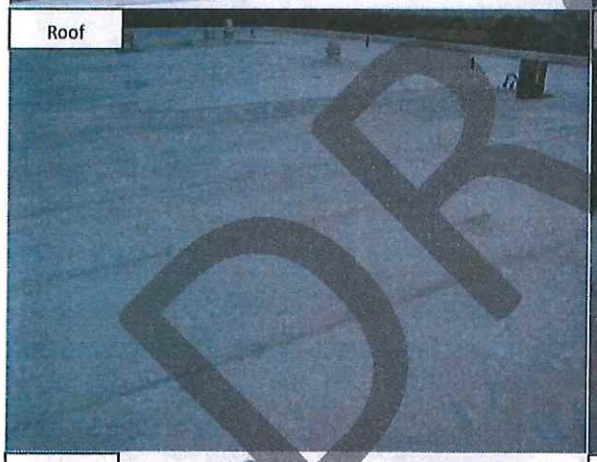
Roof

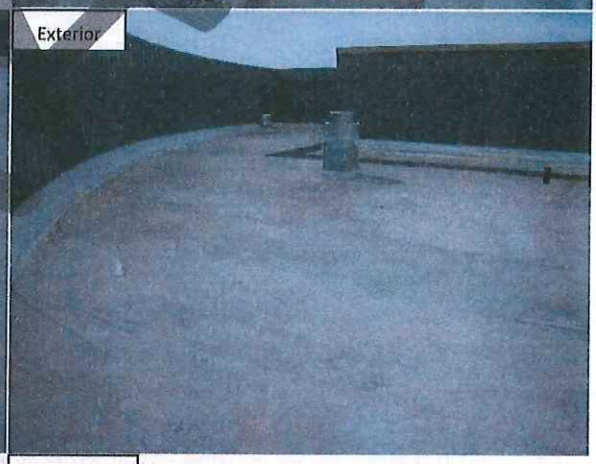
Exterior

Chiller

Generator

DRAFT

Pumps

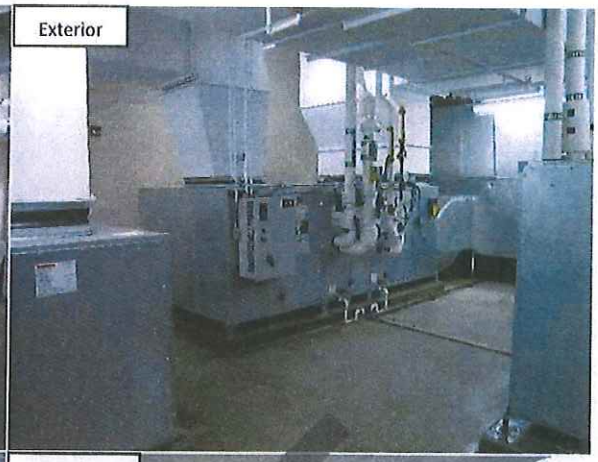
Exterior

AHU

Classroom

Classroom

Pumps

Motor Control Center

Boilers

Piping

Water Heaters

Ceiling

Elevator

Kitchen

Walk in Freezer

Kitchen

Dining

Door

Hallway

Lobby

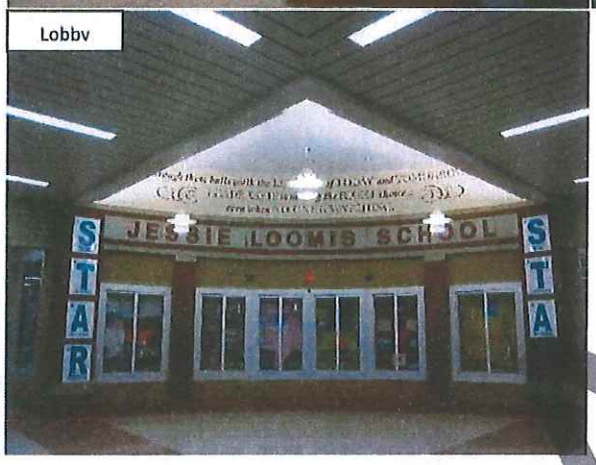

DRAFT

BUILDING

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYORS

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
Civil							
	Perimeter Fencing		3				
	Paving Parking Lot (Asphalt / Concrete)		3				
	Curbing		3				
	On-Site Signage		3				
	Pedestrian Access (Michigan Barrier Free & Safety)		3				
Site Facilities							
	Loading Dock		3				
Michigan barrier free Compliance							
	Handicap Parking		3				
	Accessible Entry		3				
	Exterior Ramps and walks		3				
	Barrier free route (ROW - Sidewalk to Bldg. Entry)		3				
	Building Entry		3				
Foundation/Footings							
	Structure		3				
Columns/Beams/Walls							
	Structure		3				
	Applied Fireproofing Systems					N/A	
Roofing							
	Roof Openings (Skylights)					N/A	
	Roof Openings (Access)		3				
	Roof Equipment Curbing		3				
	Leakage		3				
	Ponding Water		3				
	Roof Drains		3				
	Gutters / Downspouts		3				
Exterior Walls							
	Exterior Finish		3				

DRAFT

BUILDING

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYORS

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
	Expansion / Control Joints		3				
	Thermal Condition		3				
	Soffits					N/A	
	General Appearance		3				
Doors / Windows / Louvers							
	Windows		3				
	Louvers and Vents					N/A	
	Main Entry Doors		3				
	Main Entry Hardware		3				
	Other Exterior Doors		3				
	Other Exterior Door Hardware		3				
General							
	Wall Finishes (Classrooms)		3				
	Wall Finishes (Corridors)		3				
	Wall Finishes (Restrooms)		3				
	Wall Finishes (Others)		3				
	Ceilings		3				
	Cabinetry					N/A	
	Moveable / Operable Walls		3				
Interior Doors							
	Door & Frame Condition		3				
	Hardware Condition		3				
	Hallway Fire Door					N/A	
	Cafe / Concession Security Gates / Roll-up Doors					N/A	
Flooring							
	ACT					N/A	
	Drywall					N/A	
	Other					N/A	
	Carpet		3				

DRAFT

BUILDING

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYORS

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
	VCT		3				
	Tile		3				
	Terrazzo		3				
	Wood					N/A	
	Sealed Concrete					N/A	
Stairs							
	Landing finish		3				
	Stair treads		3				
	Stair nosings		3				
	Handrails		3				
Toilet Rooms							
	Flooring		3				
	Walls		3				
	Signage		3				

***Any violations reported in this school assessment were not given to the facility as violations to be corrected in order to maintain the certificate of occupancy for the facility. Any violations reported in this school assessment were not cited as part of a school safety inspection, they are strictly for the use of the assessment report.

DRAFT

MECHANICAL

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
Gas System							
	Piping		3				
	Other (Vented Interior Regulators)		3				
	Gas PRV (Proximity to OA intakes)		3				
	Science Classroom Emergency Off Switch		3				
Cooling Plant							
	Distribution Piping (2 pipe or 4-pipe)		3				
	Chillers (Age, Refrigerant, Heat Rejection Method)		3				
	Cooling Towers (Age, Materials, VFD, Sufficiency)					N/A	
	CHW Pump Volute Insulation type (foamglass, Armaflex, phenolic foam, fiberglass, mineral wool)		3				
	Plant Piping & Valves (Corroded/Isolation valves)		3				
	Chilled Water Pipe Insulation & Jacket (Foamglass Armaflex		3				
	Campus Piping & Valves (Corroded/Isolation valves)		3				
	Refrigeration Room Monitoring and Ventilation		3				
Heating Plant							
	Boilers (Age, Fuel Type, Input/Output)		3				
	Pumps (VFD / Sound / Suction Pressure)		3				
	Plant Piping & Valves (Corroded/Isolation valves)		3				
	Campus Piping & Valves (Corroded/Isolation valves)		3				
	Boiler Room E-Stop		3				
Dedicated Airside Heating Systems							
	Heating-Only Air Handling Units (Age)					N/A	
	Duct Furnaces (Fuel, Type, Age, Mission)					N/A	
	Unit Heaters (Fuel, Type, Age, Mission)					N/A	
	Heating-Only Unit Ventilators (year, condition)					N/A	
Air Distribution							
	Outside Air Units (Age, HR Type, ERV, Unitary, VAV)					N/A	
	Rooftop ACUs (Age, Gas Heat or Heat Pump)		3				

DRAFT

MECHANICAL

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

			4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
	Central Station AHUs (Age, Type/Geometry, VAV, typ. SAT dual path unit)			3				
	Terminal Units (VAV, VAV/reheat, Heat source, Close- off VAV, SFPU, PFPU)						N/A	
Exhaust Systems								
	Restrooms			3				
	Locker Rooms			3				
	Kitchen	Hood Systems (Grease or Heat only, Ansul system, Heat sensor start)					N/A	
		Exhaust Fan Outlet height (Is it <40")					N/A	
	Science	Room Emergency Exhaust (Operation)					N/A	
		Fume Exhaust (Latest year certified, sash height, manifolded, VAV, fan location)					N/A	
		Stack outlet height (is it <10')					N/A	
	Art Kiln	Exhaust Fan / Exhaust Hood					N/A	
Refrigeration Systems								
	Freezer Systems (Age, Location, Refrigerant)			3				
	Cooler Systems (Age, Location, Refrigerant)			3				
Indoor Swimming Pool Systems								
	Vent and Pool Heater						N/A	
Fire Alarm System and Fire Suppression								
	Fire suppression			3				

***Any violations reported in this school assessment were not given to the facility as violations to be corrected in order to maintain the certificate of occupancy for the facility. Any violations reported in this school assessment were not cited as part of a school safety inspection, they are strictly for the use of the assessment report.

DRAFT

PLUMBING

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
Site Utilities							
	Backflow Preventer		3				
	Water Service Piping		3				
Roofing							
	Roof Drains (piping)		3				
Toilet Rooms							
	Toilet Partitions		3				
General							
	Custodial Closets (Mop Sinks)		3				
	Laboratory Sinks		3				
	Eyewash / Emerg. Shower (Tepid Water)		3				
	Showers (Self metering, Shutoff)					N/A	
	Kitchen (POU Grease, Interceptor)		3				
	Grease (Indoor/outdoor, Interceptor)		3				
	Water Fountains (Self contained water cooler, bubbler)		3				
	Sewer Ejector systems					N/A	
	Dilution Tanks (Science Classrooms/Neutralization tanks)					N/A	
	DWV					N/A	
Restrooms							
	Water Closets		3				
	Urinals		3				
	Lavatories / Sinks		3				
Water Distribution							
	Water Distribution Piping		3				
	Water Heaters (Separate from Bldg. Heating / Kitchen)		3				
	Water Meter		3				
Food Service							
	SS Sinks		3				
	Mop Sinks		3				

DRAFT

PLUMBING

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
	Water and Drains		3				
Domestic Water Heating							
	Dedicated Heater for Kitchen		3				
	Recirculation Pump (Operating- Yes/No)		3				

***Any violations reported in this school assessment were not given to the facility as violations to be corrected in order to maintain the certificate of occupancy for the facility. Any violations reported in this school assessment were not cited as part of a school safety inspection, they are strictly for the use of the assessment report.

DRAFT

BOILER

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

Heating Plant

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
	Boilers (Age, Fuel Type, Input/Output)		3				
	Pumps (VFD / Sound / Suction Pressure)		3				
	Plant Piping & Valves (Corroded/Isolation Valves)		3				Small Leak

***Any violations reported in this school assessment were not given to the facility as violations to be corrected in order to maintain the certificate of occupancy for the facility. Any violations reported in this school assessment were not cited as part of a school safety inspection, they are strictly for the use of the assessment report.

DRAFT

ELEVATOR

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use - end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

Elevator State Serial Number: 044681

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
	Machine Room Equipment		3				
	Door Operators and Operating Equipment		3				
	Interior Cab / Signage / Emerg. Phone		3				
	Hoistway Pit		3				
	Landing Fixtures		3				
	Operating Condition		3				
	Ropes / Hoisting Equipment		3				
	Hoistway Equipment		3				
	Fire and Emergency Service		3				

***Any violations reported in this school assessment were not given to the facility as violations to be corrected in order to maintain the certificate of occupancy for the facility. Any violations reported in this school assessment were not cited as part of a school safety inspection, they are strictly for the use of the assessment report.

DRAFT

ELECTRICAL

4	NEW	New or like-new condition; no issues to report; no expected failures	No issues / violations or adverse conditions / less than 3 years old	Jesse Loomis Elementary School	SCHOOL NAME
3	GOOD	Good condition; no reported issues or concerns	No issues / violations or adverse conditions other than new	2001 Limerick St., Saginaw, MI	ADDRESS
2	FAIR	Average wear for building age; not new but no issues	Violations-90 days	2006	BUILDING
1	POOR	Worn from use -end of expected lifecycle	Violations-45 days	2/21/2017	SURVEY DATE
0	CRITICAL	Extremely worn or damaged	Violations / Imminent danger or inoperable	Mike Holsinger & Todd Perry	SURVEYOR

		4	3	2	1	0	COMMENTS / RECOMMENDED ACTION
Electrical Supply							
	Service Switchgear/Electrical Service (Observed Condition)		3				
	District-owned Site Transformers (Observed Condition)		3			N/A	
	Motor Control Centers		3				
Electrical Distribution							
	Equipment		3				
	Panelboards (Condition & Capacity)		3				
	Feeders (Observed Condition)		3				
	Devices (Switches & Receptacles)		3				
	TSS - Surge Suppression					N/A	
	Transformers					N/A	
Lighting							
	Classroom (Instructional)		3				
	Corridor / Common Areas		3				
	Restrooms		3				
	High Bay Areas		3				
	Emergency (Condition & Code Compliance)		3				
	Exterior Perimeter (Building Mounted)		3				
	Lighting Controls (Building Level)		3				
Other							
	Kitchen Equipment Supply		3				
	Emergency Generator (Observed Condition)		3				
	Intercom / PA Systems (Observed Condition)		3				
	Fire Alarm System (Observed Condition)		3				

***Any violations reported in this school assessment were not given to the facility as violations to be corrected in order to maintain the certificate of occupancy for the facility. Any violations reported in this school assessment were not cited as part of a school safety inspection, they are strictly for the use of the assessment report.

DRAFT

Appendix C: SCHOOL QUALITY MAPS

DRAFT

Jessie Loomis: Qualified Schools Whithin 10 Miles

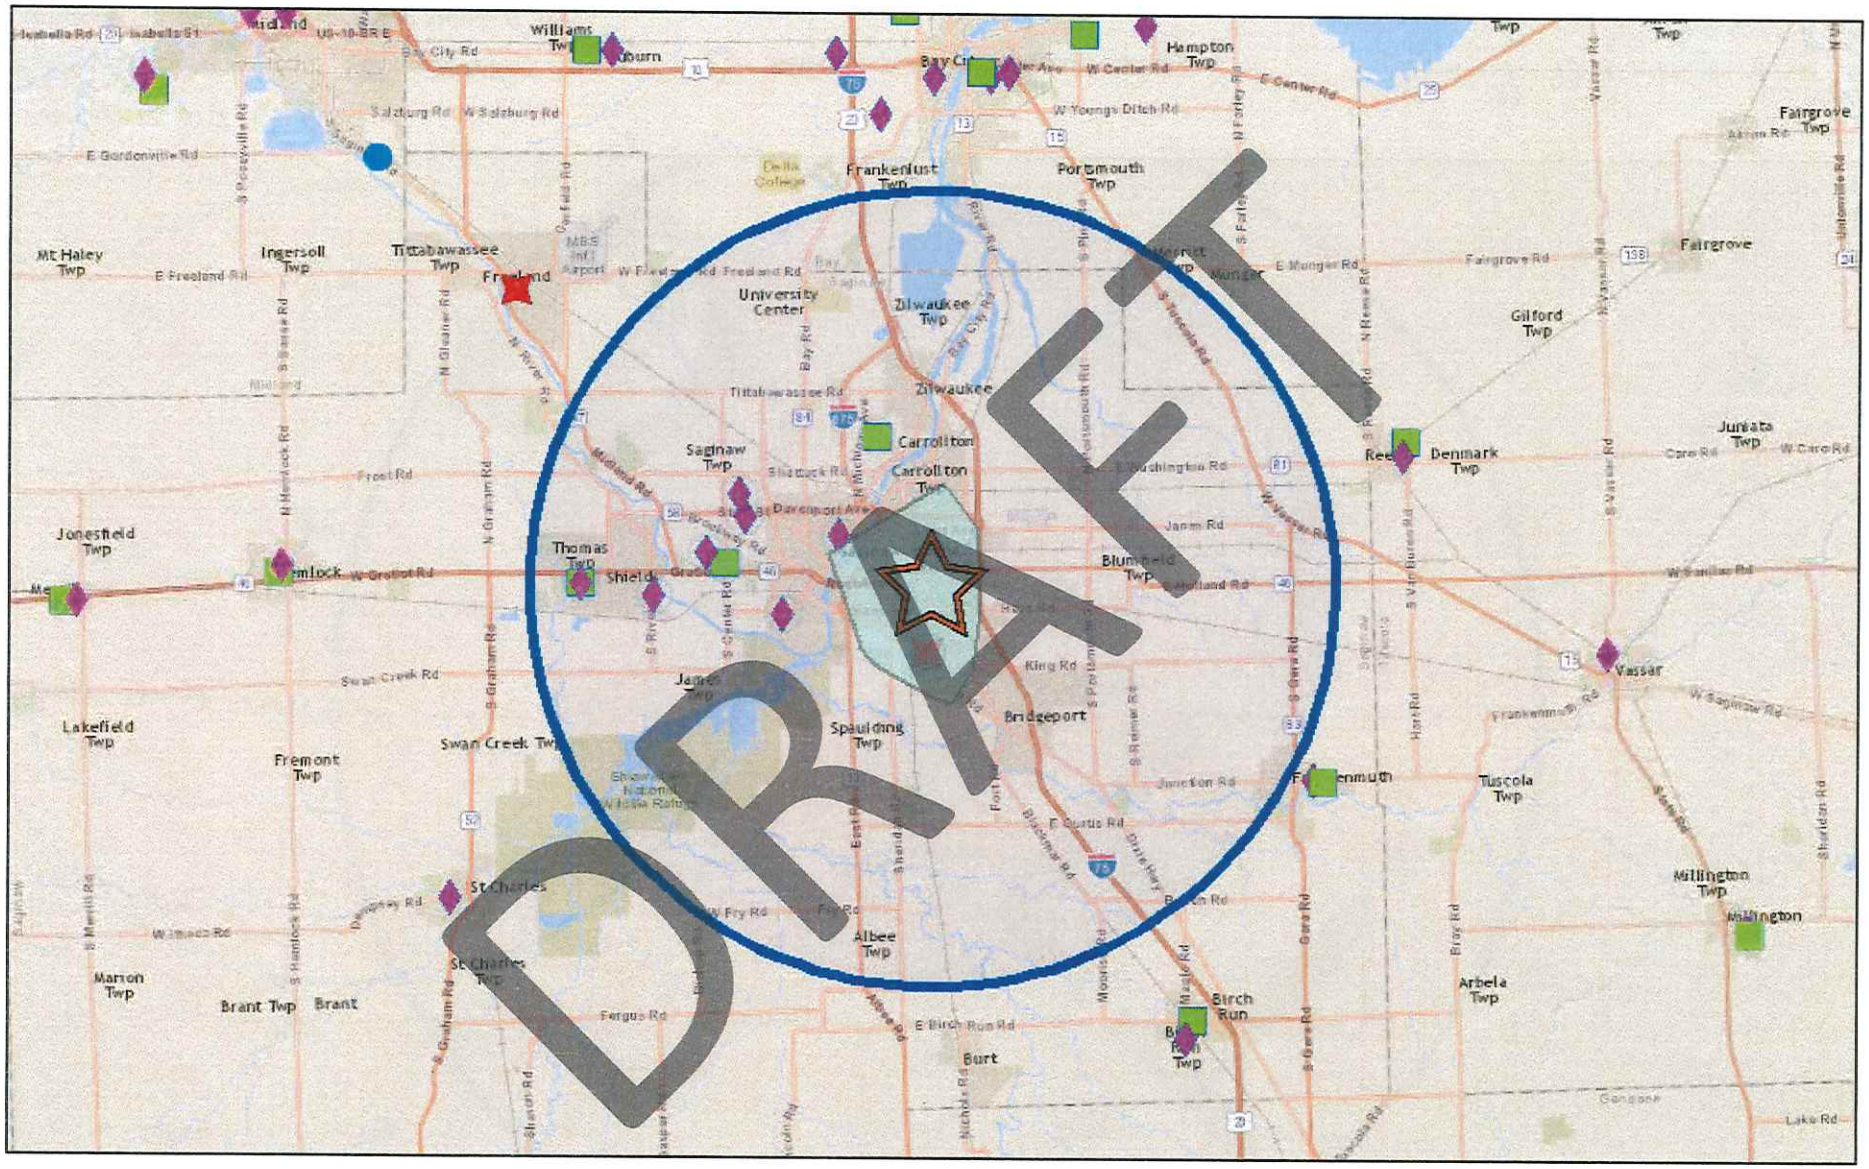

February 18, 2017

Est. Service Area

Schools

Elementary School

ES-MS

Middle School

Most Grades (PK-12)

Selected School: Jessie Loomis School

0 2.5 5 10 mi

0 4 8 16 km

Sources: Esri, HERE, DeLorme, USGS, Intermap, INCREMENT P, NRCan, Esri Japan, METI, Esri China (Hong Kong), Esri Korea, Esri (Thailand),

Area Schools radius: 10 Miles | Map: State of Michigan - CSS (2017©)

Jessie Loomis: Qualified Schools Whithin 15 Miles

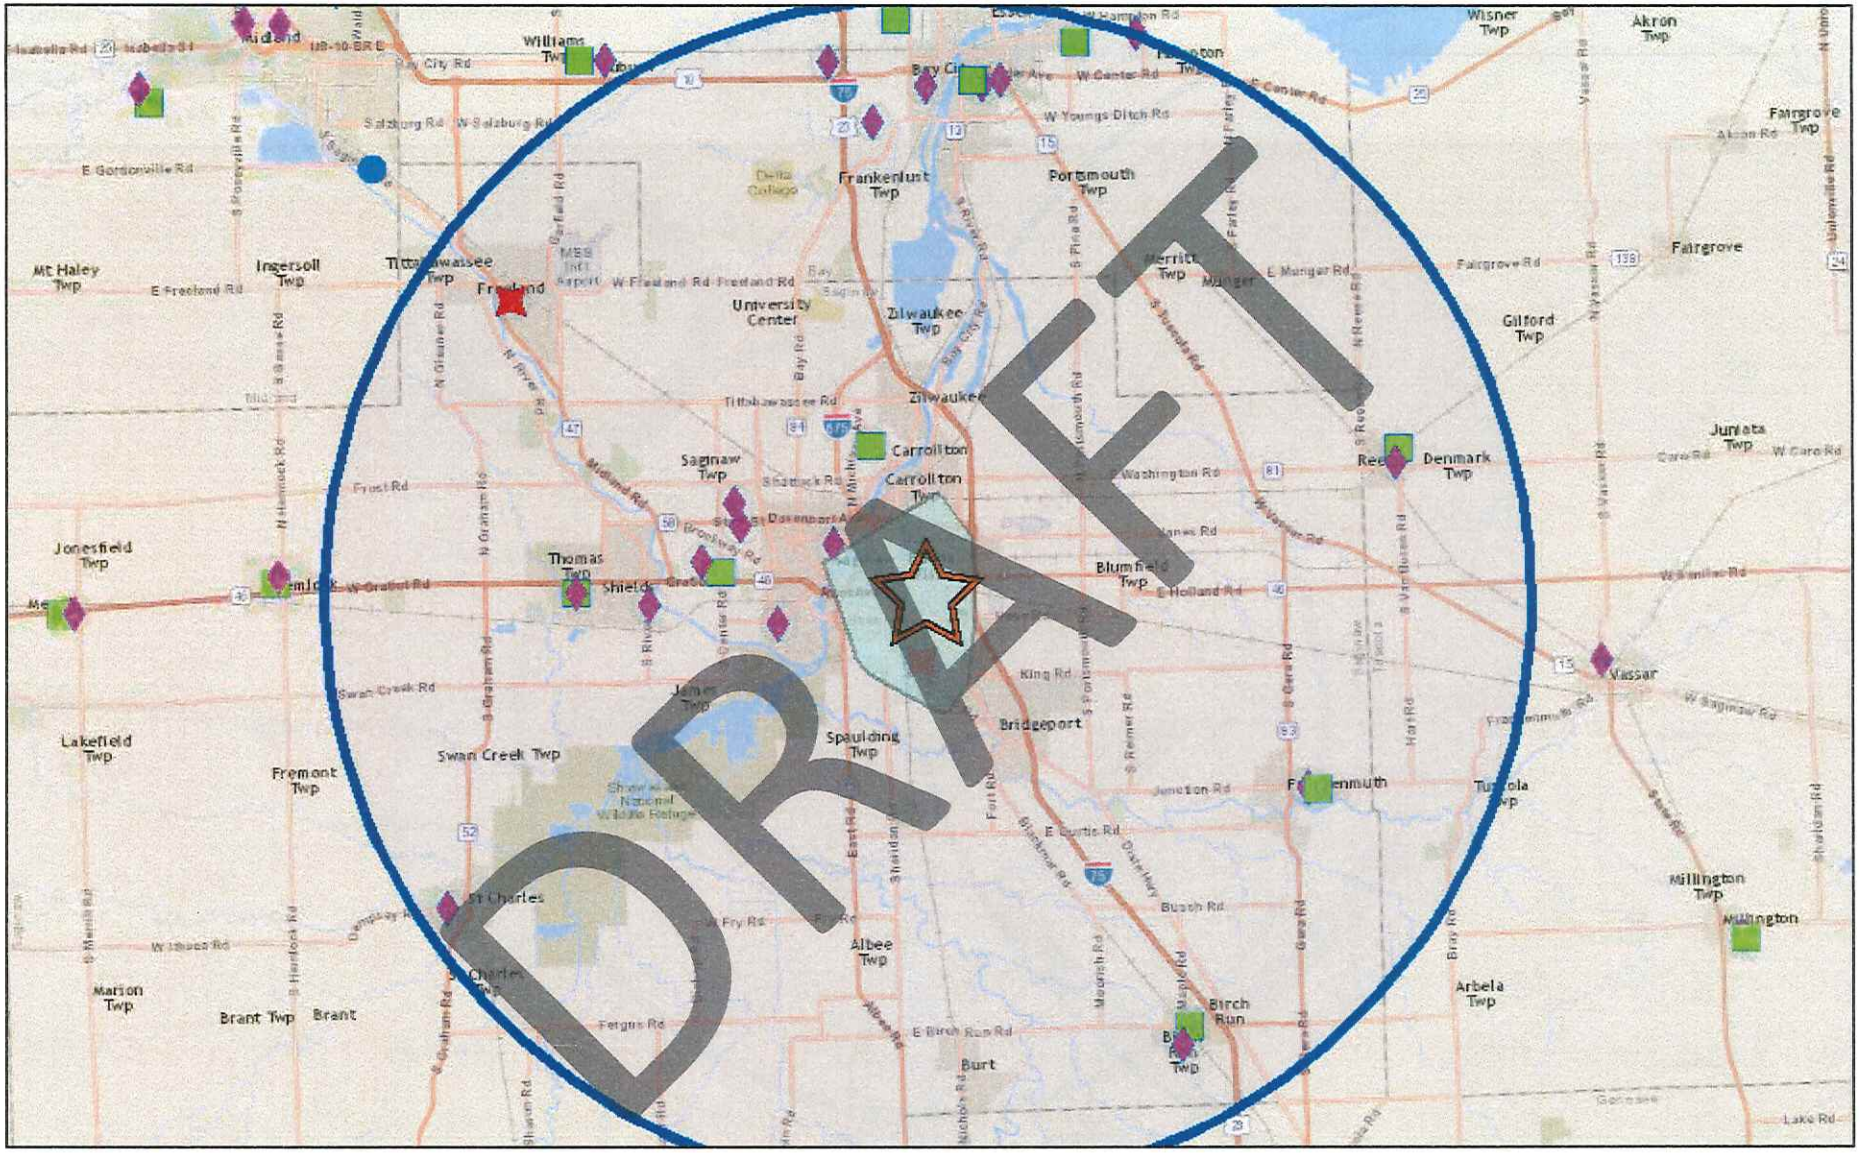

February 18, 2017

Est. Service Area

Schools

Elementary School

ES-MS

Middle School

Most Grades (PK-12)

Selected School: Jessie Loomis School

0 2.5 5 10 mi

0 4 8 16 km

Sources: Esri, HERE, DeLorme, USGS, Intermap, INCREMENT P, NRCan, Esri Japan, METI, Esri China (Hong Kong), Esri Korea, Esri (Thailand),

Area Schools radius: 15 Miles | Map: State of Michigan - CSS (2017©)

Jessie Loomis: Qualified Schools Whithin 20 Miles

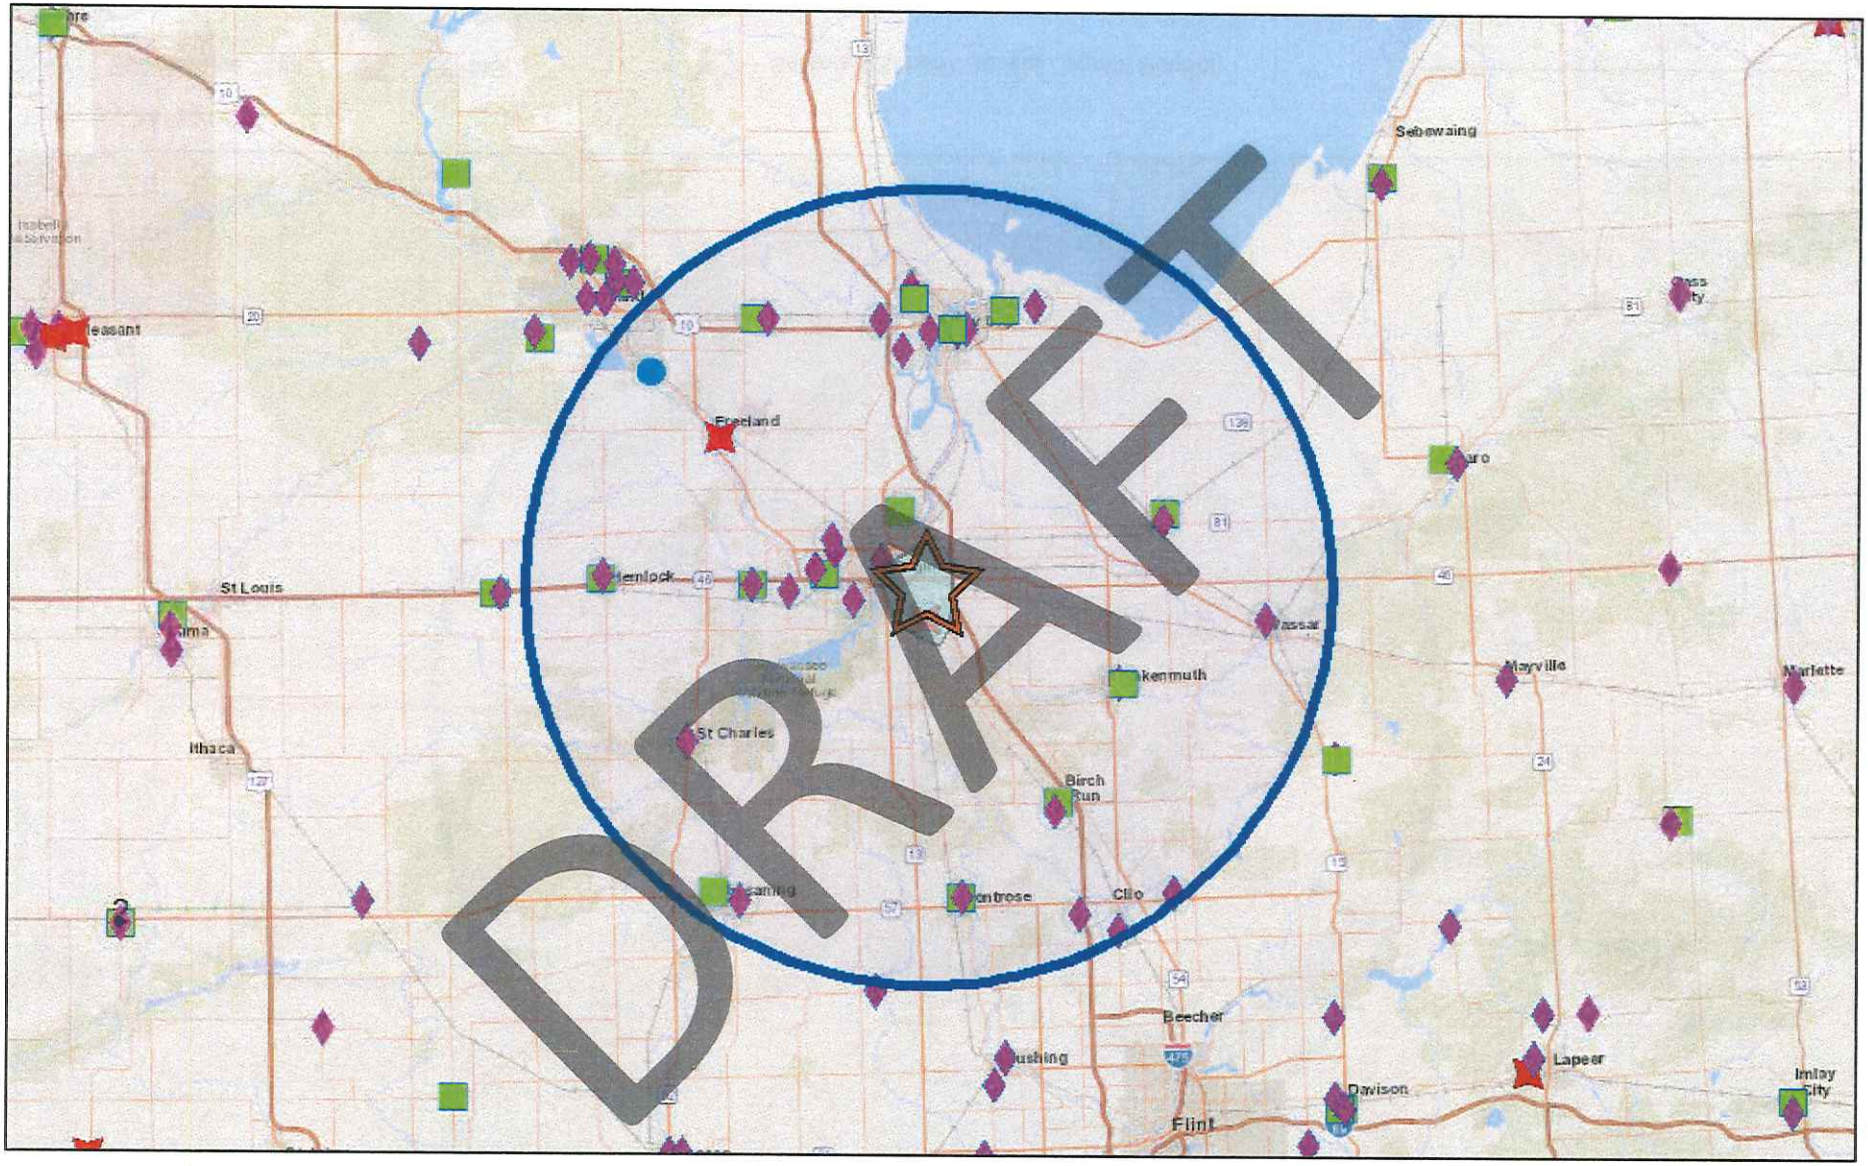

February 18, 2017

Est. Service Area

Schools

Elementary School

ES-MS

Middle School

Most Grades (PK-12)

Selected School: Jessie Loomis School

0 5 10 20 mi

0 5 10 20 km

Sources: Esri, HERE, DeLorme, USGS, Intermap, INCREMENT P, NRCan, Esri Japan, METI, Esri China (Hong Kong), Esri Korea, Esri (Thailand).

Area Schools radius: 20 Miles | Map: State of Michigan - CSS (2017©)

Jessie Loomis: Qualified Schools Whithin 25 Miles

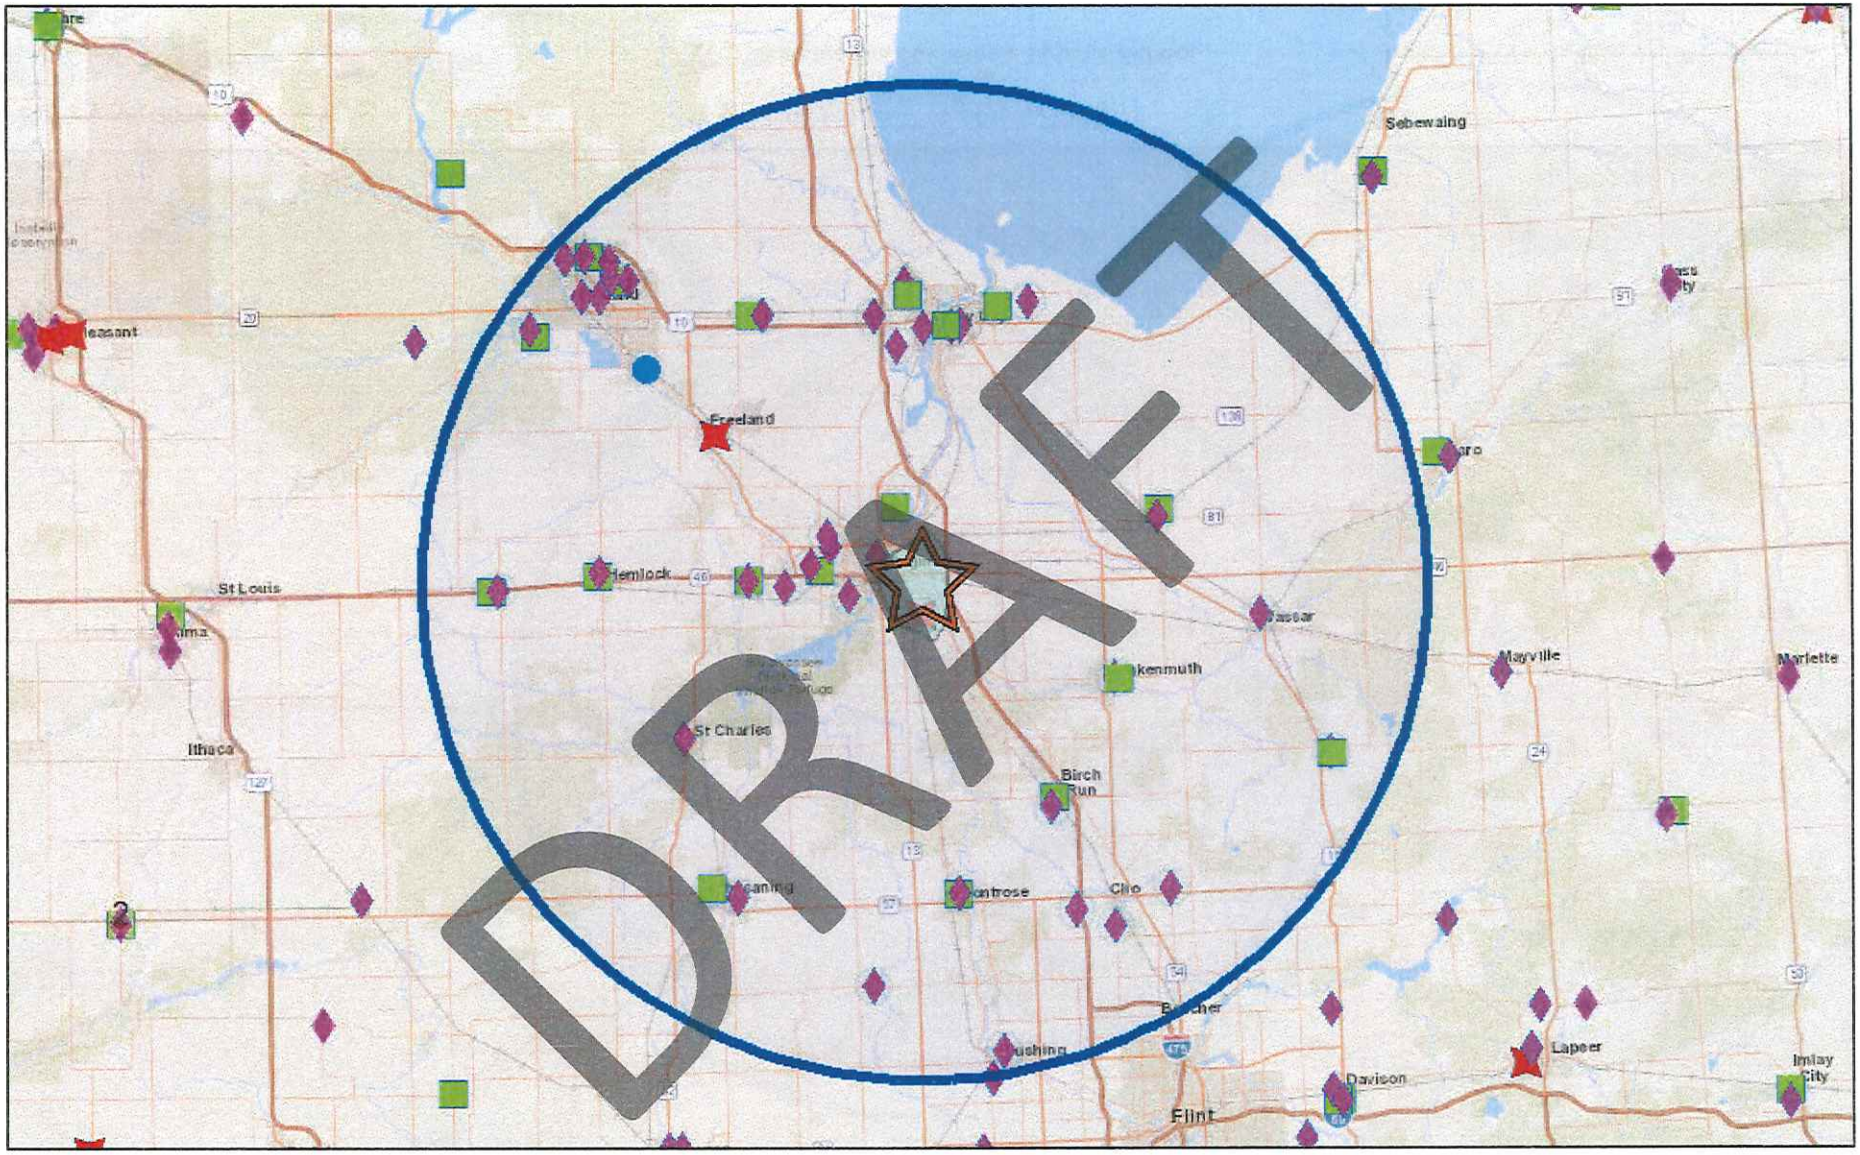

February 18, 2017

Est. Service Area

Schools

Elementary School

ES-MS

Middle School

Most Grades (PK-12)

Selected School: Jessie Loomis School

0 5 10 20 mi

0 5 10 20 km

Sources: Esri, HERE, DeLorme, USGS, Intermap, INCREMENT P, NRCan, Esri Japan, METI, Esri China (Hong Kong), Esri Korea, Esri (Thailand).

Area Schools radius: 25 Miles | Map: State of Michigan - CSS (2017©)

Jessie Loomis: Qualified Schools Whithin 30 Miles

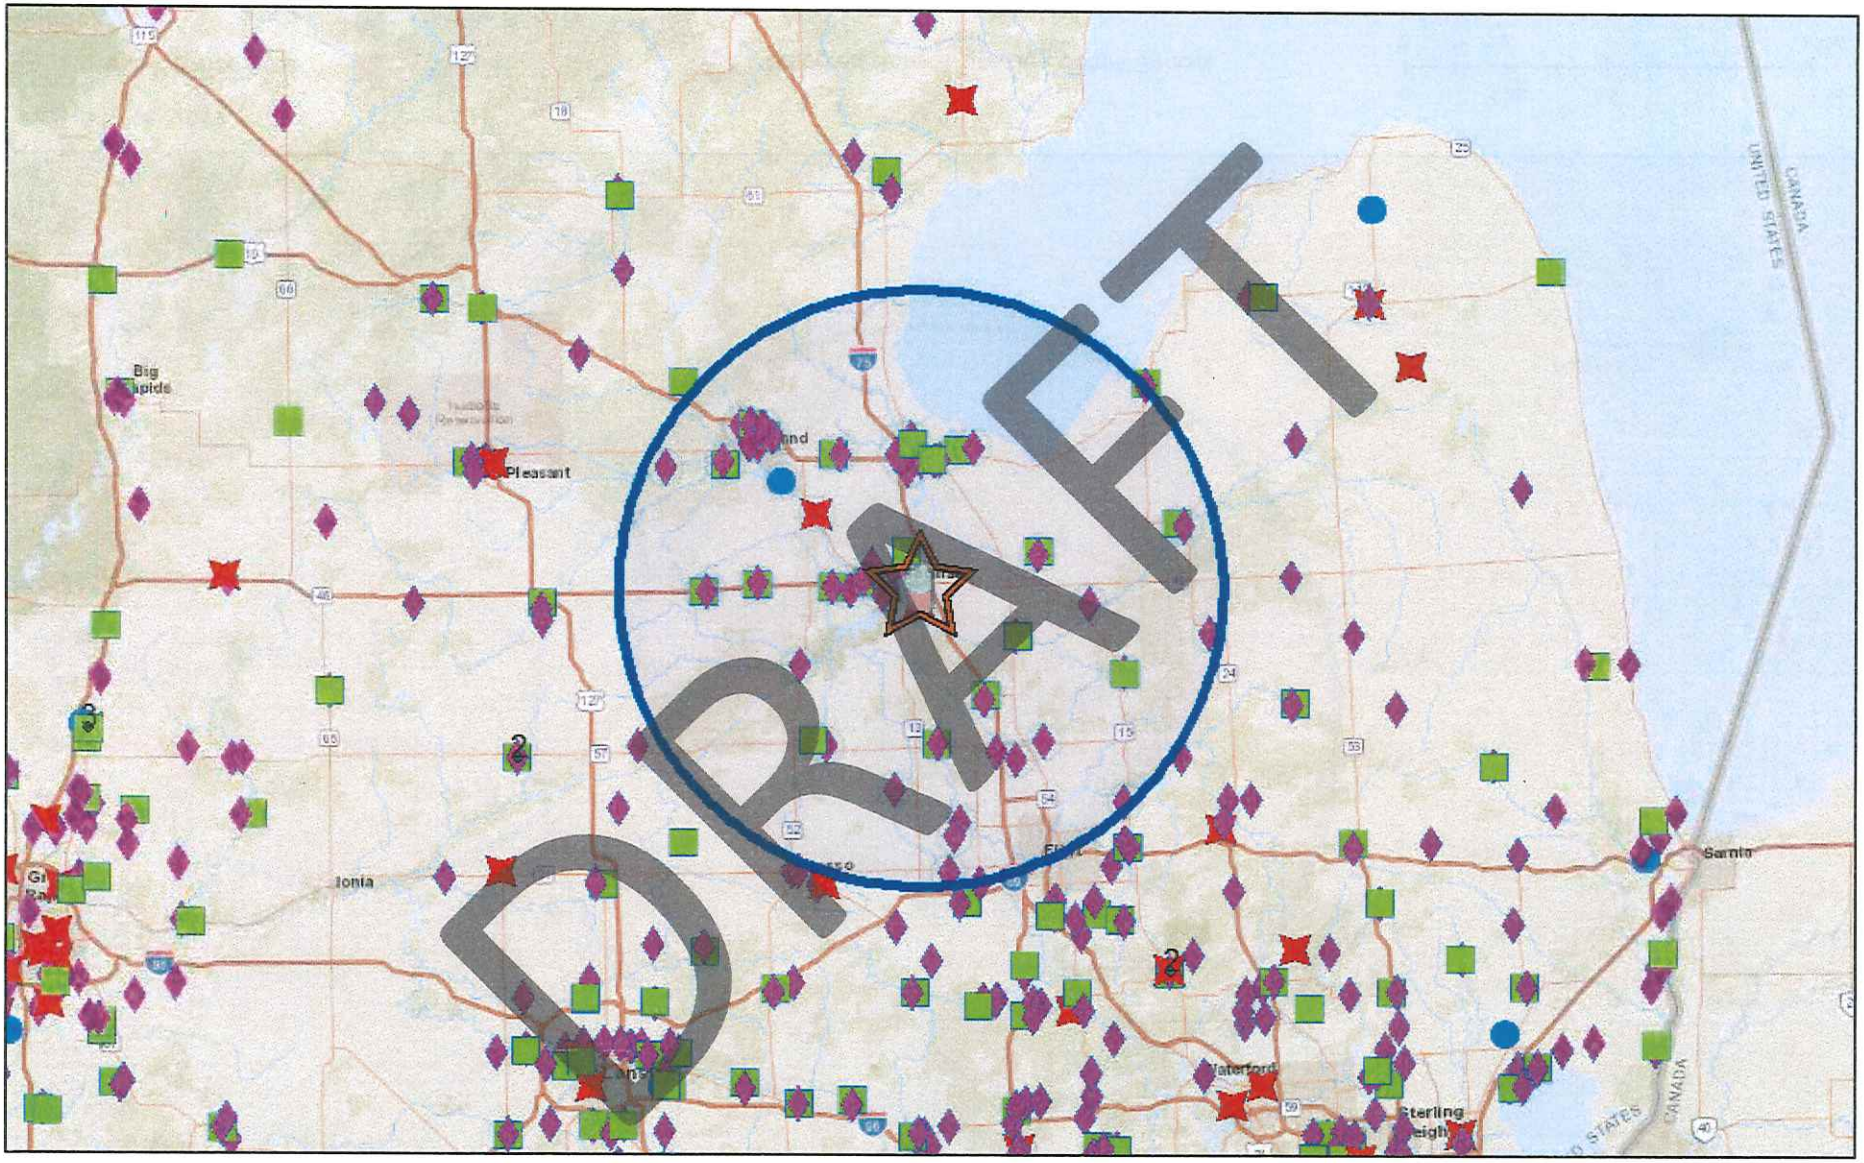

February 18, 2017

Est. Service Area

Schools

Elementary School

ES-MS

Middle School

Most Grades (PK-12)

Selected School: Jessie Loomis School

0 10 20 40 mi

0 15 30 60 km

Sources: Esri, HERE, DeLorme, USGS, Intermap, INCREMENT P, NRCan, Esri Japan, METI, Esri China (Hong Kong), Esri Korea, Esri (Thailand),

Area Schools radius: 30 Miles | Map: State of Michigan - CSS (2017©)

Jessie Loomis: Qualified Schools Whithin 5 Miles

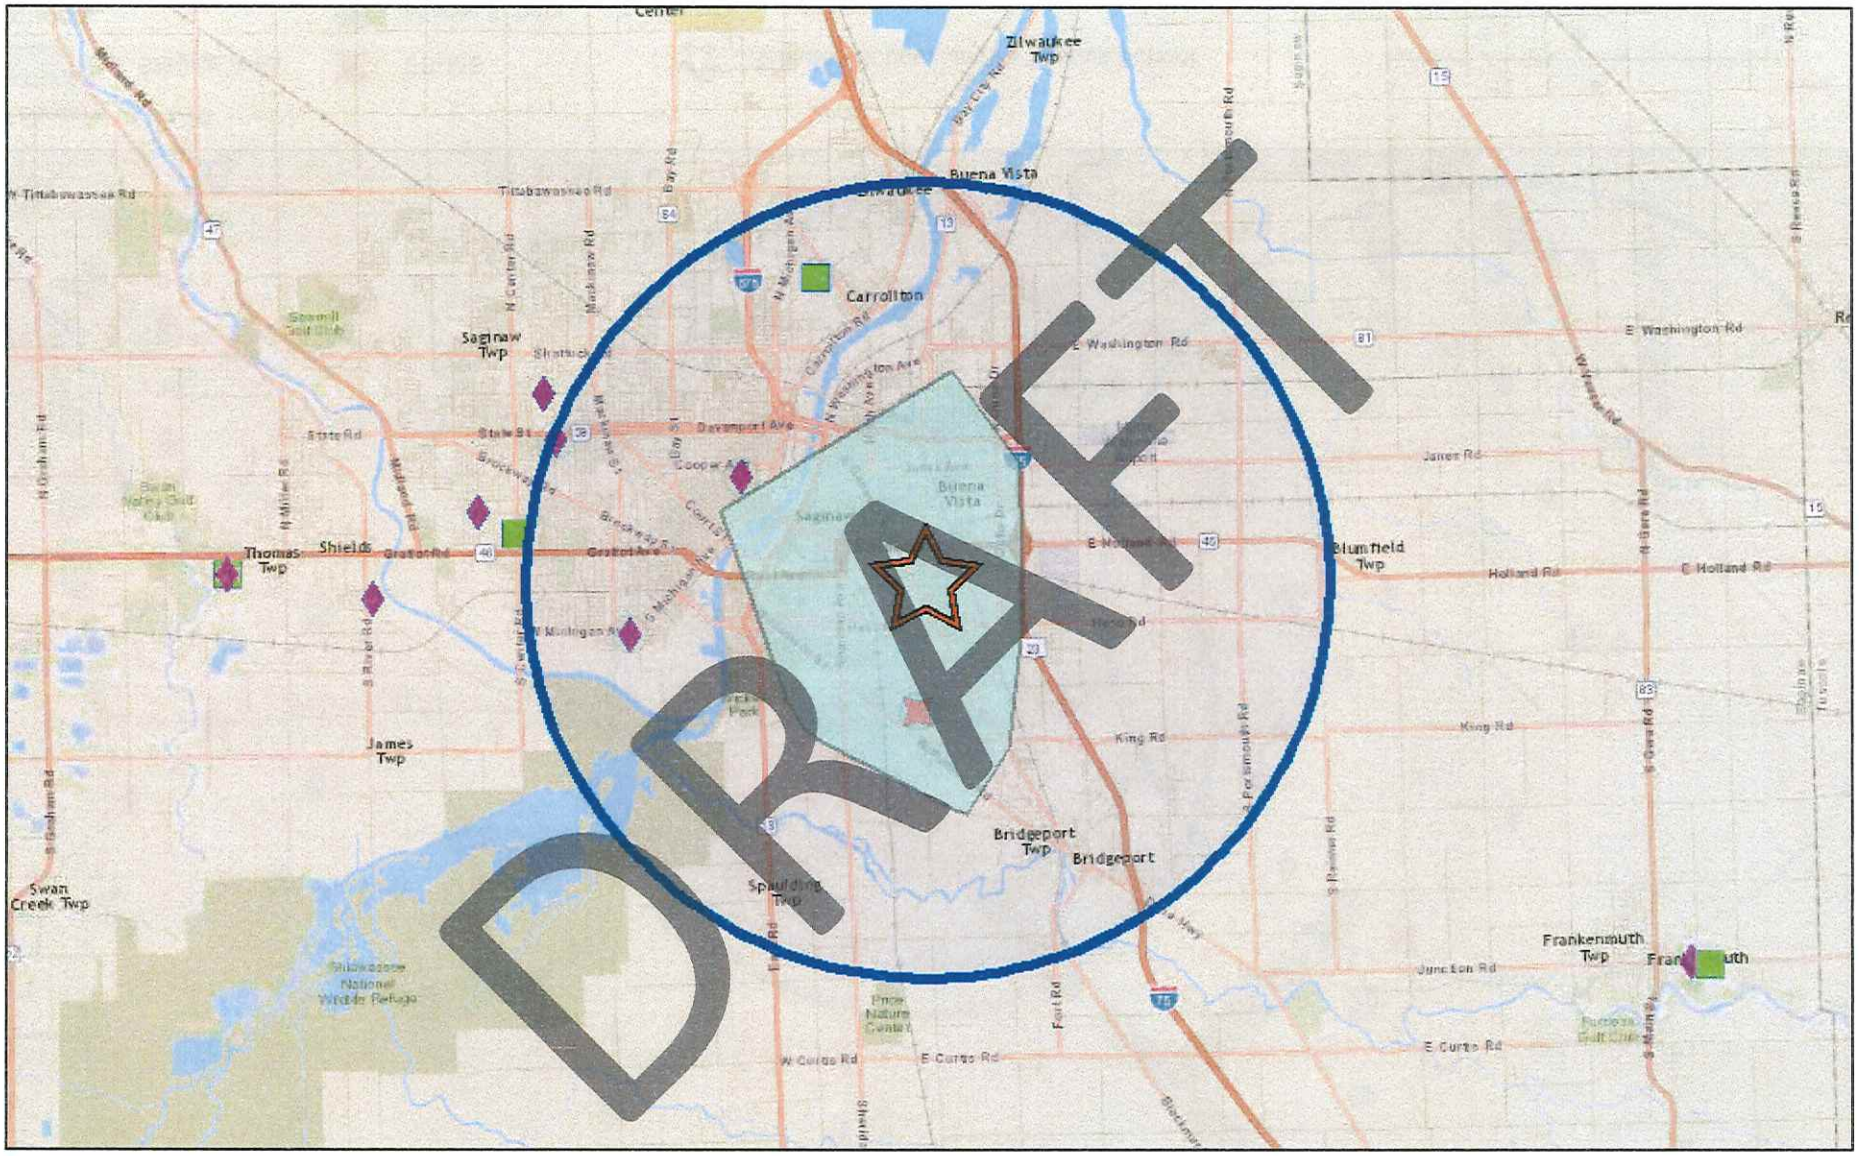

February 18, 2017

Est. Service Area

Schools

Elementary School

ES-MS

Middle School

Most Grades (PK-12)

Selected School: Jessie Loomis School

0 1.25 2.5 5 mi

0 2 4 8 km

Sources: Esri, HERE, DeLorme, USGS, Intermap, INCREMENT P, NRCan, Esri Japan, METI, Esri China (Hong Kong), Esri Korea, Esri (Thailand),

Area Schools radius: 5 Miles | Map: State of Michigan - CSS (2017©)

Appendix D: Financial Impact

DRAFT

Appendix D: Financial Impact

Schools Identified for the Next Level of Accountability Outstanding Obligations			
Saginaw			
Loan Type		**Loan Balance**	**Maturity**
SAN 2016 C-3		$7,000,000.00	8/21/2017
	Total	$7,000,000.00	
Long Term		$253,150.42	
2016 PSA SAN D-1		$475,155.87	8/21/2017
	Total	$728,306.29	

Source: Michigan Department of Treasury via the Michigan Finance Authority

Appendix D: Financial Impact *(continued)*

Schools' Potential Losses from School Closures						
Saginaw						
Schools	**Allowance**	**Student Count (Losing)**	**Foundation (Losing)**	**Student Count (Total)**	**Foundation (Total)**	**% of Foundation**
Saginaw High School	$ 7,511.00	580.00	$ 4,356,380.00	6,151.35	$ 46,202,789.85	9.43%
Jessie Loomis Schoool	$ 7,511.00	415.00	$ 3,117,065.00	6,152.35	$ 46,210,300.85	6.75%
TOTAL	$ 7,511.00	995.00	$ 7,473,445.00	6,152.35	$ 46,210,300.85	16.17%
Saginaw 2016 Federal Revenues	**General Fund**	$ 14,956,297.54				
	Food Service	$ 4,672,788.38				
	Total	$ 19,629,085.92				

Source: Michigan Department of Treasury